

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

|                                                                                                     |
|-----------------------------------------------------------------------------------------------------|
| WELL API NO.<br>30-025-26057                                                                        |
| 5. Indicate Type of Lease<br>STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/> |
| 6. State Oil & Gas Lease No.                                                                        |
| 7. Lease Name or Unit Agreement Name<br>Myers Langlie Mattix Unit                                   |
| 8. Well No.<br>#52                                                                                  |
| 9. Pool name or Wildcat<br>Langlie Mattix 7R Queen GB                                               |
| 10. Elevation (Show whether DF, RKB, RT, GR, etc.)                                                  |

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

|                                                                                                          |
|----------------------------------------------------------------------------------------------------------|
| 1. Type of Well:<br>OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER |
| 2. Name of Operator<br>Texaco Exploration & Production Inc.                                              |
| 3. Address of Operator<br>P.O. Box 730, Hobbs, NM 88241-0730 505-393-7191                                |

|                                                                                                                                                          |
|----------------------------------------------------------------------------------------------------------------------------------------------------------|
| 4. Well Location<br>Unit Letter B : 710 Feet From The North Line and 1980 Feet From The East Line<br>Section 33 Township 23-S Range 37-E NMPM Lea County |
|----------------------------------------------------------------------------------------------------------------------------------------------------------|

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

|                                                |                                                      |
|------------------------------------------------|------------------------------------------------------|
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input checked="" type="checkbox"/> |
| TEMPORARILY ABANDON <input type="checkbox"/>   | CHANGE PLANS <input type="checkbox"/>                |
| PULL OR ALTER CASING <input type="checkbox"/>  |                                                      |
| OTHER: <input type="checkbox"/>                |                                                      |

SUBSEQUENT REPORT OF:

|                                                     |                                               |
|-----------------------------------------------------|-----------------------------------------------|
| REMEDIAL WORK <input type="checkbox"/>              | ALTERING CASING <input type="checkbox"/>      |
| COMMENCE DRILLING OPNS. <input type="checkbox"/>    | PLUG AND ABANDONMENT <input type="checkbox"/> |
| CASING TEST AND CEMENT JOB <input type="checkbox"/> |                                               |
| OTHER: <input type="checkbox"/>                     |                                               |

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) Inform NMOCD 24 hours prior to commencement of plugging.
- 2) MIRU. Install bop. TIH with work string.
- 3) Tag CIBP. Load hole with salt gel mud; 10# brine and 25# gel/ Bbl.
- 4) Pump 14 sx class 'C' cement from 2389'-2489'. WOC. Tag plug.
- 5) Pump 14 sx class 'C' cement from 1120'-1220'. WOC. Tag plug.
- 6) Pump 14 sx class 'C' cement from 462' - 562'. WOC. Tag plug.
- 7) Pump 7 sx class 'C' cement from 50' - surface.
- 8) Cutoff wellhead and install marker. Clean location.
- 9) Restore surface as per state requirements.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Robert McNaughton TITLE Production Engineer DATE 3-31-92  
TYPE OR PRINT NAME Robert McNaughton TELEPHONE NO. 397-0428

(This space for State Use) ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT I SUPERVISOR

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

MAR 31

**PO-113**

**RECOMMENDATION FOR ABANDONMENT**

MLMU #52

MLMU #52  
Langlie-Mattix Queen Sand


Sec 33. T23S. R37E.

Unit B, 710FNL, 1980FWL  
3288' GL

Langlie-Mattix Queen Sand  
6-28-90

Revised 3-31-92

**CURRENT WELL DRAWING**

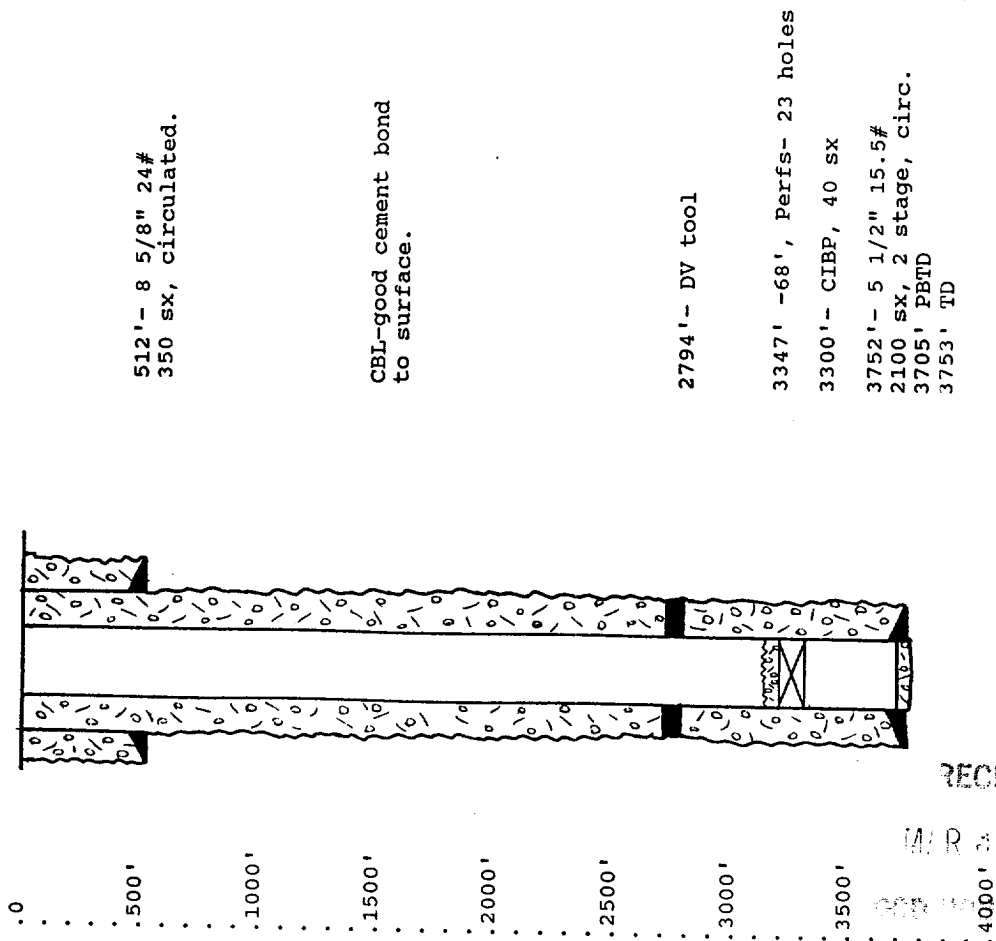

RECEIVED

MAR 31 1992

**00000000**

## PROPOSED PLUGGING OPERATION

