

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1940, Hobbs, NM 88240

DISTRICT II
P.O. Drawer 00, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
3002511185

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name

Shell Black

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Mack Energy Corporation

8. Well No. 2

3. Address of Operator
P.O. Box 960, Artesia, NM 88211

9. Pool name or Wildcat
Jalmat Tansill Yates 7 Rvs Progas

4. Well Location
Unit Letter 0 : 1980 Feet From The East Line and 660 Feet From The South Line
Section 21 Township 24S Range 37E NMMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐


12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-31-02 Move in & rig up, POOH w/ rods.

11-01-02 POOH w/ 2-3/8" production pipe, tag PBTD @ 3086', spot 25 sx cmt. @ 2800' WOC.

11-04-02 Tag cmt. plug @ 2860', re-spot 25 sx cmt. @ 2800' (suggested by Gonzales) w/ 2% CaCl₂ WOC tag plug @ 2640'. Mud up hole. Spot 25 sx @ 2340' perf. 4 holes @ 1500', sqz. 35 sx cmt.

11-05-02 Tag plug @ 1385', spot 25 sx @ 1205'. Perf 4 holes @ 197' surface. RDMO. Cut off wellhead, install dry hole marker, clean location.

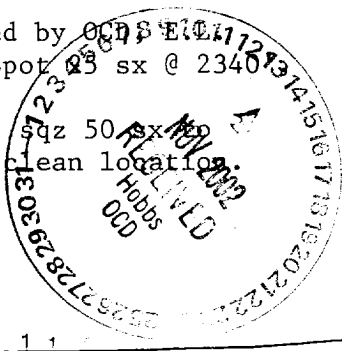

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Crissa D. Carter TITLE Production Analyst DATE 11/12/2002

TYPE OR PRINT NAME Crissa D. Carter

TELEPHONE NO. (505) 7481288

(This space for State Use)

APPROVED BY Samuel Hill TITLE CWW

CONDITIONS OF APPROVAL IF ANY:

FEB 12 2003

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980
DISTRICT II
P.O. Drawer DD, Artesia, NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 3002511185
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Shell Black
8. Well No. 2
9. Pool name or Wildcat Jalmat Tansill Yates 7 Rvs Progas

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER	
2. Name of Operator Mack Energy Corporation	
3. Address of Operator P.O. Box 960, Artesia, NM 88211	
4. Well Location Unit Letter 0 : 1980 Feet From The East Line and 660 Feet From The South Line Section 21 Township 24S Range 37E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPNS. ☐
WELL OR ALTER CASING ☐	CASING TEST AND CEMENT JOB ☐
OTHER: ☐	OTHER: ☐
PLUG AND ABANDON ☒	ALTERING CASING ☐
CHANGE PLANS ☐	PLUG AND ABANDONMENT ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU.
2. Tag PBTD @ 3086'.
3. Circulate hole w/ 9.5# MLF.
4. Spot 25 sx cmt. 2800-2700', WOC & tag.
5. Spot 25 sx cmt. 2340-2240'.
6. Perforate 6-5/8" csg. @ 1500', sqz w/ 35 sx 1500-1400', WOC & tag.
7. Spot 25 sx cmt. 1205-1105'.
8. Perforate 6-5/8" csg. @ 197', sqz perms w/ 50 sx cmt. & circulate cmt. to surface inside & outside.
9. RD, cut off wellhead & install dry hole marker, & clean location.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED

Verbal Approval From Gary Wink w/ NM OCD on 5-30-02

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Tony Hall* TITLE Supervisor DATE 5-31-02
TYPE OR PRINT NAME Tony Hall TELEPHONE NO. (505) 748-1288

(This space for State Use)

APPROVED BY _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: _____
ORIGINAL FILED BY _____ DATE _____
STATE MANAGER

JUN 05 2002