

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLI
(Other instructions
verse side)

TE*
re-

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. UNIT AGREEMENT NAME ---
2. NAME OF OPERATOR TEXACO Inc.		8. FARM OR LEASE NAME NCT-2
3. ADDRESS OF OPERATOR P. O. Box 728 - Hobbs, New Mexico 88240		9. WELL NO. 2
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 1980' FEL of S-35, T-24-S, R-37-E, Unit Letter J		10. FIELD AND POOL, OR WILDCAT Justis Ellsberry
14. PERMIT NO. Regular		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA S-35, T-24-S, R-37-E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3179' DF		12. COUNTY OR PARISH Lea
		13. STATE N. M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☒
(Other) ☐

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Perforated 2 7/8" casing w/1 JSPI @ 5043-5048', 5057-5061', w/1 JSPI @ 5064, 65, 66, 70 & 5072', w/1 JSPI @ 5077-5082', w/1 JSPI @ 5085', 87, 5103 & 5105', w/1 JSPI @ 5113-5122' w/1 JSPI @ 5142' & 5144' w/1 JSPI @ 5154-5160', w/1 JSPI @ 5166', w/1 JSPI @ 5194-5200', w/1 JSPI @ 5206, 08, 12 & 5214'.
2. Frac casing perforations 5043-5518' w/25,000 gal lease crude w/1 HPG sand & 1/40 ppg Mark II Adomite in 5 - 5000 gal stages w/50 - 175# unleads & 250 gals acid between stages. Run temperature survey following each stage.
3. On 24 hr potential test ending 3-2-72. Flowed 22 barrels of 35° gravity oil, 5 barrels water, GOR 5680, 28/64 choke, 200# fbg pressure.

18. I hereby certify that the foregoing is true and correct

SIGNED

(This space for Federal or State office use)

TITLE Asst. Dist. Supt.

DATE 3-3-72

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

ACCEPTED FOR RECORD

MAR 8 1972

*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY
HOBBS, NEW MEXICO

Instructions


General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site abandoned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE : 1963—O-685229

8 47 - 485

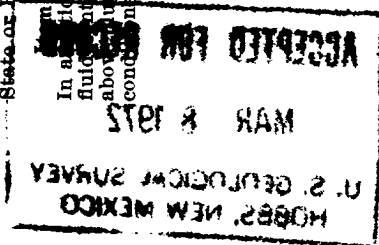

RECEIVED

MAR 14 1972

OIL CONSERVATION COMM.
HOBBES, N. M.