

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIP  
(Other instruction,  
verse side)

TE  
re

Form approved.  
Budget Bureau No. 1004 0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC-032579-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

HARRISON

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

LANGUE MATTHEW SR-DU-GB

11. SEC., T., R., M., OR BLM. AND  
SURVEY OR AREA

SEC. 23, T25S, R37E

12. COUNTY OR PARISH

LEA

13. STATE

NEW MEXICO

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

PENROCK OIL CORPORATION

3. ADDRESS OF OPERATOR

P.O. BOX 5970, HOBBS, NEW MEXICO 88241

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)

At surface

unit m  
330' FSL & 330' FWL OF SECTION 23, T25S, R37E  
LEA COUNTY, NEW MEXICO

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3065' DF

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON\*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any  
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-  
nent to this work.)

9 5/8" @ 1204' w/ 500 SXS.

7" @ 3200'; TD 3347

Proposed operations are to set CIBP @ 3100'. Dump 10 SXS.  
cement on top. Cut & pull 7" csg. @ 2100'.  
TAG PLUG.

Spot 50 SXS cement plug 2050'-2150'. Spot 50 SXS.  
TAG PLUG.

plug @ 9 5/8" csg shoe 10 SXS cement plug @ surface.  
50 FEET

Install dry hole marker. Clean location. Seed etc.

Implementing NMCI order # 9210

18. I hereby certify that the foregoing is true and correct

SIGNED

Whitcomb A. ...

TITLE

Resident

DATE

6/22/91

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

7-29-91

CONDITIONS OF APPROVAL, IF ANY:


NOTIFY BLM AT (505) 343-3612 PRIOR TO COMMENCING PLUGGING OPERATION.  
PLACE 9.0 PPY Gelled ... BETWEEN PLUGS.

\*See Instructions on Reverse Side

HARRISON NO. 1  
Sec. 23, T25S, R37E  
LEA COUNTY, NEW MEXICO

PRESENT

PROPOSED

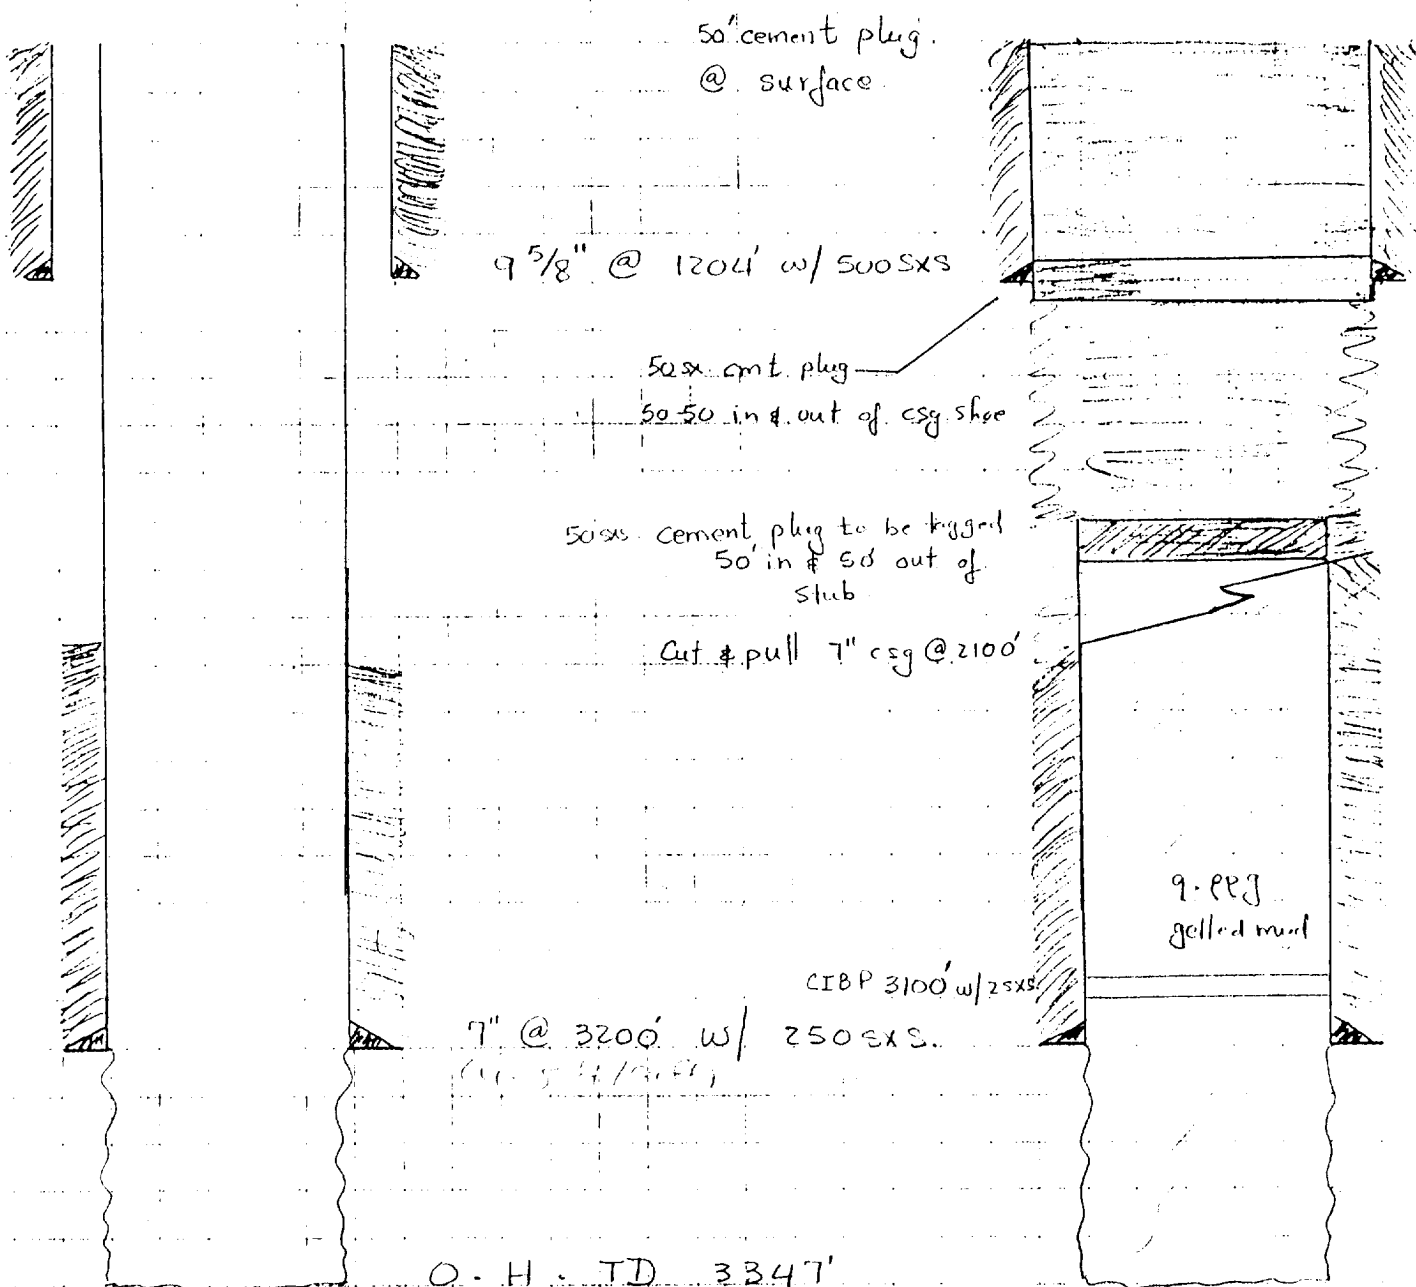

RECEIVED  
JUL 18 11 20 AM '91  
CARL  
AREA

REC.

JUL 31 1961

CH.  
MOBILE OFFICE