

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division

P.O. Box 1980
Hobbs, NM 88240

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT - " for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

ARCO Permian

3. Address and Telephone No.

P.O. Box 1710 Hobbs, N.M. 88240

505-394-1649

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UNIT LETTER K, 1980' FSL & 1650' FWL

SEC. 24-25S-37E

~~field EC-032650(B)~~

5. Lease Designation and Serial No.

LC-032650(B)

6. If Indian, Allottee or Tribe Name

~~field SOUTH JUSTIS UT~~

7. If Unit or CA, Agreement Designation

~~F-21~~

nmnm87877X

8. Well Name and No.

SOUTH
~~30-025-11734~~ F-21 JUSTIS unit

9. API Well No.

~~BLY TUBB DRILL~~ 30-025-11734

10. Field and Pool, or exploratory Area

~~LEA~~ Justis Bly Tubb Drk

11. County or Parish, State

NM, Lea

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other DD PERFS & ACIDIZE
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD: 7137' PBD: 6453' PERFS: 4980-5940'

02/22/97: POH W/2-7/8" TBG. WIH W/BIT,SUB,SCRAPER, & 2-7/8" WORKSTRING TO 4000'.

02/23/97: KILLED WELL W/100 BBLs 10# BRING. WIH W/BIT,SUB, SCRAPER & 2-7/8" TBG TO 6100'.

WIH W/4" GUNS AND PERF 1 SPF 4980-4997 & 4998', 10 HOLES, POH.

02/25/97: WIH W/PPI ASSEMBLY, SET PKRS @ 5000' & 5010'. PMP 1000 GALS 15% NEFE W/35 BBLs 2%


KCL FOR LFUSH. ACIDIZED EXISTING PERFS FROM 5001 TO 5940'. PUH AND SET PKRS @ 4990 & 5000'.

DROPPED S.V., PUMP 50 GA;S 15% NEFE HCL W/29 BBLs 2% KCL FLUSH. ACIDIZED NEW PERFS FROM

4980 TO 4998', POH. TESTING 2-7/8" TBG BIH @ 5000', SET @ 5900'.

02/27/97: PRESS UP TBG W/28 BBLs PRODUCED WTR TO 500', HELD OK.

~~UTP~~

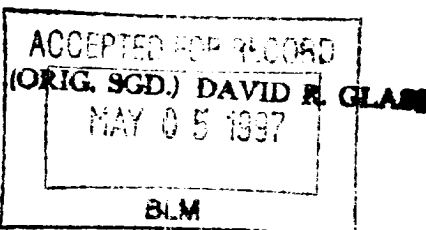

14. I hereby certify that the foregoing is true and correct

Signed

David R. Glass

Title

Admin. Asst.

Date

4-28-97
WORKSTRING TO
4000'

(This space for Federal or State office use)

~~02/22/97: POH W/2-7/8" TBG.~~
WIH W/BIT,SUB,SCRAPER, & 2-7/8"

Approved by

Title

Date

Conditions of approval, if any: