

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLI
(Other instructions
verse side)

E*
re-

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.
LC 032650 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

A. B. Coates "C"

9. WELL NO.

12

10. FIELD AND POOL, OR WILDCAT

Justis Drinkard-Fusselman

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 24, 25E, 37E

1. ☒ OIL
WELL ☐ GAS
WELL ☐ OTHER

2. NAME OF OPERATOR

Tidewater Oil Company

3. ADDRESS OF OPERATOR

Box 249, Hobbs, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1930' FSL and 1650' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

30' 4" DF

12. COUNTY OR PARISH

Lea

13. STATE

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) **Install Gas Lift Valves**

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This is a dual Fusselman-Drinkard oil completion. The Fusselman zone has ceased to flow due to water encroachment. We propose to install gas lift valves as follows: Kill well, pull both tubing strings. Run 595' of long string tail pipe with 3' of extra Model E seals w/o anchor assembly, run Baker Model A-5 dual packer, switch over to short string side of selective head and finish in hole with CS Hydril. Locate on Model D packer, then pick up 3' and land short string. Run short string with gas lift valves. Put 10-12,000# weight on dual packer, pump in long string and set dual hydrostatic packer. Take 7-8,000# off long string and space out.

18. I hereby certify that the foregoing is true and correct

SIGNED **Original Signed By** TITLE **Area Supt.**

DATE **3-29-66**


O. L. WADE
(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

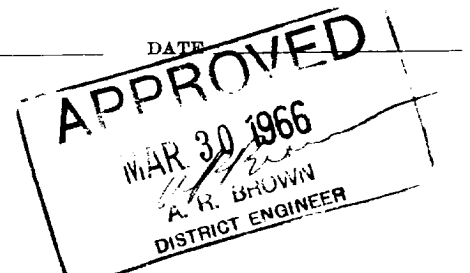

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

APR 2 11 11 AM '88
U.S. GOVERNMENT PRINTING OFFICE