

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)		
1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		7. Unit Agreement Name
2. Name of Operator Atlantic Richfield Company		8. Farm or Lease Name Wimberly WN
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240		9. Well No. 2
4. Location of Well UNIT LETTER <u>C</u> , <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>24</u> TOWNSHIP <u>25S</u> RANGE <u>37E</u> NMPM.		10. Field and Pool, or Wildcat Justis Fusselman
15. Elevation (Show whether DF, RT, GR, etc.) 3078' GR		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data		
NOTICE OF INTENTION TO:		
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	Justis Fusselman zone	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>		OTHER <input type="checkbox"/>
SUBSEQUENT REPORT OF:		
ALTERING CASING <input type="checkbox"/>		
PLUG AND ABANDONMENT <input type="checkbox"/>		

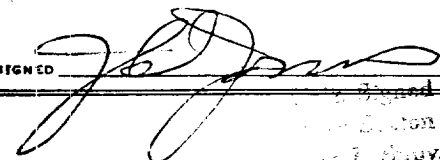

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

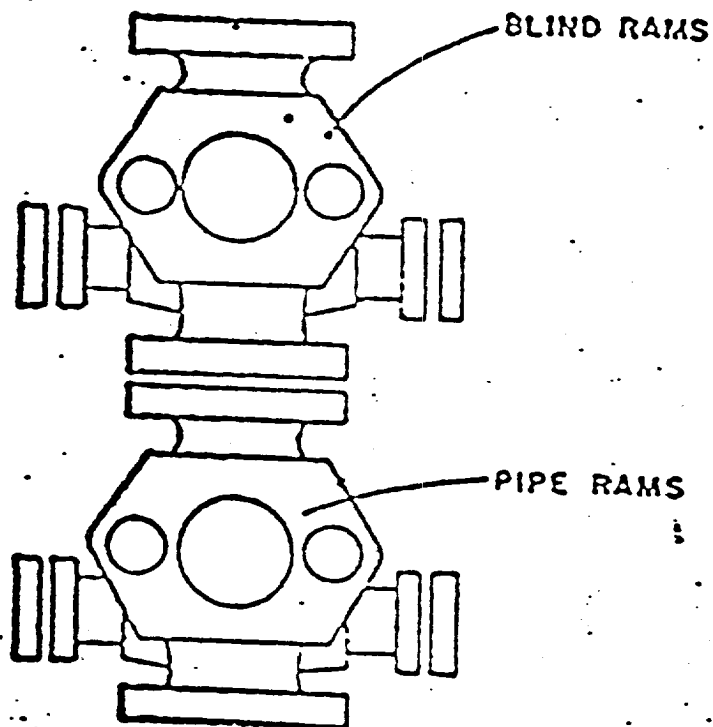
Propose to P&A the present Justis Fusselman perms 6655-6756' in the following manner:

1. Rig up, kill well & POH w/rods & tbg, install BOPs.
2. Run 7" cmt retr, set retr @ 6500'.
3. Pressure test 7" X 2-7/8" annulus to 1000# for 30 mins.
4. Squeeze Justis-Fusselman perms 6655-6756' w/100 bbls injectrol followed by 100 sx C1 C cmt cont'g .5% Halad 22 & 5# sd/sk. POH w/stinger.
5. GIH w/bit, drill out squeeze job, press test 7" csg to 1000#.

Note: Recompletion to the Justis Montoya zone submitted separately on Form C-101.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <u>Dist. Drlg. Supv.</u>	DATE <u>8/27/76</u>
APPROVED BY 	TITLE _____	DATE _____
CONDITIONS OF APPROVAL, IF ANY:		



ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name Wimberly WN

Well No. 2

Location 660' FNL & 1980' FWL
Sec 24-25S-37E, Lea County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.