

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLI
(Other instructions
reverse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC-034117 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

ARC Federal

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Jalmat Yates Gas

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

28-25S-37E

12. COUNTY OR PARISH

Lea

13. STATE

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL ☐ WELL GAS ☐ WELL OTHER ☐ Plug & Abandon

2. NAME OF OPERATOR

Atlantic Richfield Company

3. ADDRESS OF OPERATOR

P. O. Box 1710, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

1980' FSL & 1980' FWL (Unit letter K)

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3023' DF

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) Plug & Abandon ☒REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

RU 10/31/77, killed well w/10# brine wtr. Installed BOP & POH w/compl assy. RIH w/9-5/8" cmt retr, set @ 2240'. Squeeze cmtd Jalmat perms 2302-2395' w/80 sx Cl C cmt. PO of retr & dumped 18 sx cmt on top. Tagged cmt @ 2185'. Circ hole w/heavy brine gel. Spotted 50 sx cmt plug from 1120-970' FS (150' plug) inside 9-5/8" csg & across top of salt @ 1060'. Spotted 10 sx cmt plug @ surface, installed regulation dry hole marker, cleaned & leveled location according to USGS surface restoration specifications. Plugged & abandoned eff 11/3/77.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature]TITLE Dist. Drlg. Supt.DATE 11/8/77


(This space for Federal or State office use)

APPROVED BY _____

TITLE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

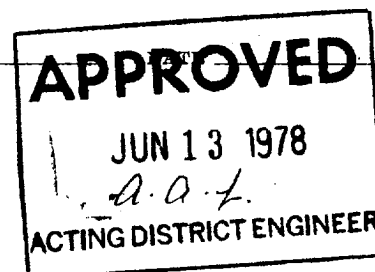

APPROVED

RECEIVED

JUL 10 1976

COMM. on
H. R. 1000