Form 3160-5 (June 1990)

C IN MA

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED


Budget Bureau No. 1004-0135

Expires: March 31, 1993

5. Lease Designation and Serial No. SUNDRY NOTICES AND REPORTS ON WELLS LC-069052 Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. 6. If Indian, Alottee or Tribe Name Use "APPLICATION FOR PERMIT -- " for such proposals 7. If Unit or CA, Agreement Designation SUBMIT IN TRIPLICATE 8. Well Name and Number GAS ✓ OIL WELL 1. Type of Well: **OTHER** WEST DOLLARHIDE DRINKARD UNIT WELL 2. Name of Operator 50 **TEXACO EXPLORATION & PRODUCTION INC.** 9. API Well No. 3. Address and Telephone No. 205 E. Bender, HOBBS, NM 88240 397-0405 30 025 12277 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 10. Field and Pool, Exploaratory Area DOLLARHIDE TUBB DRINKARD Feet From The NORTH Line and 1650 Feet From The **Unit Letter** 2310 11. County or Parish, State Township 24S Range 38E Section 31 EAST LEA , NEW MEXICO 12 Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data TYPE OF ACTION TYPE OF SUBMISSION Change of Plans Abandonment **New Construction** Recompletion Non-Routine Fracturing Notice of Intent Plugging Back Water Shut-Off Subsequent Report Casing Repair Conversion to Injection Atlering Casing Final Abandonment Notice Dispose Water OTHER: **REQUEST TA STATUS** (Note: Report results of multiple completion on Well 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*. 1-10-00: MIRU YALE. NUBOP. REL TAC. 1-11-00: TIH W/BIT & SCRAPER. TIH W/CIBP @ 2 3/8" TBG. COULD NOT GET PLUG TO SET @ 6300 TO 6270'. SET PLUG @ 6225'. LOAD & TEST CSG W/500 PSI-OK. 1-12-00: CHART TEST CSG W/500 PSI FOR 30 MIN-OK. DISPL CSG W/PKR FLUID. LD ALL TBG. DUMPED 35' CMT ON CIBP. PBTD @ 6190'. NDBOP, INSTL WH. RIG DOWN. (CHART ATTACHED) TEMPORARY ABANDON. THE ORIGINAL CHART WAS SENT TO THE NMOCD ON 1-27-00 - COPY OF CHART ATTACHED **Engineering Assistant** DATE 3/21/00 LIITLE SIGNATURE TYPE OR PRINT NAME J. Denise Leake (This space for Federal or State office use) APPROVED TITL F BUNDITIONS OF APPROVAL, IF ANY:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or



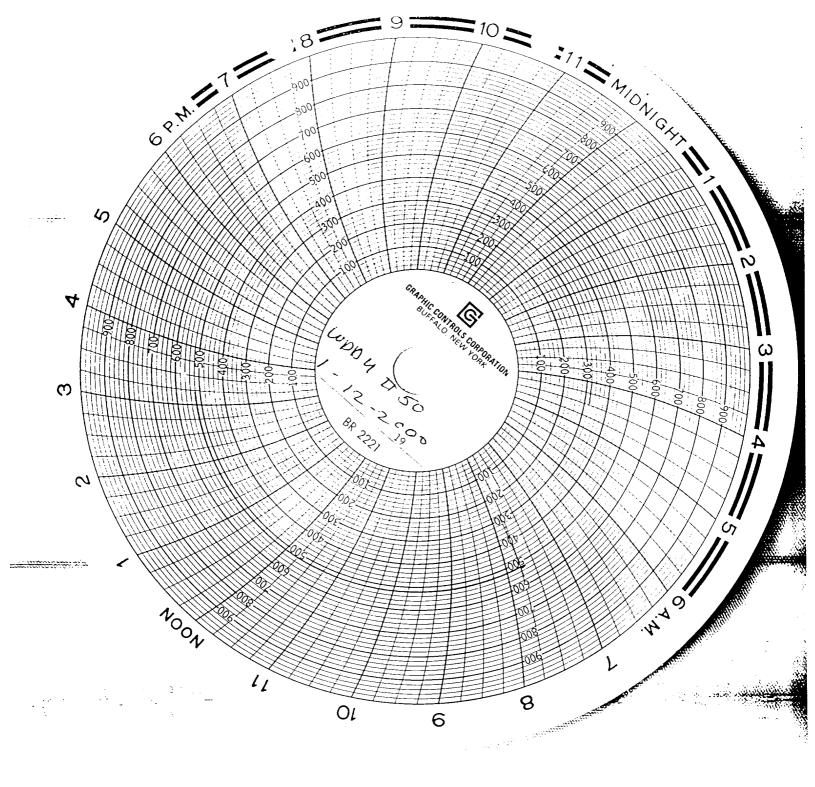

State of New Mexico

Submit 3 copies to Appropriate District Office

, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I

OIL CONSERVATION DIVISION

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30 025 12277

5. Indicate Type of Lease

P.O. Box Drawer DD, Artesia, NM 88210	STATE [] FEE [
DISTRICT III	6. State Oil / Gas Lease No.
1000 Rio Brazos Rd., Aztec, NM 87410	LC-069052
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	7. Lease Name or Unit Agreement Name WEST DOLLARHIDE DRINKARD UNIT
1. Type of Well: OIL GAS WELL WELL OTHER	
Name of Operator TEXACO EXPLORATION & PRODUCTION INC.	8. Well No. 50
3. Address of Operator 205 E. Bender, HOBBS, NM 88240	Pool Name or Wildcat DOLLARHIDE TUBB DRINKARD
4. Well Location Unit Letter G: 2310 Feet From The NORTH Line and 1650 Section 31 Township 24S Range 38E NM	Feet From The <u>EAST</u> Line
10 Flevation (Show whether DF RKB RT GR etc.)	The state of the s

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF IN	TENTIC	ON TO:		S	UBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK		PLUG AND ABANDON		REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON		CHANGE PLANS		COMMENCE DRILLING OF	PERATION PLUG AND ABANDONMENT	
PULL OR ALTER CASING				CASING TEST AND CEME	INT JOB	
OTHER:			_ =	OTHER:	REQUEST TA STATUS	_ <

1-11-00: TIH W/BIT & SCRAPER. TIH W/CIBP @ 2 3/8" TBG. COULD NOT GET PLUG TO SET @ 6300 OT 6270'. SET PLUG @ 6225'. LOAD & TEST CSG W/500 PSI-OK.

1-12-00: CHART TEST CSG W/500 PSI FOR 30 MIN-OK. DISPL CSG W/PKR FLUID. LD ALL TBG. DUMPED 35' CMT ON CIBP. PBTD @ 6190'. NDBOP. INSTL WH. RIG DOWN. (CHART ATTACHED) TEMPORARY ABANDON.

\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	A sign complete to the best of my knowledge and belief. I	DATE 1/27/00
GIGNATURE_		Telephone No. 397-040
YPE OR PRINT NAME	J. Denise Leake	relephone No. 397-040

APPROVED

BUNDITIONS OF APPROVAL IF ANY:

TITLE

_DATE__

^{12.} Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

^{1-10-00:} MIRU YALE, NUBIP, REL TAC.

ROSMETT' NM BTW WAR 22 2000