Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

NOV 13'92

DATE

District Office OIL CONSERVATION DIVISION WELL API NO. P.O. Box 1980, Hobbs, NM 8824U P.O. Box 2088 30 025 12304 DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease STATE X FEE 📙 DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil & Gas Lease No. B-9311 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) WEST DOLLARHIDE DRINKARD UNIT 1. Type of Well: WELL X METT OTHER 2. Name of Operator 8. Well No. Texaco Exploration and Production Inc. 62 3. Address of Operator 9. Pool name or Wildcat P. O. Box 730 Hobbs, NM 88240 **DOLLARHIDE DRINKARD UNIT** 4. Well Location Unit Letter K 1980 Feet From The SOUTH 1980 Feet From The WEST Line and ___ Line County Section 32 Township 24S Range 38E **NMPM** 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3164' GL Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data **NOTICE OF INTENTION TO:** SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK **ALTERING CASING** \mathbf{x} TEMPORARILY ABANDON **CHANGE PLANS** COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 09-16/22-92 1) 2 7/8' tubing & anchor stuck @ 5845', chemical cut tbg @ 5830', pull free tbg. 2) Could not retrieve fish, contact Mr. Jerry Sexton w/NMOCD - receive verbal to set cmt ret above 5830'. 3) Set pkr @ 5803', test csg 500# 15 min - held OK - establish pump rate thru fish 2 BPM @ 2450#. 4) Set cmt retainer @ 5803', pump 120 sx class H, failed to pump all of flush. 5) Pull out of retainer, reverse out 88 sx, est 225' cmt below ret w/63' cmt on top of ret. 6) Contact NMOCD of cmt placement, load csq w/inhibited water, test to 500#, held OK. 7) Request TA status - (chart attached, copy on back). This Approval of Temporary Abandonment Expires I hereby certify that the information above is true and complete to the best of my knowledge and belief. ____ ππε _ Engr Asst DATE 11/11/92 SKINATURE TELEPHONE NO.393-7191 TYPE OR PRINT NAME L.W. Johnson (This space for State Use ORIGINAL SIGNED BY JERRY SEXTON

_ TILE _

カダごが

APPROVED BY _


CONDITIONS OF APPROVAL, IP ANY:

DISTRICT I SUPERVISOR

RECEIVED

NOV 1 2 1992

OCD HOBBS OFFICE

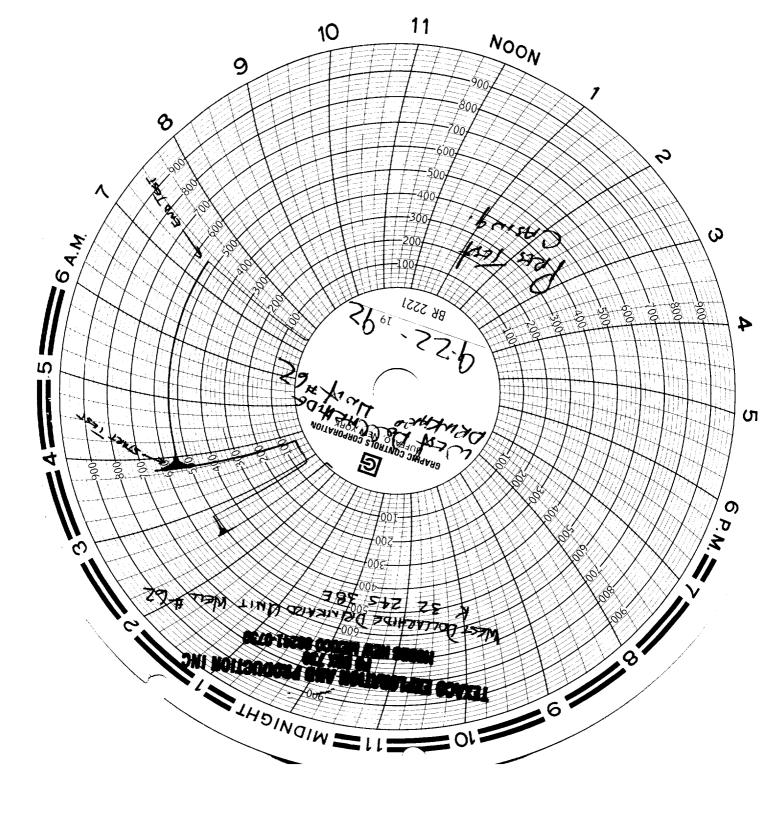

OCD HOBBS OUTILE
400 T \$ 1885
BECEINED

MORNING AND PRODUCTION OF THE PROPERTY OF THE