

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.  
30-025-12324

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

West Dollarhide Drinkard Unit

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☐ Other Injection

2. Name of Operator  
Chevron USA, Inc.

8. Well No.  
45

3. Address of Operator  
15 Smith Rd. Midland, Tx 79705

9. Pool name or Wildcat  
Dollarhide, Tubb, Drinkard

4. Well Location

Unit Letter D : 660 feet from the north line and 660 feet from the west line

Section 32 Township 24-S Range 38-E NMPM County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒


CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Set 7 CIBP 6400' spot 40sx plug fr/6400-6300(Drinkard) Tag @ 6218
2. Displace hole w/MLF 9.5 # Brine w/25 # Gel P/BBL.
3. Spot 40sx plug fr/3800-3600(Queen)
4. Spot 40sx plug fr/3200-3000(9 5/8 shoe) Tag @ 2985
5. Spot 40sx plug fr/2600-2400(B-salt, Yates)
6. Spot 40sx plug fr/1200-1000(T-salt)Tag @ 972
7. Circ cmt fr/350-surf w/80sx (13 3/8 shoe, surf)Tag @ surf
8. Install dry hole marker. 12-15-02

Approved as to Plugging of the Well Bore.  
Liability under bond is retained until  
Surface restoration is completed.

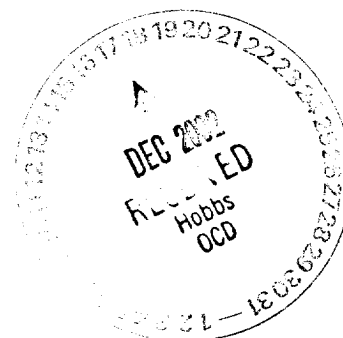

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE MANAGER / SUNSET DATE 12-15-02

Type or print name JIMMY BAGLEY Telephone No. 915 520 8756  
(This space for State use)

APPROVED BY [Signature] TITLE ORIGINAL SIGNED BY DATE DEC 19 2002  
Conditions of approval, if any: GARY W. WINK  
STATE MANAGER