

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103  
Revised March 25, 1999


<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		<b>WELL API NO.</b> 30-025-12345
<b>1. Type of Well:</b> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other Injection <input type="checkbox"/>		<b>5. Indicate Type of Lease</b> STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
<b>2. Name of Operator</b> Chevron USA, Inc.		<b>6. State Oil &amp; Gas Lease No.</b>
<b>3. Address of Operator</b> 15 Smith Rd. Midland, Tx 79705		<b>7. Lease Name or Unit Agreement Name:</b> West Dollarhide Drinkard Unit
<b>4. Well Location</b> Unit Letter <u>K</u> : 1980 feet from the <u>south</u> line and 630 feet from the <u>east</u> line Section <u>33</u> Township <u>24-S</u> Range <u>38-E</u> NMPM County <u>Lea</u>		<b>8. Well No.</b> 58 WIW
<b>10. Elevation (Show whether DR, RKB, RT, GR, etc.)</b>		<b>9. Pool name or Wildcat</b> Dollarhide, Drinkard

<b>11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data</b>	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU
2. Set 5 CIBP @ 6400, spot 60sx plug 600-5940(Drinkard, 7 shoe, Top 5 liner) WOC Tag.
3. Displace hole w/MLF 9.5# Brine w/25 # Gel P/BBL.
4. Spot 40sx plug 3600-3400(Queen)
5. Spot 40sx plug 2600-2400(B-salt, Yates) WOC Tag.
6. Spot 40sx plug 1200-1000 (T-salt) WOC Tag.
7. Sqz 50sx plug from bad csg. 359-371(10 3/4 shoe) WOC Tag.  
\* If well does not circ. Displace to 145'
8. Perf 4 holes @ 145 TOC circ cmt to surf 7 X 10 3/4 WOC Tag.
9. Install dry hole marker.

THIS DOCUMENT IS A CONFIDENTIAL COPY OF THE OIL CONSERVATION DIVISION'S RECORDS. IT IS TO BE KEPT IN THE OIL CONSERVATION DIVISION'S RECORDS.

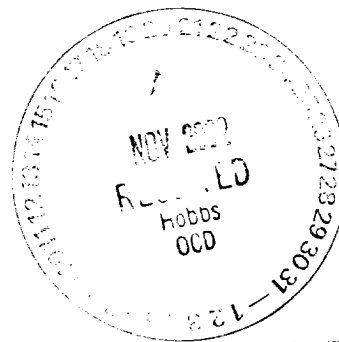

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE HES STAFF

DATE 11/19/02

Type or print name

RANDAL C. PAPASAN

Telephone No. (915) 687-7108

(This space for State use)

APPROVED BY

TITLE

DATE 11/20/02

Conditions of approval, if any: