F THE INTERIOR SUBMIT IN TRIPLICATES (Other instructions (verse side) UNITED STATES DEPARTMEN?

6 x 4 3

Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

GEOLO

GICAL SURVEY	LC-060942
	6. IF INDIAN, ALLOTTEE OR TRIBE NAM

SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
OIL CAS	7. UNIT AGREEMENT NAME
WELL WELL OTHER 2. NAME OF OPERATOR	8. FARM OR LEASE NAME
	Justis Federal
Atlantic Richfield Company 3. ADDRESS OF OPERATOR	9. WELL NO.
• • • • • • • • • • • • • • • • • • • •	2
P. O. Box 1710, Hobbs, New Mexico 88240 1. Location of Well (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface	10. FIELD AND POOL, OR WILDCAT Justis Blinebry
660' FSL & 1980' FEL (Unit letter 0)	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
660 FSL & 1980 FEL (UNIT Tettel O)	11-25S-37E
14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH 13. STATE
. 3144' DF	Lea N.M.
16. Check Appropriate Box To Indicate Nature of Notice, Report, or	r Other Data
NOTICE OF INTENTION TO:	EQUENT REPORT OF:
TEST WATER SHUT-OFF FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WELL (Other) Add Perfs & Frac Blinebry (Note: Report rest Completion or Reco 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent da proposed work. If well is directionally drilled, give subsurface locations and measured and true ver nent to this work.) 1. Rig up, kill well, install BOP, POH w/CA. 2. Perforate add'l Bly w/l JSPF @ 5103, 09, 20, 27, 34, 37, 42, 5200, 12, 20, 53, 57'. 3. RIH w/RBP & trtg pkr, set RBP @ 5300' & pkr @ 5000'. Acidiz gals 15% HCL-LSTNE w/additives, rel pkr & reset @ 4900'. Sw 4. Run base temp & GR logs. Frac Bly 5103-5257' in 3 equal state cross-linked 2% KCL wtr w/additives & 33% CO2 w/60,000# sd. 5. Rel pkr, retr RBP & POH. 6. RIH w/compl assy & return to production	, 55, 58, 60, 80, 86, 93, ze perfs 5103-5257' w/2000 wab. nges w/40,000 gals gelled
	· · · · · · · · · · · · · · · · · · ·

18. I hereby certify that the foregoing is true and correct Dist. Drlg. Supt. SIGNED

(This space for Federal or State office use)


APPROVED BY CONDITIONS OF APPROVAL, IF ANY: TITLE

A A A AL SURVEY

JUL 5 1978 a.a. +.

ACTING DISTRICT ENGINEER

*See Instructions on Reverse Side

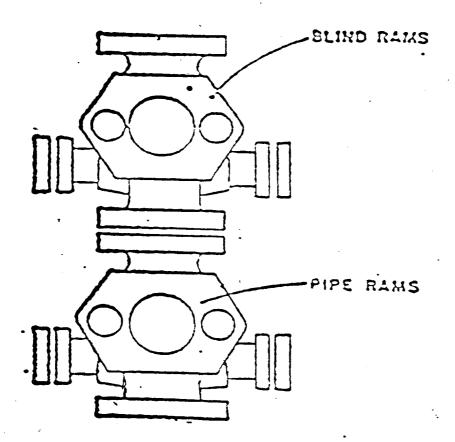

ATIANTIC RICHFIELD COMPANY Blow Out Preventer Program

Lease Name	Justis Federal
Well No	2
Location_	660' FSL & 1980' FEL
	Sec 11-255-37F Tea County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.