

## N. M. OIL CONS. COMMISSION

P. O. BOX 1980

UNITED STATES HOBBS, NEW MEXICO 88240

DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

## SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposalsFORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM 0140978 acs

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8910115870

8. Well Name and No.

Langlie Jal Unit 91

9. API Well No.

30-025-24891

10. Field and Pool, or Exploratory Area

Langlie Mattix

11. County or Parish, State

Lea County, N. M.

## SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

GP II Energy, Inc.

3. Address and Telephone No.

P. O. Box 50682, Midland, Tx., 79710, 915-684-4748

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

T, 1980' FSL &amp; 1980' FEL

S 16, T 25 S, R 37E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

## TYPE OF SUBMISSION

- ☐
- Notice of Intent
- 
- ☒
- Subsequent Report
- 
- ☐
- Final Abandonment Notice

## TYPE OF ACTION

- ☐
- Abandonment
- 
- ☐
- Recompletion
- 
- ☐
- Plugging Back
- 
- ☐
- Casing Repair
- 
- ☐
- Altering Casing
- 
- ☐
- Other
- Add perfs. acidize
- 
- ☐
- Change of Plans
- 
- ☐
- New Construction
- 
- ☐
- Non-Routine Fracturing
- 
- ☐
- Water Shut-Off
- 
- ☐
- Conversion to Injection
- 
- ☐
- Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

05-18-96 MIRU. POOH w/rods & pump. PU 10 jts 2 7/8" tbg. Tag TD. POOH w/10 jts 2 7/8" tbg & 111 jts 2 3/8" tbg. RIH w/4 1/2" csg scraper to btm.

05-19-96 Pull PND log.

05-20-96 Perf; 3255'-3272', 3292'-3298', 3300'-3322', 3330'-3336', 3339'-3345', 3350'-3352', 3380'-3386', 3396'-3400', 3408'-3412', 3426'-3436', 3447'-3453', 3460'-3466', 3470'-3488', 3493'-3498', 3522'-3540', 3544'-3564', 3570'-3592', 3598'-3602', 3610'-3618', 3620'-3630', 3632'-3646', 3654'-3666' (3 SPF, 226', 678 holes) RIH w/4 1/2" AD-1 pkr on 100 jts 2 3/8" tbg.

05-21-96 Finish RIH w/pkr, set @ 3210'. Acidize w/6000 gals 7 1/2% NeFe & 5000# salt in 5 stages. Vac - 1 min. POOH w/103 jts 2 3/8" tbg & pkr. RIH w/2 3/8" SN, 116 jts 2 3/8" tbg. Flange up well head. RIH w/pump, & rods. Space out & hang on.

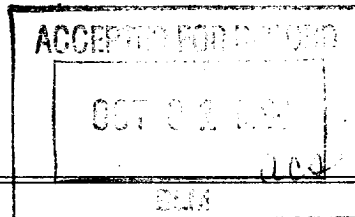

14. I hereby certify that the foregoing is true and correct

Signed [Signature]Title PresidentDate 5-23-96

(This space for Federal or State office use)

Approved by \_\_\_\_\_  
Conditions of approval, if any:

Title \_\_\_\_\_

Date \_\_\_\_\_

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*See Instruction on Reverse Side