

OIL CONSERVATION DIVISION

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name	
2. Name of Operator <b>ARCO Oil and Gas Company</b> Division of Atlantic Richfield Company		8. Farm or Lease Name <b>Wimberly WN</b>	
3. Address of Operator <b>Box 1710, Hobbs, New Mexico 88240</b>		9. Well No. <b>11</b>	
4. Location of Well UNIT LETTER <b>C</b> , <b>990</b> FEET FROM THE <b>North</b> LINE AND <b>1490</b> FEET FROM THE <b>West</b> LINE, SECTION <b>24</b> TOWNSHIP <b>25S</b> RANGE <b>37E</b> NMPM.		10. Field and Pool, or Wildcat <b>Justis Montoya</b>	
15. Elevation (Show whether DF, RT, GR, etc.) <b>3067.9' GR</b>		12. County <b>Lea</b>	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	<b>Justis Montoya only</b>	COMMENCE DRILLING OPS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>
OTHER <input type="checkbox"/>			


17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.


Plug and abandon Justis Montoya zone and prepare for recompletion to the Justis Fusselman in the following manner:  
1. Rig up, install BOP & POH w/compl assy.  
2. RIH w/cmt retr, set retr @ approx 6900'. Cmt squeeze Montoya perfs 6950-7016' w/200 sx Cl C cmt w/3# salt/sk & 6/10 of 1% Halad-22 followed by 100 sx Cl C cmt w/3# salt & 3# sd/sk. P&A Montoya.

Blowout Preventer Program attached.

Note: Recompletion to Justis Fusselman submitted separately on C-101.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <b>Dist. Drlg. Supt.</b>	DATE <b>7/3/79</b>
PROVED BY <b>Orig. Signed by Jerry Sexton Dist. 1, Supv.</b>	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		

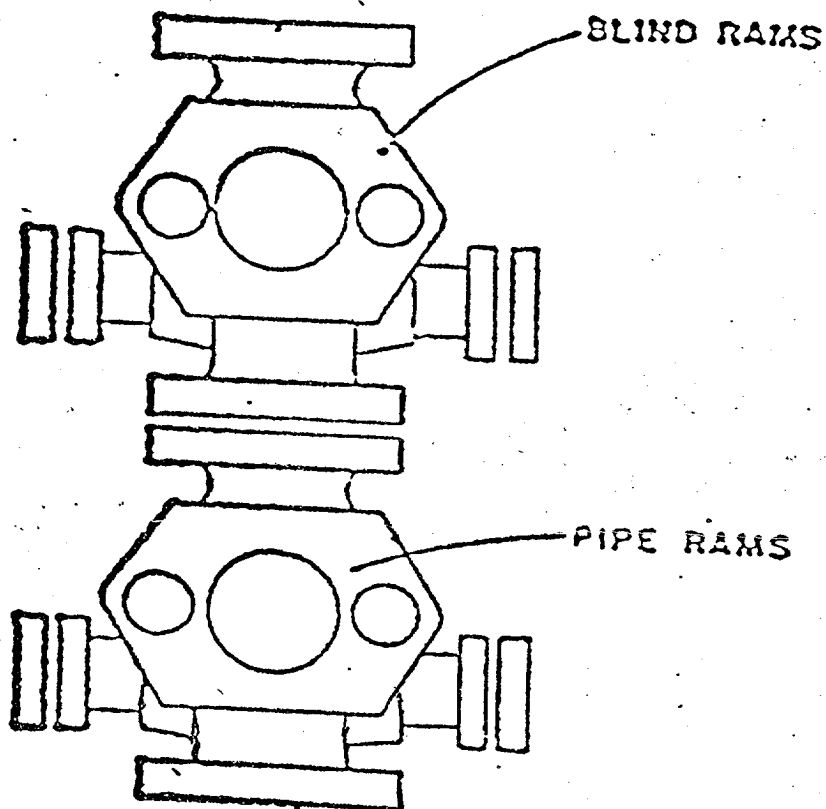

**ATLANTIC RICHFIELD COMPANY**  
**Blow Out Preventer Program**

**Lease Name** Wimberly WN

**Well No.** 11

**Location** 990' FNL & 1490' FWL  
Sec 24-25S-37E, Lea County,

BOP to be tested before installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.