

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐

2. NAME OF OPERATOR Natural Gas
El Paso Exploration Company

3. ADDRESS OF OPERATOR
1800 Wilco Building, Midland, Texas 79701


4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 2310' FSL & 660 FEL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:
TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☒

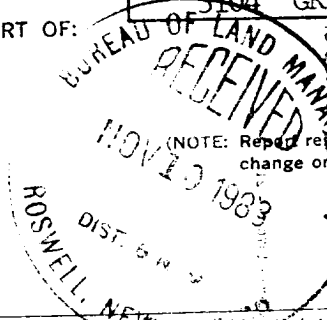

(NOTE: Report results of multiple completion or zone change only on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Plugging and Abandonment procedure October 5-6, 1983. RUPU NU BOP. Pull 2-3/8" tbg. RIH w/tbg. & cmt retainer. Set retainer @ 4606' Pump 35 sx. Cl "C" cmt. under retainer. Sting out of retainer. Dump 5 sx. cmt. on top of retainer. Load hole w/gelled mud. Pull tbg. to 2100' Pump 20 sx. Cl "C" cmt. POH w/2-3/8" tbg. RU wireline. RIH to 864' w/2" perforating gun. Perforate w/ 4 holes. Pump sx. Cl "C" cmt. tagged plug @ 503'. Pull tbg. Dump 10 sx. surface plug. Dig out cellar. Erect dry hole marker.

Subsurface Safety Valve: Manu. and Type _____

18. I hereby certify that the foregoing is true and correct

SIGNED Arde Walker, Jr. TITLE Prod. Engineer DATE November 4, 1983

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: