

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.
30-025-32374

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

West Dollarhide Drinkard Unit

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☒ Other Injector

2. Name of Operator

Chevron USA, Inc.

8. Well No.

146

3. Address of Operator

15 Smith Rd. Midland, Tx 79705

9. Pool name or Wildcat

Dollarhide Tubbs Drinkard

4. Well Location

Unit Letter C : 810 feet from the north line and 2096 feet from the west line

Section 32

Township 24-S

Range 38-E

NMPM

County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU
2. Set 5 1/2 CIBP @ 6450, spot 25sx plug 6450-6250(Drinkard) WOC Tag
3. Displace hole w/MLF 9.5# Brine w/25 # Gel P/BBL.
4. Spot 25sx plug 3800-3600(Queen)
5. Spot 25sx plug 2600-2400(B-salt,Yates) WOC Tag.
6. Perf 4 holes @ 1250, sqz 50sx plug 1250-1050(8 5/8 shoe, T-salt) WOC Tag.
7. Perf 4 holes @ 300, sqz 75sx plug 300-surf, 5 1/2 X 8 5/8 csgs (surf)WOC Tag.
8. Install dry hole marker.

THIS DOCUMENT IS NOT VALID
UNLESS IT IS SIGNED BY THE
SUPERVISOR OF THE DISTRICT
OF THE DISTRICT SUPERVISOR

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

G.R. Bledsoe

TITLE

HES Specialist

DATE

12/2/2002

Type or print name

G.R. Bledsoe

Telephone No.

915.687.7153

(This space for State use)

APPROVED BY

ORIGINAL SIGNED BY

DATE

Conditions of approval, if any:

CHRIS WILLIAMS

DISTRICT SUPERVISOR/GENERAL MANAGER

DEC 02 2002

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME WEST DOLLAHIDE DEINKARD UNIT


WELL # 146

SECT 32 TWN 24-S RNG 38-E

FROM 810 NSL 2096 EWL

TD 6950 FORMATION @ TD Deinkard

PBTD FORMATION @ PBTD

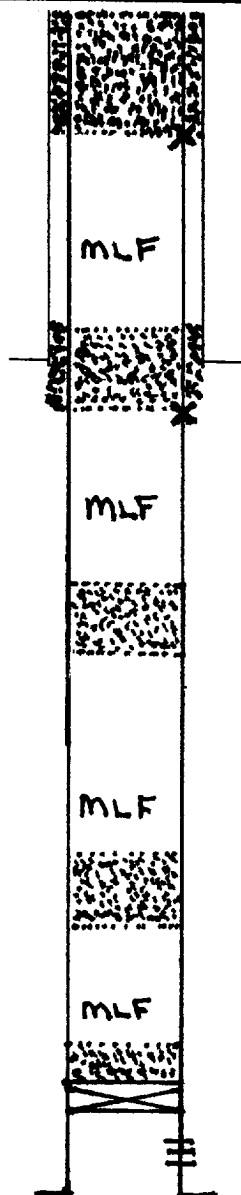

8 5/8
@ 1200
TOC SURF

5 1/2
@ 6950
TOC 1300

TD 6950

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 5/8	1200	SURF	Circ.
INTMED 1				
INTMED 2				
PROD	5 1/2	6950	1300	T.S

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	6495- 6659
INTMED 2	OPENHOLE	
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP	25	6450
YATES	2	QUEEN	25	3800
QUEEN	3	B-SALT	25	2600
GRAYBURG	4	8 5/8 S	50	1250
SAN ANDRES	5	SURF	75	300
CAPITAN REEF	*			
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA	*			
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				