

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
1625 N. French
Hobbs, NM 88240

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT --" for such proposals

5. Lease Designation and Serial No.

NM 14218

6. If Indian, Address of the Tribe

7. If Unit or CA, Agreement Designation

SUBMIT IN TRIPLICATE

1. Type of Well: ☒ OIL WELL ☐ GAS WELL ☐ OTHER

8. Well Name and Number

C.C. FRISTOE 8 FEDERAL NCT-2

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

25

3. Address and Telephone No. 205 E. Bender, HOBBS, NM 88240 397-0405

9. API Well No

30-025-34821

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

10. Field and Pool, Exploratory Area
JUSTIS TUBB DRINKARD

Unit Letter G : 2269' Feet From The NORTH Line and 2459' Feet From The

EAST Line Section 35 Township 24-S Range 37-E

11. County or Parish, State

LEA

12. Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data


TYPE OF SUBMISSION	TYPE OF ACTION
☐ Notice of Intent	☐ Abandonment
☒ Subsequent Report	☐ Recompletion
☐ Final Abandonment Notice	☐ Plugging Back
	☐ Casing Repair
	☐ Altering Casing
	☒ OTHER: COMPLETION
	☐ Change of Plans
	☐ New Construction
	☐ Non-Routine Fracturing
	☐ Water Shut-Off
	☐ Conversion to Injection
	☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

2-18-00/5-06-00: RU PUMP UNIT 2-21-00. UNLOAD & SPOT PUMP. MIRU SU 2-22-00. PU BIT & DC'S. TAG CMT @ 5505. DRILL SOFT CMT 5505-5596. TAG DV TOOL. DRILL OUT DV TOOL 4496-5600. TEST CSG TO 2000 PSI. TIH W/19 JTS TBG. TAG CMT @ 6176'. DRILL 6176-6255. PBTD 6300'. LOG GR/CCL/CBL FR 6300-5000. PERF LOWER DRINKARD 6261-65, 6167-71, 6175-79, 6184-87, 6189-93, 6194-98, 6200-02, 6204-08. TIH ON 3 1/2" TBG. LEAVE PKR @ 6011. TP @ 6073. SPOT 5 BBLs ACID ACR PERFS 6162-6208. SET PKR @ 5980'. TP @ 6047'. INSTL TREE. EOT @ 6037'. FRAC W/76580 LBS 20/40 JO9RDAN FB/24000 LBS RESIN COAT SAND. ND TREE. NDBOP. TIH W/JNK BASKET & GAUGE RING TO 6160. TIH W/RBP. SET @ 6150. RIH W/DUMP BAILER TO RBP @ 6150. RBP WAS NOT THERE. TIH W/BAILER ON TBG. TAG @ 6185'. BAIL FR 6185-6190. TAG UP @ 6190. RU WL. TIH W/RBP SET @ 6148. DUMP 3' SD ON TOP OF RBP. NDBOP. PERF 6054-6135. TIH W/3 1/2" TBG. BTM OF PIPE @ 6102. PKR @ 5914'. TIH W/6 JTS 3/1" TBG. PIPE @ 6135. PKR @ 5570. SPOT 205 GALS OF ACID ACR PERFS 6054-6135. ACIDIZE UPPER DRINKARD FORM 6054-6135 W/1500 GALS 15% HCL. FRAC TREAT UPPER DRINKARD W/2000 GALS PAD. FLOW WELL TO TEST TANK. NDTREE. REL PKR. TIH W/BAILER, C/O 6133 TO TOP OF RBP @ 6146. REL RBP, C/O FR 6176-6300. TIH & TAG 9' FILL. TIH W/PROD STRING: MA @ 6261, SN @ 6216, TBG 6183, TAG @ 5996. NDBOP. SET TAC W/12 POINTS. TIH W/FILTER, PUMP, RDS 3-10-00. START PUMPING @ 6:15 PM MST. UNSEAT PUMJP & PUMP 20 BBLs 2% KCL WTR DN TBG. CHANGE OUT PUMP FR BTM HOLD DN TO TOP HOLD DN. TIH W/PMP & RDS. RETR BHP TOOLS @ 6249. TIH W/INSERT PMP & RDS. 5-05-00.

5-06-00: ON 24 HR OPT. PUMPING 130 BO, 90 BW, & 200 MCF. FINAL REPORT

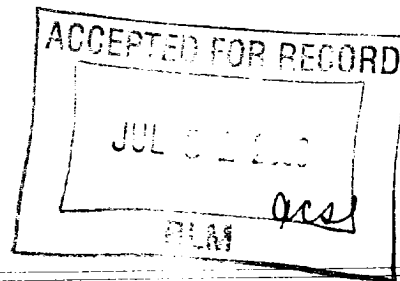

14. I hereby certify that the foregoing is true and correct

SIGNATURE *J. Denise Leake* TITLE Engineering Assistant

DATE 7/17/00

TYPE OR PRINT NAME J. Denise Leake

(This space for Federal or State office use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY

TITLE SPECIAL AGENT IN CHARGE

DATE JAN 04 2001

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

