

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

WVIL CC 32618A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

I.D. 699 N #2

9. API Well No.

30025047010001

10. Field and Pool, or Exploratory Area

JALMAT T-Y-SR

11. County or Parish, State

LEN COUNTY

NEW MEXICO

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CONVEST ENERGY CORPORATION

3. Address and Telephone No.

2401 FOUNTAIN VIEW DR, Suite 100, Houston, TX 77057

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FNL & 1980' FEL, SEC 35, T24S-R36E
660 Unit B

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) Notify BLM, PRIOR TO ANY WORK, @ (505) 393-3612
- 2) AD & RU Rig. POOH w/ PRODUCTION EXT, LD ALL EXCEPT TUBING.
- 3) GRIND & SET CIBP @ 3270'. Spot 35' cement on top of old w/cement.
- 4) Displace hole w/ 9.0 ppg. mud.
- 5) Cut & pull 7" CSG from 1725'.
- 6) Spot cement plug from 1725' to 1625'. TAG PLUG.
- 7) Cut & pull 9 5/8" CSG from 219'.
- 8) Set cement plug from 219 to 119 or to surface. TAG PLUG.
- 9) Cut off CSG's 4' below ground level, WELD ON MARKER + ID PLATE.
- 10) Level & Restore location.

14. I hereby certify that the foregoing is true and correct

Signed E. J. [Signature]

Title Agent

Date 2-4-92

(This space for Federal or State office use)


Approved by _____

Conditions of approval, if any:

Title _____

Date 2/23/92

Well: I.B. Ogg A #2
Formation: Seven Rivers
TD: 3541' PETD 3358'
Elevation: 3287 D.F.

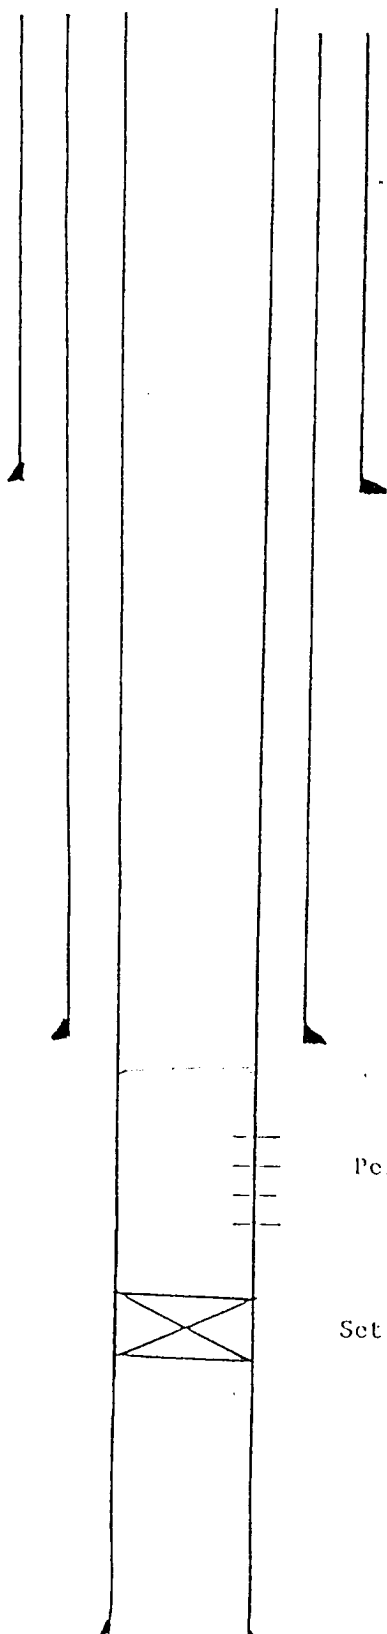

12 $\frac{1}{2}$ ", 50# set at 169'
w/100 sx

9 5/8", 40# set at 1675'
w/ 1000 sx

Perfs at 3290-3300

Set bridge^{plug} at 3370 W 5 SX CMT ON TOP

7", 24# set at 3462'
w/ 200 sx