

Form 3160-5
(June 1990)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

BLM • CARLSBAD

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

NMLC032618A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

I.B. Ogg A #4

9. API Well No.

300250970300S1

10. Field and Pool, or Exploratory Area

Jalmat T-Y-S

11. County or Parish, State

Lea County, New Mexico

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Convast Energy Corporation

3. Address and Telephone No.

2401 Fountain View Dr., Suite 700, Houston, TX 77057

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FNL & 660' FWL, Sec. 35, T24S, R36E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PLUGGING PROCEDURE

1. Notify BLM of Plugging, PRIOR TO ANY WORK, AT (505) 393-3612.
2. MI&RU Rig. POH w/ production eqpt, LD everything except tubing.
3. GIH & set CIBP at 3300'. Spot 50' cement of top of CIBP.
4. Spot cement plugs as below. Circ 9.0 ppg mud in intervals between plugs.
PERFORATE AS NECESSARY TO PLACE THE FOLLOWING PLUGS:
Cement plug from 2450' to 2350' 1667' - 1567' INSIDE AND OUTSIDE THE 7' CS 6.
from 1400' to 1300' 225' - 125' INSIDE THE 7", 9 5/8", AND 12 1/2" CSGS. TAG PLUG.
from 100' to surface
Circulate or pump cement from 100' to surface in all casing annuli.
5. Cut off all casings 4' below ground level, weld on 1/2" steel plate with marker. Backfill and restore location.

14. I hereby certify that the foregoing is true and correct

Signed

Robert A. Kelley

Title Sr. Petroleum Engineer

Date 8/20/91

(This space for Federal or State office use)

Approved by

*Conditions of approval, if any:


Title

Date 9/23/91

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

Well: I.B. Ogg A #4
Formation: Seven Rivers
TD : 3486 '
Elevation: 3304

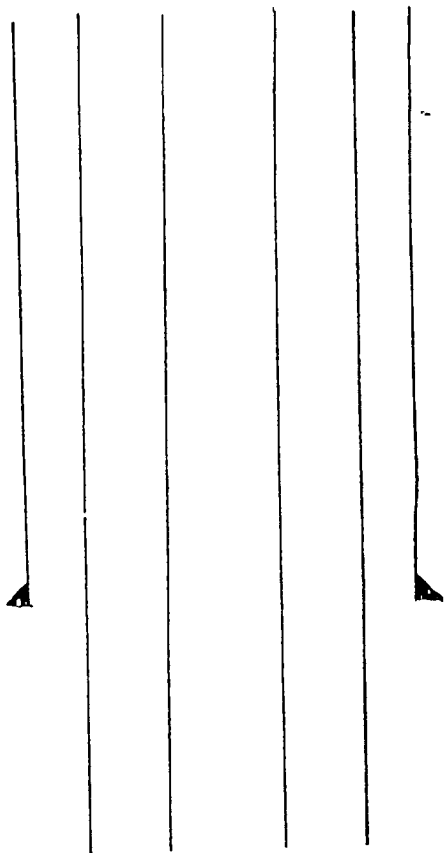

12 $\frac{1}{2}$.50 # set at 175'
w 100 sx