

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-11016
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name J.D. Young (MLMU #179)
8. Well No. 3
9. Pool name or Wildcat Jalmat Tarsill Yates 7R (PROG)
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3289' DF

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☒ OTHER

2. Name of Operator
Texaco Exploration and Production Inc.

3. Address of Operator
P.O. Box 730, Hobbs, NM 88241-0730

4. Well Location
Unit Letter O : 1980 Feet From The E Line and 660 Feet From The S Line
Section 5 Township 24S Range 37E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐ *Jalmat*
OTHER: Sqz. Upper Zone in Dual Well ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-23-91 - 1-4-92

- 1) Notify NMOCC
- 2) Set 7" RPB @ 3258', Run pkr to 2902'. Test Backside 500#. Held OK.
- 3) Establish pump in rate of Jalmat perfs (2945'-3105').
- 4) Set cmt ret @ 2855'. Sqz perfs with 200 sx Class 'C' cmt. WOC 20 hrs.
- 5) Clean out to TD (3360').
- 6) Run inj pkr. Set @ 3334'. Test csg 500#. Held OK. (Chart on reverse).
- 7) Resume inj in Langlie Mattix (570 BWPD @ 1220#). Abandon Jalmat.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE L.W. Johnson TITLE Engr. Asst. DATE 02-12-92
TYPE OR PRINT NAME L.W. Johnson TELEPHONE NO. (505) 397-0426


(This space for State Use) ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

FEB 17 1993

31 Jalmat

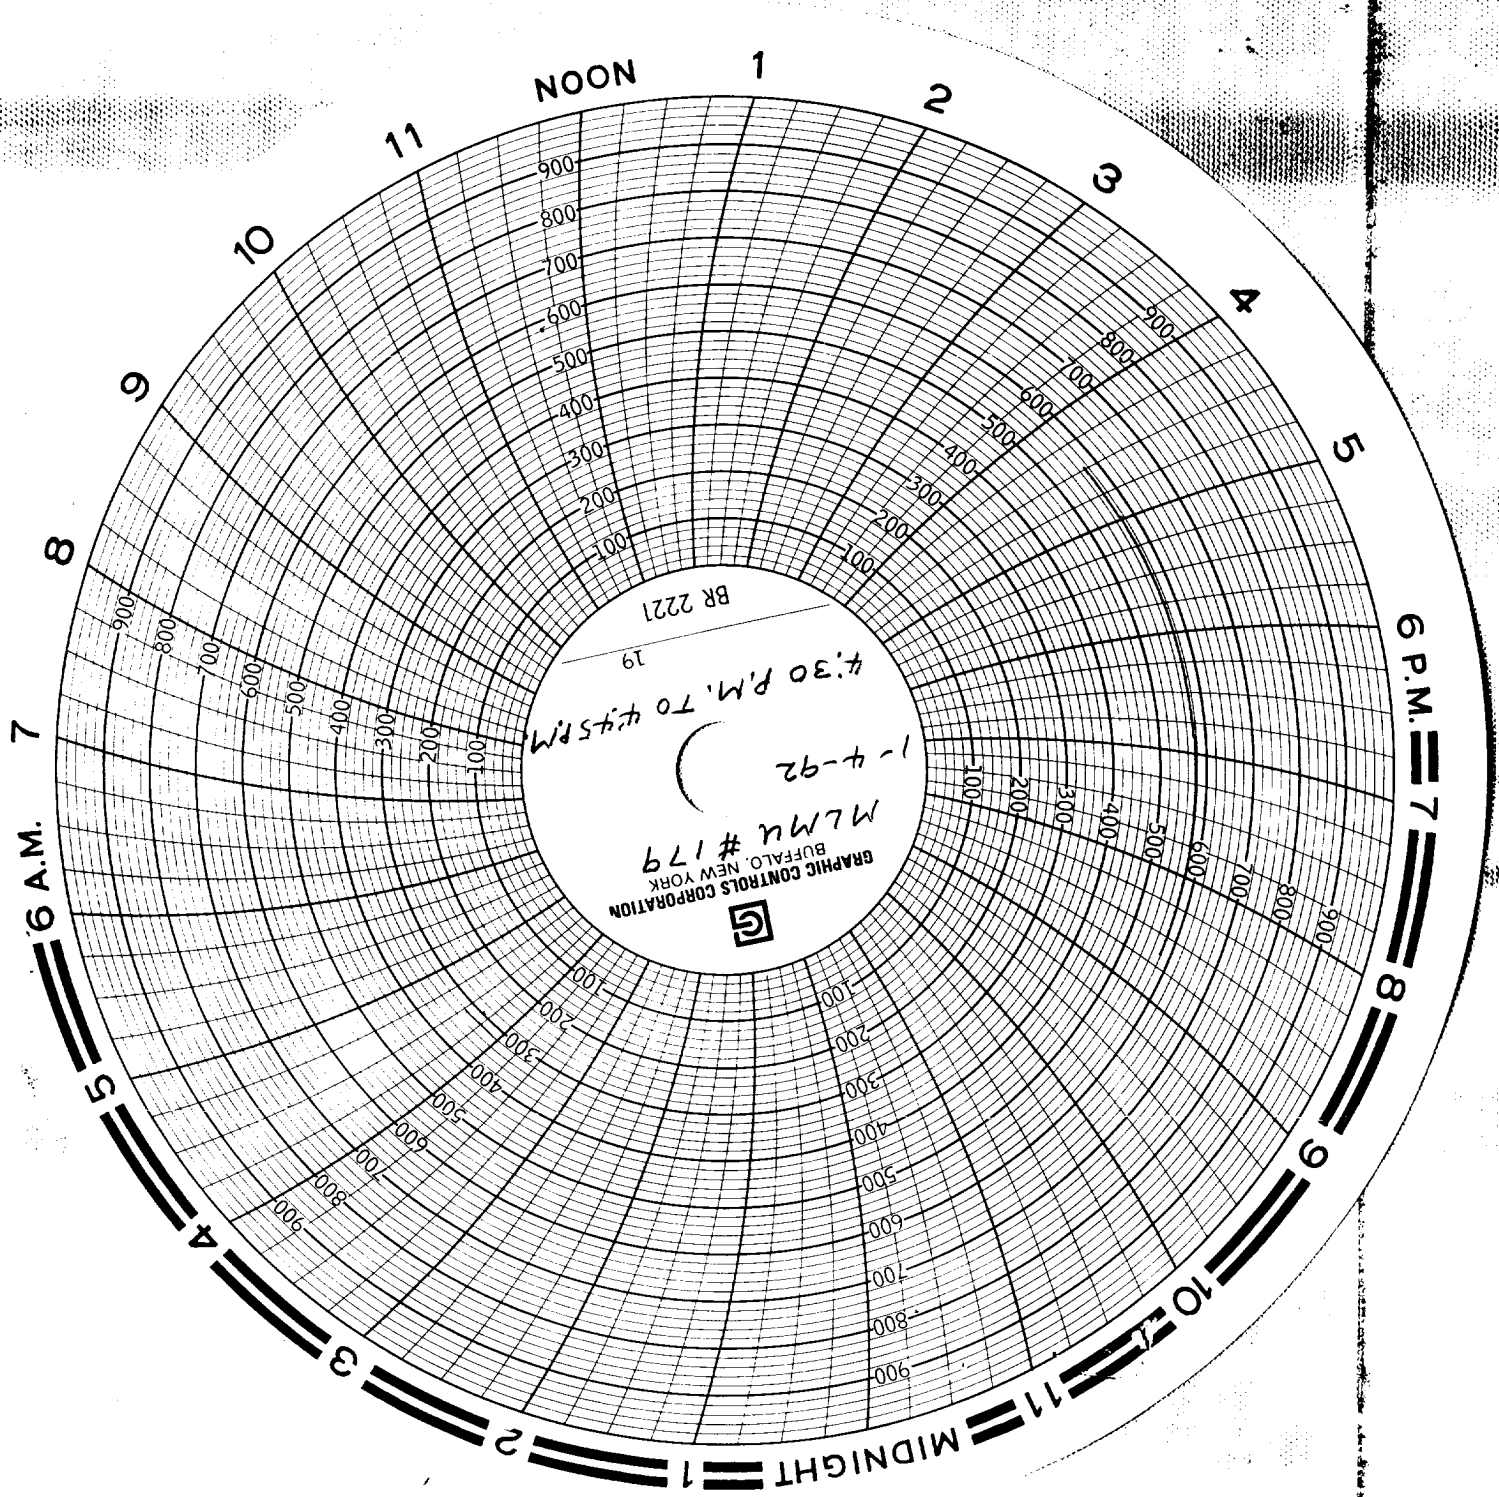

RECEIVED

FEB 14 1992

OCD HOBBS OFFICE