SCHEMATIC DIAGRAM OF DUAL COMPLETION
El Paso Natural Gas Co. San Juan 27-5 Unit No. 31 (PM)
NE/4 Section 24, T-27-N, R-5-W

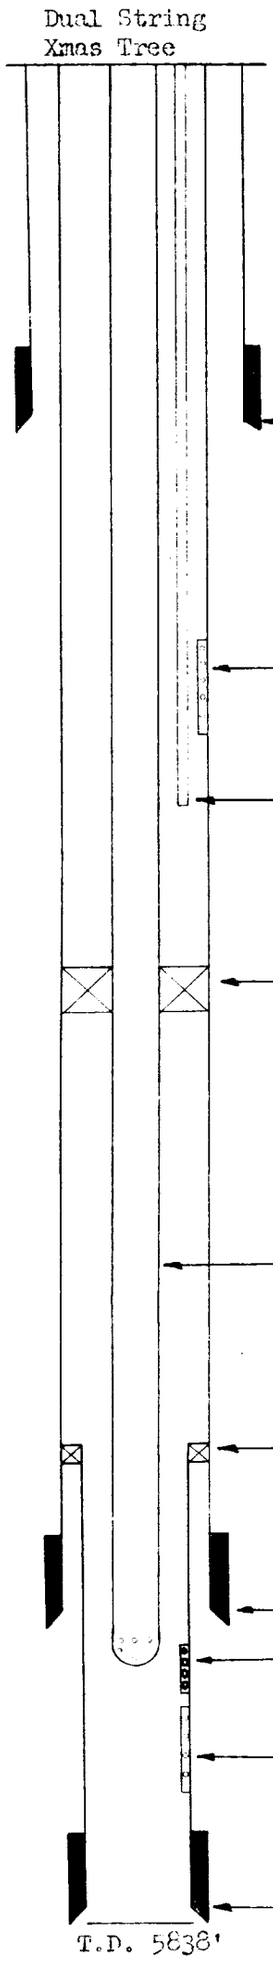

Zero reference point 11.0' above top flange of tubing hanger.

10 3/4", 32.75# S. W. casing set at 173' with 150 sacks cement circulated to surface.

Pictured Cliffs perforations 3446-64; 3474-3502 (2 SPF); fractured with water and sand.

1 1/4" EUE, 2.4# J-55 tubing landed at 3523' as siphon string.

Baker Model "D" production packer set at 3550'.

2" EUE, 4.7# J-55 tubing landed at 5757', with tubing perforations at 5722-25'.

Top of liner hanger at 3570'.

7 5/8", 26.40# J-55 casing set at 3607' with 200 sacks cement.

Cliff House perforations 5162-80; 5190-5200; 5210-32; 5300-14; 5330-42 (2 SPF); fractured with water and sand.

Point Lookout perforations 5602-20; 5630-40; 5654-68; 5678-90 (2 SPF) and 5710-44 (1 SPF) - fractured with water and sand.

5 1/2", 15.50# J-55 liner set from 3570' to 5836' with 300 sacks cement.

RECEIVED
AUG 19 1958
OIL CON. COM.
DIST. 3