ConocoPhillips

# Schematic - Current

API# 30-039-30868

## SAN JUAN 29-7 UNIT #84B

Burlington Resources Oil & Gas Company, LP

**Most Recent Job**

**Jobs**

| Job Category | Primary Job Type | Secondary Job Type | Actual Start Date | End Date |
|---|---|---|---|---|
| COMPLETIONS | INITIAL COMPLETION | INITIAL COMPLETION | 4/6/2011 | 6/2/2011 |

Well Config: DEVIATED - Original Hole, 6/9/2011 11:46:02 AM

| ftKB (MD) | Schematic - Actual |
|---|---|
| 0 | |
| 15 | |
| 16 | 2-1, Casing Hanger, 7, 6.366, 15, 1.0 |
| 17 | 2-2, Casing Pup Joint, 7, 6.366, 16, 1.3 |
| 18 | 1-1, Casing Hanger, 9 5/8, 9.001, 15, 3.1 |
| 201 | 1-2, Casing Joints, 9 5/8, 9.001, 18, 183.0 |
| 202 | 1-3, Float Collar, 9 5/8, 9.001, 201, 1.5 |
| 233 | 1-4, Casing Joints, 9 5/8, 9.001, 203, 30.5 |
| 234 | 1-5, Sawtooth Collar, 9 5/8, 9.001, 233, 0.9 |
| 239 | |
| 400 | |
| 483 | 3-1, Casing Joints, 4 1/2, 4.000, 15, 467.9 |
| 3,126 | |
| 3,247 | |
| 3,330 | |
| 3,348 | 2-3, Casing Joints, 7, 6.366, 17, 3,331.0 |
| 3,351 | 2-4, Stage Tool, 7, 6.366, 3,348, 2.5 |
| 3,355 | 2-5, Casing Pup Joint, 7, 6.366, 3,351, 4.0 |
| 3,365 | 2-6, External Casing Packer, 7, 6.366, 3,355, 10.0 |
| 3,718 | |
| 3,883 | |
| 4,060 | 1-1, Tubing, 2 3/8, 1.995, 15, 8,305.4 |
| 4,218 | 2-7, Casing Joints, 7, 6.366, 3,365, 853.1 |
| 4,219 | 2-8, Float Collar, 7, 6.366, 4,218, 1.0 |
| 4,261 | |
| 4,262 | 2-9, Casing Joints, 7, 6.366, 4,219, 42.9 |
| 4,262 | 2-11, Casing Joints, 7, 6.366, 4,263 |
| 4,263 | 2-10, Float Shoe, 7, 6.366, 4,262, 1.0 |
| 4,292 | |
| 4,666 | 3-2, Casing Joints, 4 1/2, 4.000, 483, 4,182.8 |
| 4,677 | 3-3, Marker Joint, 4 1/2, 4.000, 4,666, 11.3 |
| 4,720 | |
| 4,993 | |
| 5,004 | Perforated, 5,004-5,480, 4/27/2011 |
| 5,480 | |
| 5,530 | |
| 5,544 | |
| 5,800 | Perforated, 5,544-6,012, 4/27/2011 |
| 5,833 | |
| 6,012 | |
| 6,046 | |
| 6,212 | |
| 6,290 | Perforated, 6,046-6,500, 4/27/2011 |
| 6,500 | |
| 6,643 | |
| 7,433 | |
| 7,964 | |
| 8,044 | 3-4, Casing Joints, 4 1/2, 4.000, 4,677, 3,367.5 |
| 8,055 | 3-5, Marker Joint, 4 1/2, 4.000, 8,044, 10.5 |
| 8,157 | |
| 8,210 | |
| 8,217 | |
| 8,281 | |
| 8,284 | |
| 8,321 | 1-2, Tubing Pup Joint, 2 3/8, 1.995, 8,320, 2.2 |
| 8,323 | 1-3, Tubing, 2 3/8, 1.995, 8,323, 30.6 |
| 8,353 | 1-4, Profile Nipple 1.78 ID "F", 2 3/8, 1.780, 8,353, 0.9 |
| 8,354 | 1-5, Expendable Check w/ Mule Shoe, 2 3/8, 1.780, 8,354, 0.9 |
| 8,355 | Perforated, 8,284-8,432, 4/22/2011 |
| 8,362 | |
| 8,395 | |
| 8,432 | |
| 8,440 | 3-6, Casing Joints, 4 1/2, 4.000, 8,055, 385.2 |
| 8,440 | |
| 8,441 | 3-7, Float Collar, 4 1/2, 4.000, 8,440, 0.9 |
| 8,442 | 3-8, Float Shoe, 4 1/2, 4.000, 8,441, 1.0 |
| 8,460 | |

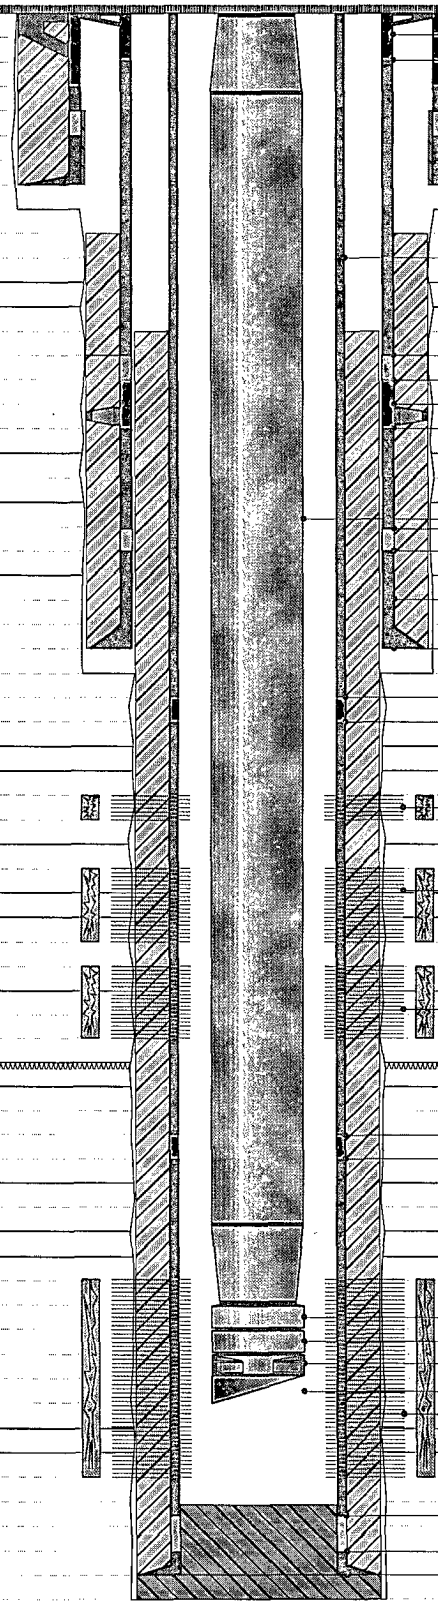

RECEIVED JUN 2011 OIL CONS. DIV. DIST. 3



Report Printed: 6/9/2011