#### OCD Received 9/21/2020


(June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT					January 31	, 2018
APPLICATION FOR PERMIT TO D		REENTER		6. If Indian, Allotee or Tribe Name		
1a. Type of work:   Image: Constraint of the second seco	REENTER			7. If Unit or CA Ag	greement,	Name and No.
1b. Type of Well:				8. Lease Name and	l Well No.	
1c. Type of Completion:   Hydraulic Fracturing	Single Zone	✔ Multiple Zone		CORRAL CANYO	DN 36-25	FEDERAL COM
2. Name of Operator				331H 9. API Well No.		
OXY USA INCORPORATED	21 . DI	NY /: 1 1	7 \	3001547534	- T 1	
<ul><li>3a. Address</li><li>5 Greenway Plaza, Suite 110, Houston, TX 77046</li></ul>	3b. Phone (713) 366	No. <i>(include area coa</i> - <b>5716</b>	le)	10. Field and Pool, CORRAL DRAW		
<ol> <li>Location of Well (Report location clearly and in accordance At surface NENW / 190 FNL / 1800 FWL / LAT 32.166</li> </ol>	6027 / LONG	G -103.940783		11. Sec., T. R. M. G SEC 1/T25S/R29		l Survey or Area
At proposed prod. zone NWNW / 20 FNL / 940 FWL / LA 14. Distance in miles and direction from nearest town or post off		33 / LONG -103.943	3584	12. County or Paris EDDY	sh	13. State
15. Distance from proposed* 20 feet location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	16. No of 240	acres in lease	17. Spaci 640.0	ng Unit dedicated to this well		
18. Distance from proposed location*     19. Proposed Depth     20       to nearest well, drilling, completed, provided and the second				M/BIA Bond No. in file ESB000226		
21. Elevations (Show whether DF, KDB, RT, GL, etc.) 3117 feet	22. Appro: 10/14/202	kimate date work will 1	start*	23. Estimated dura 20 days	tion	
	24. Atta	chments				
The following, completed in accordance with the requirements o (as applicable)	of Onshore O	il and Gas Order No.	1, and the I	Hydraulic Fracturing	rule per 4	3 CFR 3162.3-3
<ol> <li>Well plat certified by a registered surveyor.</li> <li>A Drilling Plan.</li> </ol>		4. Bond to cover th Item 20 above).	he operatior	ns unless covered by a	an existing	g bond on file (see
3. A Surface Use Plan (if the location is on National Forest Syste SUPO must be filed with the appropriate Forest Service Office				rmation and/or plans a	as may be i	requested by the
25. Signature (Electronic Submission)		e (Printed/Typed) ID STEWART / Ph	: (713) 366	6-5716	Date 10/10/2	2019
Title Sr. Regulatory Advisor						
Approved by (Signature) (Electronic Submission)		Name (Printed/Typed) Cody Layton / Ph: (575) 234-5959		1	Date 09/14/2	2020
Title Assistant Field Manager Lands & Minerals Application approval does not warrant or certify that the applican applicant to conduct operations thereon. Conditions of approval, if any, are attached.		sbad Field Office	hose rights	in the subject lease v	which wou	ild entitle the
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, r of the United States any false, fictitious or fraudulent statements				jurisdiction.		
				Oil base muds are n are cased and ceme		<del>sed until fresh wa</del> te

(Continued on page 2)

Approval Date: 09/14/2020

\*(Instructions on page 2)

Entered - KMS NMOCD

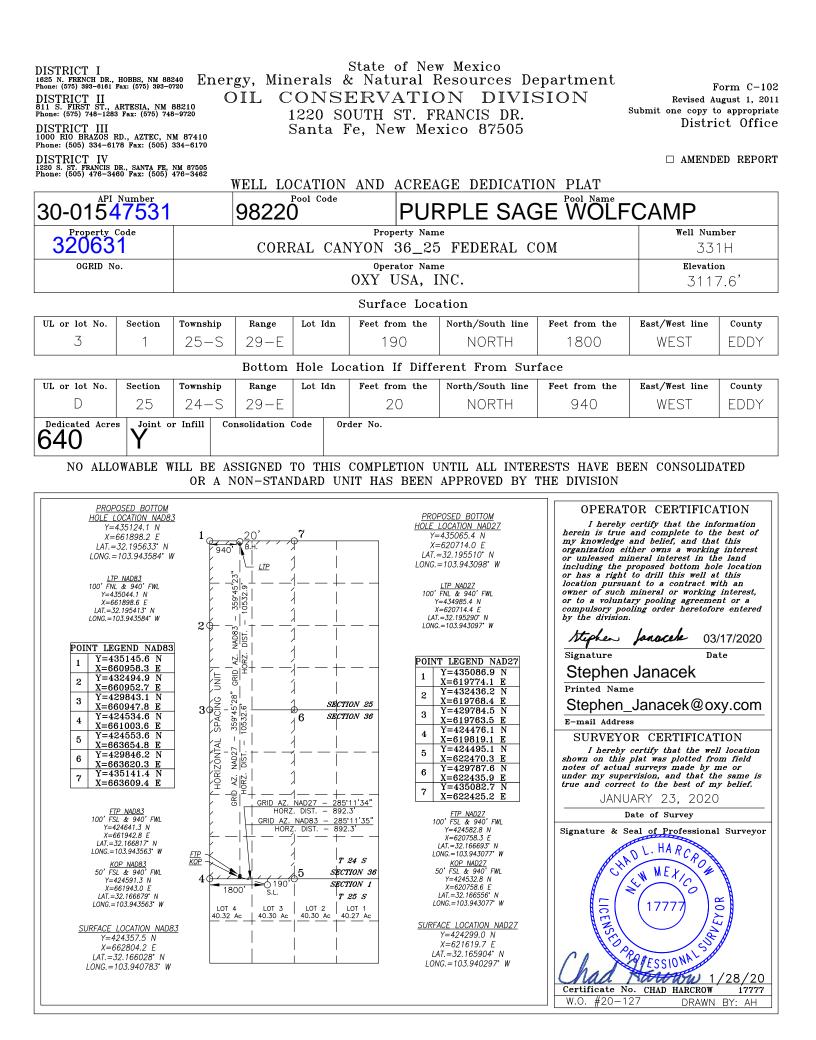

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

#### GAS CAPTURE PLAN

Date: 07/18/2019

 $\boxtimes$  Original

Operator & OGRID No.: OXY USA INC. - 16696

□ Amended - Reason for Amendment:

This Gas Capture Plan outlines actions to be taken by the Operator to reduce well/production facility flaring/venting for new completion (new drill, recomplete to new zone, re-frac) activity.

Note: Form C-129 must be submitted and approved prior to exceeding 60 days allowed by Rule (Subsection A of 19.15.18.12 NMAC).

#### Well(s)/Production Facility – Name of facility

The well(s) that will be located at the production facility are shown in the table below.

Well Name	ΑΡΙ	Well Location (ULSTR)	Footages	Expected MCF/D	Flared or Vented	Comments
Corral Canyon 36-25 Fd Com 331H	Pending	4-1-25S-29E	560 FNL 1013 FWL	5300	0	
Corral Canyon 36-25 Fd Com 332H	Pending	4-1-25S-29E	560 FNL 1048 FWL	5300	0	
Corral Canyon 36-25 Fd Com 333H	Pending	1-1-25S-29E	980 FNL 740 FEL	5300	0	
Corral Canyon 36-25 Fd Com 334H	Pending	1-1-25S-29E	980 FNL 705FEL	5300	0	

#### **Gathering System and Pipeline Notification**

Well(s) will be connected to a production facility after flowback operations are complete, where a gas transporter system is in place. The gas produced from the production facility is sent to <u>ETC Texas Pipeline, LTD ("ETC"</u>) and is connected to <u>ETC</u> high pressure gathering system located in Eddy County, New Mexico. <u>OXY USA INC. ("OXY"</u>) provides (periodically) to <u>ETC</u> a drilling, completion and estimated first production date for wells that are scheduled to be drilled in the foreseeable future. In addition, <u>OXY</u> and <u>ETC</u> have periodic conference calls to discuss changes to drilling and completion schedules. Gas from these wells will be processed at Orla Plant Processing Plant located in Sec. 35, Block 57, T2, T&P RR CO, Reeves, County, Texas. The actual flow of the gas will be based on compression operating parameters and gathering system pressures.

#### **Flowback Strategy**

After the fracture treatment/completion operations, well(s) will be produced to temporary production tanks and gas will be flared or vented. During flowback, the fluids and sand content will be monitored. When the produced fluids contain minimal sand, the wells will be turned to production facilities. Gas sales should start as soon as the wells start flowing through the production facilities, unless there are operational issues on <u>Enterprise</u> system at that time. Based on current information, it is <u>OXY's</u> belief the system can take this gas upon completion of the well(s).

Safety requirements during cleanout operations from the use of underbalanced air cleanout systems may necessitate that sand and non-pipeline quality gas be vented and/or flared rather than sold on a temporary basis.

#### **Alternatives to Reduce Flaring**

Below are alternatives considered from a conceptual standpoint to reduce the amount of gas flared.

- Power Generation On lease
  - Only a portion of gas is consumed operating the generator, remainder of gas will be flared
- Compressed Natural Gas On lease
  - Gas flared would be minimal, but might be uneconomical to operate when gas volume declines
- NGL Removal On lease
  - o Plants are expensive, residue gas is still flared, and uneconomical to operate when gas volume declines

## PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

<b>OPERATOR'S NAME:</b>	OXY USA INCORPORATED
LEASE NO.:	NMNM059386
WELL NAME & NO.:	CORRAL CANYON 36-25 FEDERAL COM 331H
SURFACE HOLE FOOTAGE:	560'/N & 1013'/W
<b>BOTTOM HOLE FOOTAGE</b>	20'/N & 940'/W
LOCATION:	Section 1, T.25 S., R.29 E., NMP
COUNTY:	Eddy County, New Mexico

## COA

H2S	C Yes	🖸 No	
Potash	None	C Secretary	© R-111-P
Cave/Karst Potential	• Low	C Medium	C High
Cave/Karst Potential	Critical		
Variance	C None	• Flex Hose	C Other
Wellhead	Conventional	C Multibowl	Soth
Other	4 String Area	Capitan Reef	□ WIPP
Other	Fluid Filled	Cement Squeeze	Pilot Hole
Special Requirements	□ Water Disposal	COM	🗖 Unit

## A. HYDROGEN SULFIDE

Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.

## **B. CASING**

#### **Casing Design:**

- 1. The **10-3/4** inch surface casing shall be set at approximately **573** feet (a minimum of **70 feet (Eddy County)** into the Rustler Anhydrite and above the salt) and cemented to the surface.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after

Page 1 of 9

completing the cement job.

- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u>
   <u>hours</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.
- 2. The **7-5/8** inch intermediate casing shall be set at approximately **9905** feet. The minimum required fill of cement behind the **7-5/8** inch intermediate casing is:

## **Option 1 (Single Stage):**

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

## **Option 2:**

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
  - Cement to surface. If cement does not circulate, contact the appropriate BLM office.
     Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

# Operator has proposed to pump down 10-3/4" X 7-5/8" annulus. <u>Operator must run</u> a CBL from TD of the 7-5/8" casing to surface. Submit results to BLM.

3. The minimum required fill of cement behind the 5-1/2 inch production casing is:

## **Option 1 (Single Stage):**

• Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

Page 2 of 9

#### **Option 2:**

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
  - Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

## C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

## 2.

## Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the intermediate casing shoe shall be **5000** (**5M**) psi.

## **Option 2:**

- 1. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000** (**5M**) psi.
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.

Page 3 of 9

- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

## **D. SPECIAL REQUIREMENT (S)**

#### **Communitization Agreement**

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. <u>When the Communitization Agreement number is known, it shall also be on the sign.</u>

#### **Offline Cementing**

Contact the BLM prior to the commencement of any offline cementing procedure.

#### **BOP Break Testing Variance**

• BOP break testing is not permitted on this well pending submittion of break testing sundry.

Page 4 of 9

# **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
  - Eddy County Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822
  - Lea County
     Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 393-3612
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig
    - Notify the BLM when moving in and removing the Spudder Rig.
    - Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
    - BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

## A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- <u>Wait on cement (WOC) for Potash Areas:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least <u>24</u> <u>hours</u>. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. <u>Wait on cement (WOC) for Water Basin:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

Page 6 of 9

#### B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
  - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including

lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).

- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the plug. However, **no tests** shall commence until the cement has had a minimum of 24 hours setup time, except the casing pressure test can be initiated immediately after bumping the plug (only applies to single stage cement jobs).
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

## C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

#### D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

#### NMK08102020

Page 9 of 9



# Permian Drilling Hydrogen Sulfide Drilling Operations Plan New Mexico

## <u>Scope</u>

This contingency plan establishes guidelines for the public, all company employees, and contract employees who's work activities may involve exposure to hydrogen sulfide (H2S) gas.

While drilling this well, it is possible to encounter H2S bearing formations. At all times, the first barrier to control H2S emissions will be the drilling fluid, which will have a density high enough to control influx.

## **Objective**

- 1. Provide an immediate and predetermined response plan to any condition when H2S is detected. All H2S detections in excess of 10 parts per million (ppm) concentration are considered an Emergency.
- 2. Prevent any and all accidents, and prevent the uncontrolled release of hydrogen sulfide into the atmosphere.
- 3. Provide proper evacuation procedures to cope with emergencies.
- 4. Provide immediate and adequate medical attention should an injury occur.

## **Discussion**

Implementation:	This plan with all details is to be fully implemented before drilling to <u>commence</u> .
Emergency response Procedure:	This section outlines the conditions and denotes steps to be taken in the event of an emergency.
Emergency equipment Procedure:	This section outlines the safety and emergency equipment that will be required for the drilling of this well.
Training provisions:	This section outlines the training provisions that must be adhered to prior to drilling.
Drilling emergency call lists:	Included are the telephone numbers of all persons to be contacted should an emergency exist.
Briefing:	This section deals with the briefing of all people involved in the drilling operation.
Public safety:	Public safety personnel will be made aware of any potential evacuation and any additional support needed.
Check lists:	Status check lists and procedural check lists have been included to insure adherence to the plan.
General information:	A general information section has been included to supply support information.

## **Hydrogen Sulfide Training**

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on the well:

- 1. The hazards and characteristics of H2S.
- 2. Proper use and maintenance of personal protective equipment and life support systems.
- 3. H2S detection.
- 4. Proper use of H2S detectors, alarms, warning systems, briefing areas, evacuation procedures and prevailing winds.
- 5. Proper techniques for first aid and rescue procedures.
- 6. Physical effects of hydrogen sulfide on the human body.
- 7. Toxicity of hydrogen sulfide and sulfur dioxide.
- 8. Use of SCBA and supplied air equipment.
- 9. First aid and artificial respiration.
- 10. Emergency rescue.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile strength tubular is to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling a well, blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan.

H2S training refresher must have been taken within one year prior to drilling the well. Specifics on the well to be drilled will be discussed during the pre-spud meeting. H2S and well control (choke) drills will be performed while drilling the well, at least on a weekly basis. This plan shall be available in the well site. All personnel will be required to carry the documentation proving that the H2S training has been taken.

Service company and visiting personnel

- A. Each service company that will be on this well will be notified if the zone contains H2S.
- B. Each service company must provide for the training and equipment of their employees before they arrive at the well site.
- C. Each service company will be expected to attend a well site briefing

## **Emergency Equipment Requirements**

#### 1. <u>Well control equipment</u>

The well shall have hydraulic BOP equipment for the anticipated pressures. Equipment is to be tested on installation and follow Oxy Well Control standard, as well as BLM Onshore Order #2.

Special control equipment:

- A. Hydraulic BOP equipment with remote control on ground. Remotely operated choke.
- B. Rotating head
- C. Gas buster equipment shall be installed before drilling out of surface pipe.

#### 2. <u>Protective equipment for personnel</u>

- A. Four (4) 30-minute positive pressure air packs (2 at each briefing area) on location.
- B. Adequate fire extinguishers shall be located at strategic locations.
- C. Radio / cell telephone communication will be available at the rig.
  - Rig floor and trailers.
  - Vehicle.

#### 3. <u>Hydrogen sulfide sensors and alarms</u>

- A. H2S sensor with alarms will be located on the rig floor, at the bell nipple, and at the flow line. These monitors will be set to alarm at 10 ppm with strobe light, and audible alarm.
- B. Hand operated detectors with tubes.
- C. H2S monitor tester (to be provided by contract Safety Company.)
- D. There shall be one combustible gas detector on location at all times.

#### 4. <u>Visual Warning Systems</u>

A. One sign located at each location entrance with the following language:

Caution – potential poison gas Hydrogen sulfide No admittance without authorization

#### *Wind sock – wind streamers:*

- A. One 36" (in length) wind sock located at protection center, at height visible from rig floor.
- B. One 36" (in length) wind sock located at height visible from pit areas.

## Condition flags

A. One each condition flag to be displayed to denote conditions.

green – normal conditions yellow – potential danger red – danger, H2S present

B. Condition flag shall be posted at each location sign entrance.

#### 5. <u>Mud Program</u>

The mud program is designed to minimize the risk of having H2S and other formation fluids at surface. Proper mud weight and safe drilling practices will be applied. H2S scavengers will be used to minimize the hazards while drilling. Below is a summary of the drilling program.

#### Mud inspection devices:

Garrett gas train or hatch tester for inspection of sulfide concentration in mud system.

#### 6. <u>Metallurgy</u>

- A. Drill string, casing, tubing, wellhead, blowout preventers, drilling spools or adapters, kill lines, choke manifold, lines and valves shall be suitable for the H2S service.
- B. All the elastomers, packing, seals and ring gaskets shall be suitable for H2S service.

#### 7. <u>Well Testing</u>

No drill stem test will be performed on this well.

8. <u>Evacuation plan</u>

Evacuation routes should be established prior to well spud for each well and discussed with all rig personnel.

- 9. <u>Designated area</u>
  - A. Parking and visitor area: all vehicles are to be parked at a predetermined safe distance from the wellhead.
  - B. There will be a designated smoking area.
  - C. Two briefing areas on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds perpendicularly, or at a 45-degree angle if wind direction tends to shift in the area.

#### **Emergency procedures**

- A. In the event of any evidence of H2S level above 10 ppm, take the following steps:
  - 1. The Driller will pick up off bottom, shut down the pumps, slow down the pipe rotation.
  - 2. Secure and don escape breathing equipment, report to the upwind designated safe briefing / muster area.
  - 3. All personnel on location will be accounted for and emergency search should begin for any missing, the Buddy System will be implemented.
  - 4. Order non-essential personnel to leave the well site, order all essential personnel out of the danger zone and upwind to the nearest designated safe briefing / muster area.
  - 5. Entrance to the location will be secured to a higher level than our usual "Meet and Greet" requirement, and the proper condition flag will be displayed at the entrance to the location.
  - 6. Take steps to determine if the H2S level can be corrected or suppressed and, if so, proceed as required.
- B. If uncontrollable conditions occur:
  - 1. Take steps to protect and/or remove any public in the down-wind area from the rig – partial evacuation and isolation. Notify necessary public safety personnel and appropriate regulatory entities (i.e. BLM) of the situation.

- 2. Remove all personnel to the nearest upwind designated safe briefing / muster area or off location.
- 3. Notify public safety personnel of safe briefing / muster area.
- 4. An assigned crew member will blockade the entrance to the location. No unauthorized personnel will be allowed entry to the location.
- 5. Proceed with best plan (at the time) to regain control of the well. Maintain tight security and safety procedures.
- C. Responsibility:
  - 1. Designated personnel.
    - a. Shall be responsible for the total implementation of this plan.
    - b. Shall be in complete command during any emergency.
    - c. Shall designate a back-up.

All personnel:	1.	On alarm, don escape unit and report to the nearest upwind designated safe briefing / muster area upw
	2.	Check status of personnel (buddy system).
	3.	Secure breathing equipment.
	4.	Await orders from supervisor.
Drill site manager:	1.	Don escape unit if necessary and report to nearest upwind designated safe briefing / muster area.
	2.	Coordinate preparations of individuals to return to point of release with tool pusher and driller (using the buddy system).
	3.	Determine H2S concentrations.
	4.	Assess situation and take control measures.
Tool pusher:	1.	Don escape unit Report to up nearest upwind designated safe briefing / muster area.
	2.	Coordinate preparation of individuals to return to point of release with tool pusher drill site manager (using the buddy system).
	3.	Determine H2S concentration.
	4.	Assess situation and take control measures.
Driller:	1.	Don escape unit, shut down pumps, continue

	<ol> <li>2.</li> <li>3.</li> <li>4.</li> <li>5.</li> <li>6.</li> </ol>	rotating DP. Check monitor for point of release. Report to nearest upwind designated safe briefing / muster area. Check status of personnel (in an attempt to rescue, use the buddy system). Assigns least essential person to notify Drill Site Manager and tool pusher by quickest means in case of their absence. Assumes the responsibilities of the Drill Site Manager and tool pusher until they arrive should they be absent.
Derrick man Floor man #1 Floor man #2	1.	Will remain in briefing / muster area until instructed by supervisor.
Mud engineer:	1. 2.	Report to nearest upwind designated safe briefing / muster area. When instructed, begin check of mud for ph and H2S level. (Garett gas train.)
Safety personnel:	1.	Mask up and check status of all personnel and secure operations as instructed by drill site manager.

## Taking a kick

When taking a kick during an H2S emergency, all personnel will follow standard Well control procedures after reporting to briefing area and masking up.

## **Open-hole logging**

All unnecessary personnel off floor. Drill Site Manager and safety personnel should monitor condition, advise status and determine need for use of air equipment.

## **Running casing or plugging**

Following the same "tripping" procedure as above. Drill Site Manager and safety personnel should determine if all personnel have access to protective equipment.

## **Ignition procedures**

The decision to ignite the well is the responsibility of the operator (Oxy Drilling Management). The decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope controlling the blowout under the prevailing conditions at the well.

## Instructions for igniting the well

- 1. Two people are required for the actual igniting operation. They must wear self-contained breathing units and have a safety rope attached. One man (tool pusher or safety engineer) will check the atmosphere for explosive gases with the gas monitor. The other man is responsible for igniting the well.
- 2. Primary method to ignite: 25 mm flare gun with range of approximately 500 feet.
- 3. Ignite upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best for protection, and which offers an easy escape route.
- 5. Before firing, check for presence of combustible gas.
- 6. After lighting, continue emergency action and procedure as before.
- 7. All unassigned personnel will remain in briefing area until instructed by supervisor or directed by the Drill Site Manager.

**<u>Remember</u>**: After well is ignited, burning hydrogen sulfide will convert to sulfur dioxide, which is also highly toxic. **<u>Do not assume the area is safe after the well is ignited.</u>** 

## Status check list

Note: All items on this list must be completed before drilling to production casing point.

- 1. H2S sign at location entrance.
- 2. Two (2) wind socks located as required.
- 3. Four (4) 30-minute positive pressure air packs (2 at each Briefing area) on location for all rig personnel and mud loggers.
- 4. Air packs inspected and ready for use.
- 5. Cascade system and hose line hook-up as needed.
- 6. Cascade system for refilling air bottles as needed.
- 7. Condition flag on location and ready for use.
- 8. H2S detection system hooked up and tested.
- 9. H2S alarm system hooked up and tested.
- 10. Hand operated H2S detector with tubes on location.
- 11. 1 100' length of nylon rope on location.
- 12. All rig crew and supervisors trained as required.
- 13. All outside service contractors advised of potential H2S hazard on well.
- 14. No smoking sign posted and a designated smoking area identified.
- 15. Calibration of all H2S equipment shall be noted on the IADC report.

## Procedural check list during H2S events

#### **Perform each tour:**

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to ensure that it in proper working order.
- 3. Make sure all the H2S detection system is operative.

## Perform each week:

- 1. Check each piece of breathing equipment to make sure that demand or forced air regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you receive air or feel air flow.
- 2. BOP skills (well control drills).
- 3. Check supply pressure on BOP accumulator stand by source.
- 4. Check breathing equipment mask assembly to see that straps are loosened and turned back, ready to put on.
- 5. Check pressure on breathing equipment air bottles to make sure they are charged to full volume. ( Air quality checked for proper air grade "D" before bringing to location)
- 6. Confirm pressure on all supply air bottles.
- 7. Perform breathing equipment drills with on-site personnel.
- 8. Check the following supplies for availability.
  - A. Emergency telephone list.
  - B. Hand operated H2S detectors and tubes.

## General evacuation plan

- 1. When the company approved supervisor (Drill Site Manager, consultant, rig pusher, or driller) determines the H2S gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan.
- 2. Drill Site Manager or designee will notify local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company or contractor safety personnel that have been trained in the use of H2S detection equipment and self-contained breathing equipment will monitor H2S concentrations, wind directions, and area of exposure. They will delineate the outer perimeter of the hazardous gas area. Extension to the evacuation area will be determined from information gathered.
- 4. Law enforcement personnel (state police, police dept., fire dept., and sheriff's dept.) Will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- 5. After the discharge of gas has been controlled, company safety personnel will determine when the area is safe for re-entry.

<u>Important:</u> Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

## **Emergency actions**

#### Well blowout – if emergency

- 1. Evacuate all personnel to "Safe Briefing / Muster Areas" or off location if needed.
- 2. If sour gas evacuate rig personnel.
- 3. If sour gas evacuate public within 3000 ft radius of exposure.
- 4. Don SCBA and shut well in if possible using the buddy system.
- 5. Notify Drilling Superintendent and call 911 for emergency help (fire dept and ambulance) if needed.
- 6. Implement the Blowout Contingency Plan, and Drilling Emergency Action Plan.
- 6. Give first aid as needed.

#### Person down location/facility

- 1. If immediately possible, contact 911. Give location and wait for confirmation.
- 2. Don SCBA and perform rescue operation using buddy system.

## Toxic effects of hydrogen sulfide

Hydrogen sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 ppm, which is .001% by volume. Hydrogen sulfide is heavier than air (specific gravity -1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen sulfide is almost as toxic as hydrogen cyanide and is between five and six times more toxic than carbon monoxide. Toxicity data for hydrogen sulfide and various other gases are compared in table i. Physical effects at various hydrogen sulfide exposure levels are shown in table ii.

Common	Chemical	Specific	Threshold	Hazardous	Lethal concentration
name	formula	gravity (sc=1)	limit (1)	limit (2)	(3)
Hydrogen Cyanide	Hcn	0.94	10 ppm	150 ppm/hr	300 ppm
Hydrogen Sulfide	H2S	1.18	10 ppm	250 ppm/hr	600 ppm
Sulfur Dioxide	So2	2.21	5 ppm	-	1000 ppm
Chlorine	C12	2.45	1 ppm	4 ppm/hr	1000 ppm
Carbon Monoxide	Co	0.97	50 ppm	400 ppm/hr	1000 ppm
Carbon Dioxide	Co2	1.52	5000 ppm	5%	10%
Methane	Ch4	0.55	90,000 ppm	Combustibl	e above 5% in air

#### Table i <u>Toxicity of various gases</u>

1) threshold limit – concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.

- 2) hazardous limit concentration that will cause death with short-term exposure.
- 3) lethal concentration concentration that will cause death with short-term exposure.

## Toxic effects of hydrogen sulfide

## Table ii Physical effects of hydrogen sulfide

		Concentration	Physical effects
Percent (%)	<u>Ppm</u>	Grains	
		100 std. Ft3*	
0.001	<10	00.65	Obvious and unpleasant odor.

0.002	10	01.30	Safe for 8 hours of exposure.
0.010	100	06.48	Kill smell in 3 – 15 minutes. May sting eyes and throat.
0.020	200	12.96	Kills smell shortly; stings eyes and throat.
0.050	500	32.96	Dizziness; breathing ceases in a few minutes; needs prompt artificial respiration.
0.070	700	45.36	Unconscious quickly; death will result if not rescued promptly.
0.100	1000	64.30	Unconscious at once; followed by death within minutes.

\*at 15.00 psia and 60'f.

## Use of self-contained breathing equipment (SCBA)

- 1. Written procedures shall be prepared covering safe use of SCBA's in dangerous atmosphere, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available SCBA.
- 2 SCBA's shall be inspected frequently at random to insure that they are properly used, cleaned, and maintained.
- 3. Anyone who may use the SCBA's shall be trained in how to insure proper facepiece to face seal. They shall wear SCBA's in normal air and then wear them in a test atmosphere. (note: such items as facial hair {beard or sideburns} and eyeglasses will not allow proper seal.) Anyone that may be reasonably expected to wear SCBA's should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses or contact lenses.
- 4. Maintenance and care of SCBA's:
  - a. A program for maintenance and care of SCBA's shall include the following:
    - 1. Inspection for defects, including leak checks.
    - 2. Cleaning and disinfecting.
    - 3. Repair.
    - 4. Storage.
  - b. Inspection, self-contained breathing apparatus for emergency use shall be inspected monthly.
    - 1. Fully charged cylinders.
    - 2. Regulator and warning device operation.
    - 3. Condition of face piece and connections.
    - 4. Rubber parts shall be maintained to keep them pliable and prevent deterioration.
  - c. Routinely used SCBA's shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- 5. Persons assigned tasks that requires use of self-contained breathing equipment shall be certified physically fit (medically cleared) for breathing equipment usage at least annually.
- 6. SCBA's should be worn when:
  - A. Any employee works near the top or on top of any tank unless test reveals less than 10 ppm of H2S.

- B. When breaking out any line where H2S can reasonably be expected.
- C. When sampling air in areas to determine if toxic concentrations of H2S exists.
- D. When working in areas where over 10 ppm H2S has been detected.
- E. At any time there is a doubt as to the H2S level in the area to be entered.

#### <u>Rescue</u> First aid for H2S poisoning

Do not panic!

Remain calm – think!

- 1. Don SCBA breathing equipment.
- 2. Remove victim(s) utilizing buddy system to fresh air as quickly as possible. (go up-wind from source or at right angle to the wind. Not down wind.)
- 3. Briefly apply chest pressure arm lift method of artificial respiration to clean the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 4. Provide for prompt transportation to the hospital, and continue giving artificial respiration if needed.
- 5. Hospital(s) or medical facilities need to be informed, before-hand, of the possibility of H2S gas poisoning no matter how remote the possibility is.
- 6. Notify emergency room personnel that the victim(s) has been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration.

Revised CM 6/27/2012

## OXY Permian Delaware NM Basin Drilling & Completions Incident Reporting OXY Permian Crisis Team Hotline Notification

Person	Location	Office Phone	Cell/Mobile Phone
Drilling & Completions Department			
Drilling & Completions Manager: John Willis	Houston	(713) 366-5556	(713) 259-1417
Drilling Superintendent: Simon Benavides	Houston	(713) 215-7403	(832) 528-3547
Completions Superintendent: Chris Winter	Houston	(713) 366-5212	(806) 239-8774
Drilling Eng. Supervisor: Diego Tellez	Houston	(713) 350-4602	(713) 303-4932
Drilling Eng. Supervisor: Randy Neel	Houston	(713) 215-7987	(713) 517-5544
Completions Eng. Supervisor: Evan Hinkel	Houston	(713) 366-5436	(281) 236-6153
Drilling & Completions HES Lead. Ryan Green	Houston	713-336-5753	281-520-5216
Drilling & Completions HES Advisor:Kenny Williams	Carlsbad	(432) 686-1434	(337) 208-0911
Drilling & Completions HES Advisor:Kyle Holden	Carlsbad	(432) 686-1435	(661) 369-5328
Drilling & Completions HES Advisor Sr:Dave Schmidt	Carlsbad		(559) 310-8572
Drilling & Completions HES Advisor. :Seth Doyle	Carlsbad		(337) 499-0756
HES / Enviromental & Regulatory Department	nt Location	Office	Cell Phone
Jon Hamil-HES Manager	Houston	(713) 497-2494	(832) 537-9885
Mark Birk-HES Manager	Houston	(713) 350-4615	(949) 413-3127
Austin Tramell	Midland	(432) 699-4208	(575) 499-4919
Rico Munoz	Midland	(432) 699-8366	(432) 803-4116
Amber DuckWorth	Midland		(832) 966-1879
Kelley Montgomery- Regulatory Manager	Houston	(713) 366-5716	(832) 454-8137
Sandra Musallam -Regulatory Lead	Houston	+1 (713) 366-5106	+1 (713) 504-8577
Bishop, Steve-DOT Pipeline Coordinator	Midland	432-685-5614	
Wilson, Dusty-Safety Advisor	Midland	432-685-5771	(432) 254-2336
John W Dittrich Eniromental Advisor	Midland		(575) 390-2828
William (Jack) Calhoun-Environmental Lead	Houston	+713 (350) 4906	(281) 917-8571
Robert Barrow-Risk Engineer Manager	Houston	(713) 366-5611	(832) 867-5336
Sarah Holmes-HSE Cordinator	Midland	432-685-5758	
Administrative	Location	Office	
Sarah Holmes	Midland	432-685-5830	
Robertson, Debbie	Midland	432-685-5812	
Laci Hollaway	Midland	(432) 685-5716	(432) 631-6341
Administrative	Location	Office	
Rosalinda Escajeda	Midland	432-685-5831	

Person	Location	<b>Office Phone</b>	Cell/Mobile Phone
Moreno, Leslie (contract)	Hobbs	575-397-8247	
Sehon, Angela (contractor)	Levelland	806-894-8347	
Vasquez, Claudia (contractor)	North Cowden	432-385-3120	
XstremeMD	Location	Office	
Medical Case Management	Orla, TX	(337) 205-9314	
Axiom Medical Consulting	Location	Office	
Medical Case Management		(877) 502-9466	
<b>-</b>			
Regulatory Agencies			
Bureau of Land Management	Carlsbad, NM	(505) 887-6544	
Bureau of Land Management	Hobbs, NM	(505) 393-3612	
Bureau of Land Management	Roswell, NM	(505) 393-3612	
Bureau of Land Management	Santa Fe, NM	(505) 988-6030	
DOT Juisdictional Pipelines-Incident Reporting New Mexico Public Regulaion Commission	Santa Fe, NM	(505) 827-3549 (505) 490-2375	
DOT Juisdictional Pipelines-Incident Reporting Texas Railroad Commission	Austin, TX	(512) 463-6788	
EPA Hot Line	Dallas, Texas	(214) 665-6444	
Federal OSHA, Area Office	Lubbock, Texas	(806) 472-7681	
National Response Center	Washington, D. C.	(800) 424-8802	
National Infrastructure Coordinator Center		(202) 282-9201	
New Mexico Air Quality Bureau	Santa Fe, NM	(505) 827-1494	
New Mexico Oil Conservation Division	Artesia, NM	(505) 748-1283	After Hours (505) 370- 7545
New Mexico Oil Conservation Division	Hobbs, NM	(505) 393-6161	
New Mexico Oil Conservation Division	Santa Fe, NM	(505) 471-1068	
New Mexico OCD Environmental Bureau	Santa Fe, NM	(505) 476-3470	
New Mexico Environmental Department	Hobbs, NM	(505) 827-9329	
NM State Emergency Response Center	Santa Fe, NM	(505) 827-9222	
Railroad Commission of TX	District 1 San Antonio	, (210) 227-1313	
Railroad Commission of TX	District 7C San Angelo	(325) 657-7450	
Railroad Commission of TX	District 8, 8A Midland	(432) 684-5581	
Texas Emergency Response Center	Austin, TX	(512) 463-7727	
TCEQ Air	Region 2 Lubbock, TX	(806) 796-3494	
TCEQ Water/Waste/Air	Region 3 Abilene, TX	(325) 698-9674	
TCEQ Water/Waste/Air	Region 7 Midland, TX	(432) 570-1359	
TCEQ Water/Waste/Air	Region 9 San Antonio,	, (512) 734-7981	
TCEQ Water/Waste/Air	Region 8 San Angelo	(325) 655-9479	
Modical Eacilities			
Medical Facilities	Abornather TV	(906) 209 2524	
Abernathy Medical Clinic	Abernathy, TX	(806) 298-2524	
Alliance Hospital	Odessa, TX	(432) 550-1000	
Artesia General Hospital	Artesia, NM	(505) 748-3333	
Brownfield Regional Medical Center	Brownfield, TX	(806) 637-3551	

Snyder, TXLevelland, TXLubbock, TXLubbock, TXSynder, TXOzona, TXOzona, TXCarlsbad, NMHobbs, NMMcCamey, TXLamesa, TXOdessa, TXSan Angelo, TXFt. Stockton	(325) 573-6374         (806) 894-4963         (806) 725-1011         (806) 725-6000         (325) 573-1300         (325) 392-2671         (505) 887-6633         (505) 492-5000         (432) 652-8626         (806) 872-2183         (432) 640-4000	
Lubbock, TXLubbock, TXSynder, TXOzona, TXOzona, TXCarlsbad, NMHobbs, NMMcCamey, TXLamesa, TXOdessa, TXSan Angelo, TX	(806) 725-1011 (806) 725-6000 (325) 573-1300 (325) 392-2671 (505) 887-6633 (505) 492-5000 (432) 652-8626 (806) 872-2183 (432) 640-4000	
Lubbock, TXSynder, TXOzona, TXCarlsbad, NMHobbs, NMMcCamey, TXLamesa, TXOdessa, TXSan Angelo, TX	(806) 725-6000 (325) 573-1300 (325) 392-2671 (505) 887-6633 (505) 492-5000 (432) 652-8626 (806) 872-2183 (432) 640-4000	
Synder, TXOzona, TXCarlsbad, NMHobbs, NMMcCamey, TXLamesa, TXOdessa, TXSan Angelo, TX	(325) 573-1300         (325) 392-2671         (505) 887-6633         (505) 492-5000         (432) 652-8626         (806) 872-2183         (432) 640-4000	
Ozona, TXCarlsbad, NMHobbs, NMMcCamey, TXLamesa, TXOdessa, TXSan Angelo, TX	(325) 392-2671 (505) 887-6633 (505) 492-5000 (432) 652-8626 (806) 872-2183 (432) 640-4000	
Carlsbad, NM Hobbs, NM McCamey, TX Lamesa, TX Odessa, TX San Angelo, TX	(505) 887-6633 (505) 492-5000 (432) 652-8626 (806) 872-2183 (432) 640-4000	
Hobbs, NM McCamey, TX Lamesa, TX Odessa, TX San Angelo, TX	(505) 492-5000 (432) 652-8626 (806) 872-2183 (432) 640-4000	
McCamey, TX Lamesa, TX Odessa, TX San Angelo, TX	(432) 652-8626 (806) 872-2183 (432) 640-4000	
Lamesa, TX Odessa, TX San Angelo, TX	(806) 872-2183 (432) 640-4000	
Odessa, TX San Angelo, TX	(432) 640-4000	
San Angelo, TX		
Et Stockton	(325) 653-6741	
I'I. SIUCKIUII	(432) 336-2241	
Seminole, TX	(432) 758-5811	
Midland, TX	(432) 685-1111	
Lovington, NM	(505) 396-6611	
Odessa, TX	(432) 334-8200	
Andrews, TX	(432) 523-2200	
Big Lake, TX	(325) 884-2561	
Pecos, TX	(432) 447-3551	
San Angelo, TX	(325) 653-6741	
Clayton, NM	(505) 374-2585	
Lubbock, TX	(806) 725-8200	
Del Rio, TX	(830) 775-8566	
Monahans, TX	(432) 943-2511	
Denver City, TX	(806) 592-5484	
Andrews County (Andr	(132) 523 5515	
- · · · ·		
• •		
	· · · ·	1
	· · · ·	<u> </u>
		+
		+
	· · · ·	1
	(432) 688-1277	+
	Lovington, NMOdessa, TXAndrews, TXBig Lake, TXPecos, TXSan Angelo, TXClayton, NMLubbock, TXDel Rio, TXMonahans, TX	Lovington, NM       (505) 396-6611         Odessa, TX       (432) 334-8200         Andrews, TX       (432) 523-2200         Big Lake, TX       (325) 884-2561         Pecos, TX       (432) 447-3551         San Angelo, TX       (325) 653-6741         Clayton, NM       (505) 374-2585         Lubbock, TX       (806) 725-8200         Del Rio, TX       (830) 775-8566         Monahans, TX       (432) 943-2511         Denver City, TX       (806) 592-5484         Andrews County(Andr       (432) 523-5545         Crane, County (Crane)       (432) 558-3571         Crockett County (Ozor       (325) 392-2661         Dawson County (Lame       (806) 872-7560         Ector County (Odessa)       (432) 335-3050         Eddy County (Artesia)       (505) 746-2704         Eddy County (Carlsbac       (505) 887-7551         Gaines County (Semin       (432) 758-9871         Hockley County (Level       (806) 894-3126         Kent County (Jayton)       (806) 237-3801         Lea County (Hobbs)       (505) 384-2020     <

Person	Location	<b>Office Phone</b>	<b>Cell/Mobile Phone</b>
Pecos Cty Sheriff's Department	Pecos County (Iraan)	(432) 639-2251	
Reeves Cty Sheriff's Department	Reeves County (Pecos)	(432) 445-4901	
Scurry Cty Sheriff's Department	Scurry County (Snyder	(325) 573-3551	
Terry Cty Sheriff's Department	Terry County (Brownfi		
Union Cty Sheriff's Department	Union County (Claytor	(505) 374-2583	
Upton Cty Sheriff's Department	Upton County (Rankin	(432) 693-2422	
Ward Cty Sheriff's Department	Ward County (Monaha	(432) 943-3254	
Yoakum City Sheriff's Department	Yoakum Co. (Denever	(806) 456-2377	
Law Enforcement - Police			
Abernathy City Police	Abernathy, TX	(806) 298-2545	
Andrews City Police	Andrews, TX	(432) 523-5675	
Artesia City Police	Artesia, NM	(505) 746-2704	
Brownfield City Police	Brownfield, TX	(806) 637-2544	
Carlsbad City Police	Carlsbad, NM	(505) 885-2111	
Clayton City Police	Clayton, NM	(505) 374-2504	
Denver City Police	Denver City, TX	(806) 592-3516	
Eunice City Police	Eunice, NM	(505) 394-2112	
Hobbs City Police	Hobbs, NM	393-2677	
Jal City Police	Jal, NM	(505) 395-2501	
Jayton City Police	Jayton, TX	(806) 237-3801	
Lamesa City Police	Lamesa, TX	(806) 872-2121	
Levelland City Police	Levelland, TX	(806) 894-6164	
Lovington City Police	Lovington, NM	(505) 396-2811	
Midland City Police	Midland, TX	(432) 685-7113	
Monahans City Police	Monahans, TX	(432) 943-3254	
Odessa City Police	Odessa, TX	(432) 335-3378	
Seminole City Police	Seminole, TX	(432) 758-9871	
Snyder City Police	Snyder, TX	(325) 573-2611	
Sundown City Police	Sundown, TX	(806) 229-8241	
Law Enforcement - FBI			
FBI	Alburqueque, NM	(505) 224-2000	
FBI	Midland, TX	(432) 570-0255	
Law Enforcement - DPS			
NM State Police	Artesia, NM	(505) 746-2704	
NM State Police	Carlsbad, NM	(505) 885-3137	
NM State Police	Eunice, NM	(505) 392-5588	
NM State Police	Hobbs, NM	(505) 392-5588	
NM State Police	Clayton, NM	(505) 374-2473; 911	
TX Dept of Public Safety	Andrews, TX	(432) 524-1443	
TX Dept of Public Safety	Big Lake, TX	(325) 884-2301	

Person	Location	<b>Office Phone</b>	Cell/Mobile Phone
TX Dept of Public Safety	Brownfield, TX	(806) 637-2312	
TX Dept of Public Safety	Iraan, TX	(432) 639-3232	
TX Dept of Public Safety	Lamesa, TX	(806) 872-8675	
TX Dept of Public Safety	Levelland, TX	(806) 894-4385	
TX Dept of Public Safety	Lubbock, TX	(806) 747-4491	
TX Dept of Public Safety	Midland, TX	(432) 697-2211	
TX Dept of Public Safety	Monahans, TX	(432) 943-5857	
TX Dept of Public Safety	Odessa, TX	(432) 332-6100	
TX Dept of Public Safety	Ozona, TX	(325) 392-2621	
TX Dept of Public Safety	Pecos, TX	(432) 447-3533	
TX Dept of Public Safety	Seminole, TX	(432) 758-4041	
TX Dept of Public Safety	Snyder, TX	(325) 573-0113	
TX Dept of Public Safety	Terry County TX	(806) 637-8913	
TX Dept of Public Safety	Yoakum County TX	(806) 456-2377	
· · · ·			
Firefighting & Rescue			
Abernathy	Abernathy, TX	(806) 298-2022	
Amistad/Rosebud	Amistad/Rosebud, NM	(505) 633-9113	
Andrews	Andrews, TX	523-3111	
Artesia	Artesia, NM	(505) 746-5051	
Big Lake	Big Lake, TX	(325) 884-3650	
Brownfield-Administrative & other calls	Brownfield, TX	(816) 637-4547	
Brownfield emergency only	Brownfield, TX	-911	
Carlsbad	Carlsbad, NM	(505) 885-3125	
Clayton	Clayton, NM	(505) 374-2435	
Cotton Center	Cotton Center, TX	(806) 879-2157	
Crane	Crane, TX	(432) 558-2361	
Del Rio	Del Rio, TX	(830) 774-8650	
Denver City	Denver City, TX	(806) 592-3516	
Eldorado	Eldorado, TX	(325) 853-2691	
Eunice	Eunice, NM	(505) 394-2111	
Garden City	Garden City, TX	(432) 354-2404	
Goldsmith	Goldsmith, TX	(432) 827-3445	
Hale Center	Hale Center, TX	(806) 839-2411	
Halfway	Halfway, TX		
Hobbs	Hobbs, NM	(505) 397-9308	
Jal	Jal, NM	(505) 395-2221	
Jayton	Jayton, TX	(806) 237-3801	
Kermit	Kermit, TX	(432) 586-3468	
Lamesa	Lamesa, TX	(806) 872-4352	
Levelland	Levelland, TX	(806) 894-3154	
Lovington	Lovington, NM	(505) 396-2359	
Maljamar	Maljamar, NM	(505) 676-4100	

Person	Location	<b>Office Phone</b>	Cell/Mobile Phone
McCamey	McCamey, TX	(432) 652-8232	
Midland	Midland, TX	(432) 685-7346	
Monahans	Monahans, TX	(432) 943-4343	
Nara Visa	Nara Visa, NM	(505) 461-3300	
Notrees	Notress, TX	(432) 827-3445	
Odessa	Odessa, TX	(432) 335-4659	
Ozona	Ozona, TX	(325) 392-2626	
Pecos	Pecos, TX	(432) 445-2421	
Petersburg	Petersburg, TX	(806) 667-3461	
Plains	Plains, TX	(806) 456-8067	
Plainview	Plainview, TX	(806) 296-1170	
Rankin	Rankin, TX	(432) 693-2252	
San Angelo	San Angelo, TX	(325) 657-4355	
Sanderson	Sanderson, TX	(432) 345-2525	
Seminole	Seminole, TX	758-9871	
Smyer	Smyer, TX	(806) 234-3861	
Snyder	Snyder, TX	(325) 573-6215	
Sundown	Sundown, TX	911	
Tucumcari	Tucumcari, NM	911	
West Odessa	Odessa, TX	(432) 381-3033	
Ambulance			
Abernathy Ambulance	Abernathy, TX	(806) 298-2241	
Amistad/Rosebud	Amistad/Rosebud, NM	(505) 633-9113	
Andrews Ambulance	Andrews, TX	(432) 523-5675	
Artesia Ambulance	Artesia, NM	(505) 746-2701	
Big Lake Ambulance	Big Lake, TX	(325) 884-2423	
Big Spring Ambulance	Big Spring, TX	(432) 264-2550	
Brownfield Ambulance	Brownfield, TX	(806) 637-2511	
Carlsbad Ambulance	Carlsbad, NM	(505) 885-2111; 911	
Clayton, NM	Clayton, NM	(505) 374-2501	
Denver City Ambulance	Denver City, TX	(806) 592-3516	
Eldorado Ambulance	Eldorado, TX	(325) 853-3456	
Eunice Ambulance	Eunice, NM	(505) 394-3258	
Goldsmith Ambulance	Goldsmith, TX	(432) 827-3445	
Hobbs, NM	Hobbs, NM	(505) 397-9308	
Jal, NM	Jal, NM	(505) 395-2501	
Jayton Ambulance	Jayton, TX	(806) 237-3801	
Lamesa Ambulance	Lamesa, TX	(806) 872-3464	
Levelland Ambulance	Levelland, TX	(806) 894-8855	
Lovington Ambulance	Lovington, NM	(505) 396-2811	
McCamey Hospital	McCamey, TX	(432) 652-8626	
Midland Ambulance	Midland, TX	(432) 685-7499	

Person	Location	<b>Office Phone</b>	Cell/Mobile Phone
Monahans Ambulance	Monahans, TX	3731	
Nara Visa, NM	Nara Visa, NM	(505) 461-3300	
Odessa Ambulance	Odessa, TX	(432) 335-3378	
Ozona Ambulance	Ozona, TX	(325) 392-2671	
Pecos Ambulance	Pecos, TX	(432) 445-4444	
Rankin Ambulance	Rankin, TX	(432) 693-2443	
San Angelo Ambulance	San Angelo, TX	(325) 657-4357	
Seminole Ambulance	Seminole, TX	758-9871	
Snyder Ambulance	Snyder, TX	(325) 573-1911	
Stanton Ambulance	Stanton, TX	(432) 756-2211	
Sundown Ambulance	Sundown, TX	911	
Tucumcari, NM	Tucumcari, NM	911	
Medical Air Ambulance Service			
AEROCARE - Methodist Hospital	Lubbock, TX	(800) 627-2376	
San Angelo Med-Vac Air Ambulance	San Angelo, TX	(800) 277-4354	
Southwest Air Ambulance Service	Stanford, TX	(800) 242-6199	
Southwest MediVac	Snyder, TX	(800) 242-6199	
Southwest MediVac	Hobbs, NM	(800) 242-6199	
Odessa Care Star	Odessa, TX	(888) 624-3571	
NWTH Medivac	Amarillo, TX	(800) 692-1331	




# Permian Drilling Hydrogen Sulfide Drilling Operations Plan Corral Canyon 36-25 Federal Com 331H

Open drill site. No homes or buildings are near the proposed location.

1. Escape

Personnel shall escape upwind of wellbore in the event of an emergency gas release. Escape can take place through the lease road on the Southeast side of the location. Personnel need to move to a safe distance and block the entrance to location. If the primary route is not an option due to the wind direction, then a secondary egress route should be taken.

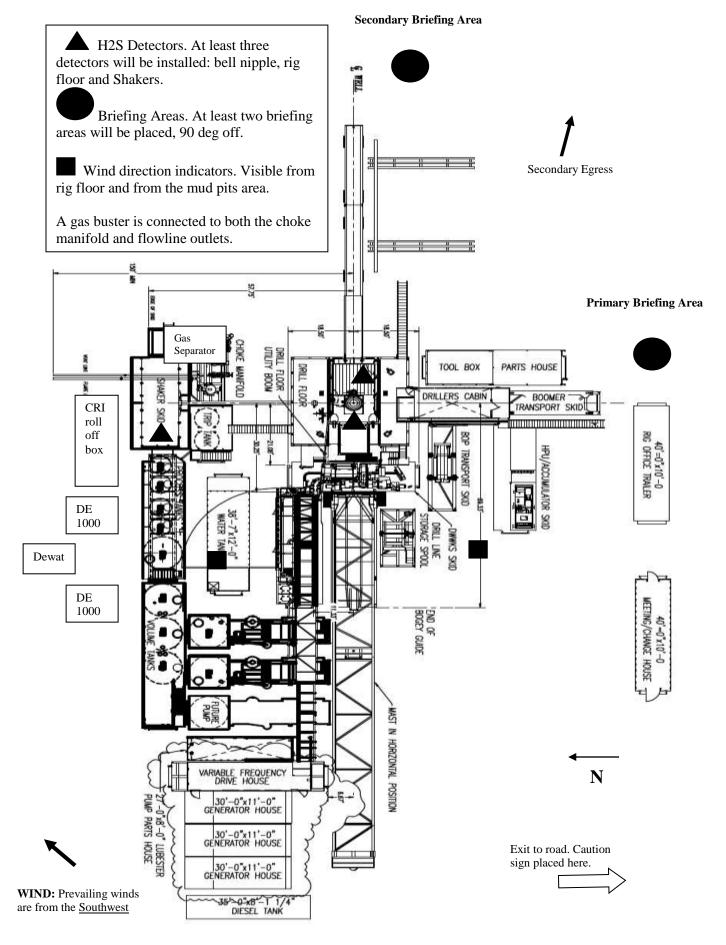

# ΟΧΥ

PRD NM DIRECTIONAL PLANS (NAD 1983) Corral Canyon 36-25 Fed Com Corral Canyon 36\_25 Federal Com 331H

Wellbore #1

**Plan: Permitting Plan** 

# **Standard Planning Report**

11 March, 2020

	LIGBODD								00 0F F	
Database:	HOPSPP				Local Co-	ordinate Re	terence:	Well Corral Car	iyon 36_25 F	ederal Com 331H
Company:	ENGINEE	ERING DE	SIGNS		TVD Refe	rence:		RKB=26.5' @ 3	144.10ft	
Project:	PRD NM	DIRECTIC	NAL PLANS	(NAD 1983)	MD Refer			RKB=26.5' @ 3		
Site:	Corral Ca	nyon 36-2	5 Fed Com		North Ref	erence:		Grid		
Well:	Corral Ca	nyon 36_2	5 Federal Co	m 331H	Survey Ca	alculation M	ethod:	Minimum Curva	ature	
Wellbore:	Wellbore	#1								
Design:	Permitting	g Plan								
Project	PRD NM E	DIRECTIO	NAL PLANS (I	NAD 1983)						
Map System:	US State Pl	ane 1983			System Da	tum:	Μ	ean Sea Level		
	North American Datum 1983									
Map Zone:	New Mexico	Eastern Z	lone				U	sing geodetic sc	ale factor	
Site	Corral Car	ıyon 36-25	Fed Com							
Site Position:			North	ina.	424 <sup>-</sup>	164.47 usft	Latitude:			32° 9' 55.801317 N
From:	Мар		Easti	•		497.64 usft	Longitude:		1	103° 56' 30.391750 W
Position Uncertainty	•	50		Radius:	002,-	13.200 in	Grid Conve	aence.	· · · · · ·	0.21 °
	·•		.00 11 31011	laulus.		10.200 11	Gild Collve	gence.		0.21
Well	Corral Can	yon 36_25	Federal Com	331H						
Well Position	+N/-S	19	3.04 ft No	orthing:		424,357.50	) usft La	titude:		32° 9' 57.700476 N
	+E/-W	30	6.58 ft Ea	asting:		662,804.20	) usft Lo	ngitude:	1	103° 56' 26.817033 W
Position Uncertainty	1		1.00 ft 🛛 🛛 🛛	ellhead Eleva	ation:	0.	.00 ft Gr	ound Level:		3,117.60 ft
Wellbore	Wellbore	#1								
Magnetics	Model	Name	Sampl	e Date	Declina (°)	tion		Angle °)		Strength nT)
	HD	GM_FILE		3/11/2020		6.77		59.80	47,8	01.1000000
Design	Permitting	Plan								
Audit Notes:										
Version:			Phas	e: l	PROTOTYPE	Ti	e On Depth:		0.00	
Mantinal Ocations			epth From (T				•	Dia		
Vertical Section:		<b>D</b>			+N/-S	+6	E/-W		ection (°)	
		D		VD)	(ft)		(ff)			
		D	(ft)	<b>V</b> D)	(ft)		( <b>ft)</b>			
		D		•0)	<b>(ft)</b> 0.00		.00		5.19	
Plan Survey Tool Pr	ogram		(ft)	<b>V</b> D)						
	rogram Depth To	Date	(ft) 0.00							
Plan Survey Tool Pr		Date	(ft) 0.00							
Plan Survey Tool Pr Depth From (ft)	Depth To (ft)	Date o Survey	(ft) 0.00 3/11/2020 7 (Wellbore)		0.00 Tool Name	0	.00			
Plan Survey Tool Pr Depth From	Depth To (ft)	Date o Survey	(ft) 0.00 3/11/2020		0.00 Tool Name B001Mb_MW	0 D+HRGM	.00			
Plan Survey Tool Pr Depth From (ft)	Depth To (ft)	Date o Survey	(ft) 0.00 3/11/2020 7 (Wellbore)		0.00 Tool Name	0 D+HRGM	.00			
Plan Survey Tool Pr Depth From (ft)	Depth To (ft)	Date o Survey	(ft) 0.00 3/11/2020 7 (Wellbore)		0.00 Tool Name B001Mb_MW	0 D+HRGM	.00			
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections	Depth To (ft)	Date o Survey	(ft) 0.00 3/11/2020 7 (Wellbore) ing Plan (Well		0.00 Tool Name B001Mb_MW	0 D+HRGM + HRGM	.00 Remarks	35		
Plan Survey Tool Pr Depth From (ft) 1 0.00	Depth To (ft) 21,370.9	Date o Survey 2 Permitt	(ft) 0.00 3/11/2020 7 (Wellbore)		0.00 Tool Name B001Mb_MW	0 D+HRGM	.00		5.19	
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections Measured	Depth To (ft) 21,370.9	Date o Survey	(ft) 0.00 3/11/2020 7 (Wellbore) ing Plan (Well	bore #1)	0.00 Tool Name B001Mb_MWI OWSG MWD	0 D+HRGM + HRGM Dogleg	.00 Remarks Build	35		Target
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections Measured Depth (ft) Inclin (*	Depth To (ft) 21,370.9	Date 5 Survey 12 Permitt 2 zimuth (°)	(ft) 0.00 3/11/2020 v (Wellbore) ing Plan (Well Vertical Depth (ft)	bore #1) +N/-S (ft)	0.00 Tool Name B001Mb_MWI OWSG MWD +E/-W (ft)	0 D+HRGM + HRGM Dogleg Rate (°/100ft)	.00 Remarks Build Rate (°/100ft)	35 Turn Rate (°/100ft)	5.19 TFO (°)	Target
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections Measured Depth (ft) Inclin (° 0.00	Depth To (ft) 21,370.9	Date D Survey D2 Permitt zimuth (°) 0.00	(ft) 0.00 3/11/2020 7 (Wellbore) ing Plan (Well Vertical Depth (ft) 0.00	bore #1) +N/-S (ft) 0.00	0.00 Tool Name B001Mb_MWI OWSG MWD +E/-W (ft) 0.00	0 D+HRGM + HRGM Dogleg Rate (°/100ft) 0.00	.00 Remarks Build Rate (°/100ft) 0.00	35 Turn Rate (°/100ft) 0.00	5.19 <b>TFO</b> (°) 0.00	Target
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections Measured Depth (ft) Inclin (° 0.00 4,780.00	Depth To (ft) 21,370.9 ation Az 0.00 0.00	Date D Survey 12 Permitt 2 zimuth (°) 0.00 0.00	(ft) 0.00 3/11/2020 7 (Wellbore) ing Plan (Well Vertical Depth (ft) 0.00 4,780.00	bore #1) +N/-S (ft) 0.00 0.00	0.00 Tool Name B001Mb_MWD OWSG MWD +E/-W (ft) 0.00 0.00 0.00	0 D+HRGM + HRGM <b>Dogleg</b> Rate (°/100ft) 0.00 0.00	.00 Remarks Build Rate (°/100ft) 0.00 0.00	35 Turn Rate (°/100ft) 0.00 0.00	5.19 TFO (°) 0.00 0.00	Target
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections Measured Depth (ft) Inclin (° 0.00 4,780.00 5,780.48	Depth To (ft) 21,370.9 21,370.9 0.00 0.00 0.00 10.00	Date D Survey 2 Permitt 2 2 2 2 2 3 2 0.00 0.00 0.00 249.38	(ft) 0.00 3/11/2020 (Wellbore) ing Plan (Well Vertical Depth (ft) 0.00 4,780.00 5,775.40	bore #1) +N/-S (ft) 0.00 0.00 -30.68	0.00 Tool Name B001Mb_MWD OWSG MWD COWSG MWD 0.00 0.00 0.00 -81.55	0 D+HRGM + HRGM <b>Dogleg</b> Rate (°/100ft) 0.00 0.00 1.00	.00 Remarks Build Rate (°/100ft) 0.00 0.00 1.00	35 Turn Rate (°/100ft) 0.00 0.00 0.00	5.19 TFO (°) 0.00 0.00 249.38	Target
Plan Survey Tool Pr           Depth From (ft)           1         0.00           Plan Sections           Measured Depth (ft)         Inclin (°           0.00         4,780.00           5,780.48         9,954.13	Depth To (ft) 21,370.9 21,370.9 0.00 0.00 0.00 10.00 10.00	Date D Survey 2 Permitt 2 2 2 2 3 2 4 9.00 0.00 0.00 2 49.38 2 49.38	(ft) 0.00 3/11/2020 (Wellbore) ing Plan (Well Vertical Depth (ft) 0.00 4,780.00 5,775.40 9,885.58	bore #1) +N/-S (ft) 0.00 0.00 -30.68 -286.04	0.00 Tool Name B001Mb_MWD OWSG MWD OWSG MWD • • • • • • • • • • • • •	0 D+HRGM + HRGM <b>Dogleg</b> Rate (°/100ft) 0.00 0.00 1.00 0.00	.00 Remarks Build Rate (°/100ft) 0.00 0.00 1.00 0.00	35 Turn Rate (°/100ft) 0.00 0.00 0.00 0.00 0.00	5.19 TFO (°) 0.00 0.00 249.38 0.00	
Plan Survey Tool Pr Depth From (ft) 1 0.00 Plan Sections Measured Depth (ft) Inclin (° 0.00 4,780.00 5,780.48	Depth To (ft) 21,370.9 21,370.9 0.00 0.00 0.00 10.00	Date D Survey 2 Permitt 2 2 2 2 2 3 2 0.00 0.00 0.00 249.38	(ft) 0.00 3/11/2020 (Wellbore) ing Plan (Well Vertical Depth (ft) 0.00 4,780.00 5,775.40	bore #1) +N/-S (ft) 0.00 0.00 -30.68	0.00 Tool Name B001Mb_MWD OWSG MWD COWSG MWD 0.00 0.00 0.00 -81.55	0 D+HRGM + HRGM <b>Dogleg</b> Rate (°/100ft) 0.00 0.00 1.00	.00 Remarks Build Rate (°/100ft) 0.00 0.00 1.00	35 Turn Rate (°/100ft) 0.00 0.00 0.00 0.00 0.00 0.00 11.83	5.19 TFO (°) 0.00 249.38 0.00 110.12	Target FTP (Corral Canyon PBHL (Corral

Database:	HOPSPP	Local Co-ordinate Reference:	Well Corral Canyon 36_25 Federal Com 331H
Project: Site: Well: Wellbore:	ENGINEERING DESIGNS PRD NM DIRECTIONAL PLANS (NAD 1983) Corral Canyon 36-25 Fed Com Corral Canyon 36_25 Federal Com 331H Wellbore #1 Permitting Plan	TVD Reference: MD Reference: North Reference: Survey Calculation Method:	RKB=26.5' @ 3144.10ft RKB=26.5' @ 3144.10ft Grid Minimum Curvature

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
100.00	0.00	0.00	100.00	0.00	0.00	0.00	0.00	0.00	0.00
200.00	0.00	0.00	200.00	0.00	0.00	0.00	0.00	0.00	0.00
300.00	0.00	0.00	300.00	0.00	0.00	0.00	0.00	0.00	0.00
400.00	0.00	0.00	400.00	0.00	0.00	0.00	0.00	0.00	0.00
500.00	0.00	0.00	500.00	0.00	0.00	0.00	0.00	0.00	0.00
600.00	0.00	0.00	600.00	0.00	0.00	0.00	0.00	0.00	0.00
700.00	0.00	0.00	700.00	0.00	0.00	0.00	0.00	0.00	0.00
800.00	0.00	0.00	800.00	0.00	0.00	0.00	0.00	0.00	0.00
900.00	0.00	0.00	900.00	0.00	0.00	0.00	0.00	0.00	0.00
1,000.00	0.00	0.00	1,000.00	0.00	0.00	0.00	0.00	0.00	0.00
1,100.00	0.00	0.00	1,100.00	0.00	0.00	0.00	0.00	0.00	0.00
1,200.00	0.00	0.00	1,200.00	0.00	0.00	0.00	0.00	0.00	0.00
1,300.00	0.00	0.00	1,300.00	0.00	0.00	0.00	0.00	0.00	0.00
1,400.00	0.00	0.00	1,400.00	0.00	0.00	0.00	0.00	0.00	0.00
1,500.00	0.00	0.00	1,500.00	0.00	0.00	0.00	0.00	0.00	0.00
1,600.00	0.00	0.00	1,600.00	0.00	0.00	0.00	0.00	0.00	0.00
1,700.00	0.00	0.00	1,700.00	0.00	0.00	0.00	0.00	0.00	0.00
1,800.00	0.00	0.00	1,800.00	0.00	0.00	0.00	0.00	0.00	0.00
1,900.00	0.00	0.00	1,900.00	0.00	0.00	0.00	0.00	0.00	0.00
2,000.00	0.00	0.00	2,000.00	0.00	0.00	0.00	0.00	0.00	0.00
2,100.00	0.00	0.00	2,100.00	0.00	0.00	0.00	0.00	0.00	0.00
2,200.00	0.00	0.00	2,200.00	0.00	0.00	0.00	0.00	0.00	0.00
2,300.00	0.00	0.00	2,300.00	0.00	0.00	0.00	0.00	0.00	0.00
2,400.00	0.00	0.00	2,400.00	0.00	0.00	0.00	0.00	0.00	0.00
2,500.00	0.00	0.00	2,500.00	0.00	0.00	0.00	0.00	0.00	0.00
2,600.00	0.00	0.00	2,600.00	0.00	0.00	0.00	0.00	0.00	0.00
2,700.00	0.00	0.00	2,700.00	0.00	0.00	0.00	0.00	0.00	0.00
2,800.00	0.00	0.00	2,800.00	0.00	0.00	0.00	0.00	0.00	0.00
2,900.00	0.00	0.00	2,900.00	0.00	0.00	0.00	0.00	0.00	0.00
3,000.00	0.00	0.00	3,000.00	0.00	0.00	0.00	0.00	0.00	0.00
3,100.00	0.00	0.00	3,100.00	0.00	0.00	0.00	0.00	0.00	0.00
3,200.00	0.00	0.00	3,200.00	0.00	0.00	0.00	0.00	0.00	0.00
3,300.00	0.00	0.00	3,300.00	0.00	0.00	0.00	0.00	0.00	0.00
3,400.00	0.00	0.00	3,400.00	0.00	0.00	0.00	0.00	0.00	0.00
3,500.00	0.00	0.00	3,500.00	0.00	0.00	0.00	0.00	0.00	0.00
3,600.00	0.00	0.00	3,600.00	0.00	0.00	0.00	0.00	0.00	0.00
3,700.00	0.00	0.00	3,700.00	0.00	0.00	0.00	0.00	0.00	0.00
3,800.00	0.00	0.00	3,800.00	0.00	0.00	0.00	0.00	0.00	0.00
3,900.00	0.00	0.00	3,900.00	0.00	0.00	0.00	0.00	0.00	0.00
4,000.00	0.00	0.00	4,000.00	0.00	0.00	0.00	0.00	0.00	0.00
4,100.00	0.00	0.00	4,100.00	0.00	0.00	0.00	0.00	0.00	0.00
4,200.00	0.00	0.00	4,200.00	0.00	0.00	0.00	0.00	0.00	0.00
4,300.00	0.00	0.00	4,300.00	0.00	0.00	0.00	0.00	0.00	0.00
4,400.00	0.00	0.00	4,400.00	0.00	0.00	0.00	0.00	0.00	0.00
4,500.00	0.00	0.00	4,500.00	0.00	0.00	0.00	0.00	0.00	0.00
4,600.00	0.00	0.00	4,600.00	0.00	0.00	0.00	0.00	0.00	0.00
4,700.00	0.00	0.00	4,700.00	0.00	0.00	0.00	0.00	0.00	0.00
4,780.00	0.00	0.00	4,780.00	0.00	0.00	0.00	0.00	0.00	0.00
4,800.00	0.20	249.38	4,800.00	-0.01	-0.03	-0.01	1.00	1.00	0.00
4,900.00	1.20	249.38	4,899.99	-0.44	-1.18	-0.34	1.00	1.00	0.00
5,000.00	2.20	249.38	4,999.95	-1.49	-3.95	-1.15	1.00	1.00	0.00
5,100.00	3.20	249.38	5,099.83	-3.15	-8.36	-2.43	1.00	1.00	0.00

Database:	HOPSPP	Local Co-ordinate Reference:	Well Corral Canyon 36_25 Federal Com 331H
Company: Project: Site: Well: Wellbore: Design:	ENGINEERING DESIGNS PRD NM DIRECTIONAL PLANS (NAD 1983) Corral Canyon 36-25 Fed Com Corral Canyon 36_25 Federal Com 331H Wellbore #1 Permitting Plan	TVD Reference: MD Reference: North Reference: Survey Calculation Method:	RKB=26.5' @ 3144.10ft RKB=26.5' @ 3144.10ft Grid Minimum Curvature

	Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
	5,200.00	4.20	249.38	5,199.62	-5.42	-14.40	-4.19	1.00	1.00	0.00
	5,300.00	5.20	249.38	5,299.29	-8.30	-22.07	-6.42	1.00	1.00	0.00
	5,400.00	6.20	249.38	5,398.79	-11.80	-31.37	-9.13	1.00	1.00	0.00
	5,500.00	7.20	249.38	5,498.11	-15.91	-42.28	-12.31	1.00	1.00	0.00
	5,600.00	8.20	249.38	5,597.20	-20.63	-54.83	-15.96	1.00	1.00	0.00
	5,700.00	9.20	249.38	5,696.05	-25.96	-68.98	-20.08	1.00	1.00	0.00
	5,780.48	10.00	249.38	5,775.40	-30.68	-81.55	-23.74	1.00	1.00	0.00
									0.00	0.00
	5,800.00 5,900.00	10.00 10.00	249.38 249.38	5,794.63 5,893.11	-31.88 -38.00	-84.72 -100.98	-24.66 -29.40	0.00 0.00	0.00	0.00
	5,900.00 6,000.00	10.00	249.38 249.38	5,893.11 5,991.59	-38.00 -44.12	-100.98	-29.40 -34.13	0.00	0.00	0.00
	6,100.00	10.00	249.38	6,090.06	-44.12	-117.24	-34.13	0.00	0.00	0.00
	6,200.00	10.00	249.38	6,188.54	-56.35	-149.76	-43.60	0.00	0.00	0.00
	6,300.00	10.00	249.38	6,287.02	-62.47	-166.02	-48.33	0.00	0.00	0.00
	6,400.00	10.00	249.38	6,385.50	-68.59	-182.28	-53.06	0.00	0.00	0.00
	6,500.00	10.00	249.38	6,483.98	-74.71	-198.54	-57.80	0.00	0.00	0.00
	6,600.00	10.00	249.38	6,582.46	-80.83	-214.80	-62.53	0.00	0.00	0.00
	6,700.00	10.00	249.38	6,680.94	-86.94	-231.06	-67.26	0.00	0.00	0.00
	6,800.00	10.00	249.38	6,779.42	-93.06	-247.32	-72.00	0.00	0.00	0.00
	6,900.00	10.00	249.38	6,877.90	-99.18	-263.58	-76.73	0.00	0.00	0.00
	7,000.00	10.00	249.38	6,976.38	-105.30	-279.84	-81.46	0.00	0.00	0.00
	7,100.00	10.00	249.38	7,074.86	-111.42	-296.10	-86.20	0.00	0.00	0.00
	7,200.00	10.00	249.38	7,173.34	-117.54	-312.36	-90.93	0.00	0.00	0.00
	7,300.00	10.00	249.38	7,271.82	-123.65	-328.62	-95.66	0.00	0.00	0.00
	7,400.00	10.00	249.38	7,370.30	-129.77	-344.88	-100.40	0.00	0.00	0.00
	7,500.00	10.00	249.38	7,468.78	-135.89	-361.14	-105.13	0.00	0.00	0.00
	7,600.00	10.00	249.38	7,567.25	-142.01	-377.40	-109.86	0.00	0.00	0.00
	7,700.00	10.00	249.38	7,665.73	-148.13	-393.66	-114.60	0.00	0.00	0.00
	7,800.00	10.00		7,764.21					0.00	0.00
	7,800.00	10.00	249.38 249.38	7,764.21 7,862.69	-154.25 -160.36	-409.92 -426.18	-119.33 -124.06	0.00 0.00	0.00	0.00
	8,000.00	10.00	249.38	7,961.17	-166.48	-420.10	-124.00	0.00	0.00	0.00
	8,100.00	10.00	249.38	8,059.65	-172.60	-442.44 -458.70	-128.80	0.00	0.00	0.00
	8,200.00	10.00	249.38	8,158.13	-178.72	-474.96	-138.26	0.00	0.00	0.00
	8,300.00	10.00	249.38	8,256.61	-184.84	-491.22	-143.00	0.00	0.00	0.00
	8,400.00	10.00	249.38	8,355.09	-190.96	-507.48	-147.73	0.00	0.00	0.00
	8,500.00	10.00	249.38	8,453.57	-197.07	-523.74	-152.46	0.00	0.00	0.00
	8,600.00	10.00	249.38	8,552.05	-203.19	-540.00	-157.20	0.00	0.00	0.00
	8,700.00	10.00	249.38	8,650.53	-209.31	-556.26	-161.93	0.00	0.00	0.00
	8,800.00	10.00	249.38	8,749.01	-215.43	-572.52	-166.66	0.00	0.00	0.00
	8,900.00	10.00	249.38	8,847.49	-221.55	-588.78	-171.40	0.00	0.00	0.00
	9,000.00	10.00	249.38	8,945.97	-227.67	-605.04	-176.13	0.00	0.00	0.00
	9,100.00	10.00	249.38	9,044.44	-233.79	-621.30	-180.86	0.00	0.00	0.00
	9,200.00	10.00	249.38	9,142.92	-239.90	-637.56	-185.60	0.00	0.00	0.00
	9,300.00	10.00	249.38	9,241.40	-246.02	-653.82	-190.33	0.00	0.00	0.00
	9,400.00	10.00	249.38	9,339.88	-252.14	-670.08	-195.06	0.00	0.00	0.00
	9,500.00	10.00	249.38	9,438.36	-258.26	-686.34	-199.80	0.00	0.00	0.00
	9,600.00	10.00	249.38	9,536.84	-264.38	-702.60	-204.53	0.00	0.00	0.00
	9,700.00	10.00	249.38	9,635.32	-270.50	-718.86	-209.26	0.00	0.00	0.00
	9,800.00	10.00	249.38	9,733.80	-276.61	-735.12	-214.00	0.00	0.00	0.00
	9,900.00	10.00	249.38	9,832.28	-282.73	-751.38	-214.00	0.00	0.00	0.00
	9,954.13	10.00	249.38	9,885.58	-286.04	-760.18	-221.29	0.00	0.00	0.00
	10,000.00	9.45	276.59	9,930.82	-287.02	-767.66	-221.63	10.00	-1.20	59.31
	10,100.00	14.51	320.08	10,028.79	-276.44	-783.90	-209.73	10.00	5.06	43.49
	10,200.00	23.02	336.88			-799.66	-180.85		8.51	16.80
1	10 200 00	23.02	336 88	10,123.46	-248.78	-799.66	-180.85	10.00	8.51	1h 80

Database:	HOPSPP	Local Co-ordinate Reference:	Well Corral Canyon 36_25 Federal Com 331H
Company: Project: Site: Well: Wellbore: Design:	ENGINEERING DESIGNS PRD NM DIRECTIONAL PLANS (NAD 1983) Corral Canyon 36-25 Fed Com Corral Canyon 36_25 Federal Com 331H Wellbore #1 Permitting Plan	TVD Reference: MD Reference: North Reference: Survey Calculation Method:	RKB=26.5' @ 3144.10ft RKB=26.5' @ 3144.10ft Grid Minimum Curvature

$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$	Turn Rate (°/100ft)	Build Rate (°/100ft)	Dogleg Rate (°/100ft)	Vertical Section (ft)	+E/-W (ft)	+N/-S (ft)	Vertical Depth (ft)	Azimuth (°)	Inclination (°)	Measured Depth (ft)
$ \left  \begin{array}{cccccccccccccccccccccccccccccccccccc$	7 78	9.34	10.00	-135 85	-814 45	-204 87	10 211 93	344 66	32.36	10,300,00
10,500.00         51.73         352.29         10,359.84         -74.12         -839.40         -3.47         10.00         9.74         3.09           10,600.00         61.54         354.64         10,414.78         8.76         -838.40         79.90         10.00         9.81         2.35           10,700.00         71.38         356.59         10,454.67         100.05         -855.74         171.46         10.00         9.86         1.73           10,887.19         89.94         359.76         10,485.14         296.63         -861.52         367.83         0.00         0.00         0.00           11,000.00         89.84         359.76         10,485.14         296.63         -861.95         467.51         0.00         0.00         0.00           11,000.00         89.84         359.76         10,486.71         496.63         -863.22         766.56         0.00<										
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$										
$ \begin{array}{cccccccccccccccccccccccccccccccccccc$										
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$		9.01	10.00		-040.00	0.70	10,414.70	554.04	01.54	10,000.00
$\left \begin{array}{cccccccccccccccccccccccccccccccccccc$										/
$ \left  \begin{array}{cccccccccccccccccccccccccccccccccccc$	1.73	9.86		268.41	-860.02	196.99		358.32	81.23	10,800.00
$ \left  \begin{array}{cccccccccccccccccccccccccccccccccccc$	1.64	9.86	10.00	355.06	-861.47	283.82	10,485.10	359.76	89.84	10,887.19
$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	0.00	0.00	0.00	367.83	-861.52	296.63	10,485.14	359.76	89.84	10,900.00
11,200.00         89.84         359.76         10,486.00         596.63         -862.80         666.88         0.00         0.00         0.00           11,300.00         89.84         359.76         10,486.28         696.63         -863.22         766.56         0.00         0.00         0.00           11,400.00         89.84         359.76         10,486.57         796.63         -863.56         866.24         0.00         0.00         0.00           11,600.00         89.84         359.76         10,487.43         1,096.62         -864.90         1,165.29         0.00         0.00         0.00           11,800.00         89.84         359.76         10,487.43         1,096.62         -864.50         1,665.60         0.00         0.00         0.00           11,800.00         89.84         359.76         10,487.43         1,096.62         -866.53         1,264.97         0.00         0.00         0.00           11,900.00         89.84         359.76         10,488.28         1,396.62         -866.20         1,464.33         0.00         0.00         0.00           12,000.00         89.84         359.76         10,488.27         1,896.61         -867.48         1,763.38         0.00	0.00	0.00	0.00	467.51	-861.95	396.63	10,485.42	359.76	89.84	11,000.00
11,200.00         89.84         359.76         10,486.00         596.63         -862.80         666.88         0.00         0.00         0.00           11,300.00         89.84         359.76         10,486.28         696.63         -863.22         766.56         0.00         0.00         0.00           11,400.00         89.84         359.76         10,486.57         796.63         -863.56         866.24         0.00         0.00         0.00           11,600.00         89.84         359.76         10,487.43         1,096.62         -864.90         1,165.29         0.00         0.00         0.00           11,800.00         89.84         359.76         10,487.43         1,096.62         -864.50         1,665.60         0.00         0.00         0.00           11,800.00         89.84         359.76         10,487.43         1,096.62         -866.53         1,264.97         0.00         0.00         0.00           11,900.00         89.84         359.76         10,488.28         1,396.62         -866.20         1,464.33         0.00         0.00         0.00           12,000.00         89.84         359.76         10,488.27         1,896.61         -867.48         1,763.38         0.00	0.00	0.00	0.00	567 19	-862.37	496 63	10 485 71	359 76	89 84	11 100 00
11,300,00         89,84         359,76         10,486,28         696,63         -863,22         766,56         0.00         0.00         0.00           11,400,00         89,84         359,76         10,486,57         796,63         -864,07         965,92         0.00         0.00         0.00           11,500,00         89,84         359,76         10,486,85         896,63         -864,07         965,92         0.00         0.00         0.00           11,600,00         89,84         359,76         10,487,14         996,62         -864,92         1,165,29         0.00         0.00         0.00           11,800,00         89,84         359,76         10,487,71         1,196,62         -864,92         1,165,29         0.00         0.00         0.00           11,900,00         89,84         359,76         10,488,00         1,296,62         -866,77         1,364,65         0.00         0.00         0.00           12,000,00         89,84         359,76         10,488,87         1,396,62         -866,70         1,663,70         0.00         0.00         0.00           12,000,00         89,84         359,76         10,488,87         1,496,61         -867,05         1,663,70         0.00							,			
$ \begin{bmatrix} 11,400.00 & 89.84 & 359.76 & 10,486.57 & 796.63 & -863.65 & 866.24 & 0.00 & 0.00 & 0.00 \\ 11,500.00 & 89.84 & 359.76 & 10,486.57 & 796.63 & -864.07 & 965.92 & 0.00 & 0.00 & 0.00 \\ 11,600.00 & 89.84 & 359.76 & 10,487.43 & 1,096.62 & -864.92 & 1,165.29 & 0.00 & 0.00 & 0.00 \\ 11,700.00 & 89.84 & 359.76 & 10,487.43 & 1,096.62 & -864.92 & 1,165.29 & 0.00 & 0.00 & 0.00 \\ 11,900.00 & 89.84 & 359.76 & 10,487.71 & 1,196.62 & -865.35 & 1,264.97 & 0.00 & 0.00 & 0.00 \\ 12,000.00 & 89.84 & 359.76 & 10,488.28 & 1,396.62 & -865.77 & 1,364.65 & 0.00 & 0.00 & 0.00 \\ 12,000.00 & 89.84 & 359.76 & 10,488.28 & 1,396.62 & -866.77 & 1,364.65 & 0.00 & 0.00 & 0.00 \\ 12,000.00 & 89.84 & 359.76 & 10,488.28 & 1,396.62 & -866.77 & 1,364.65 & 0.00 & 0.00 & 0.00 \\ 12,200.00 & 89.84 & 359.76 & 10,488.57 & 1,496.62 & -866.63 & 1,564.02 & 0.00 & 0.00 & 0.00 \\ 12,200.00 & 89.84 & 359.76 & 10,489.43 & 1,796.61 & -867.48 & 1,763.38 & 0.00 & 0.00 & 0.00 \\ 12,300.00 & 89.84 & 359.76 & 10,489.43 & 1,796.61 & -867.90 & 1,863.06 & 0.00 & 0.00 & 0.00 \\ 12,500.00 & 89.84 & 359.76 & 10,489.72 & 1,896.61 & -867.90 & 1,863.06 & 0.00 & 0.00 & 0.00 \\ 12,500.00 & 89.84 & 359.76 & 10,499.00 & 1,996.61 & -868.75 & 2,062.43 & 0.00 & 0.00 & 0.00 \\ 12,600.00 & 89.84 & 359.76 & 10,490.57 & 2,196.61 & -868.75 & 2,062.43 & 0.00 & 0.00 & 0.00 \\ 12,600.00 & 89.84 & 359.76 & 10,490.57 & 2,196.61 & -869.18 & 2,162.11 & 0.00 & 0.00 & 0.00 \\ 12,600.00 & 89.84 & 359.76 & 10,490.57 & 2,196.61 & -869.18 & 2,162.17 & 0.00 & 0.00 & 0.00 \\ 13,000.00 & 89.84 & 359.76 & 10,490.57 & 2,196.61 & -869.18 & 2,261.79 & 0.00 & 0.00 & 0.00 \\ 13,000.00 & 89.84 & 359.76 & 10,490.57 & 2,196.61 & -869.18 & 2,261.79 & 0.00 & 0.00 & 0.00 \\ 13,000.00 & 89.84 & 359.76 & 10,491.72 & 2,596.60 & -871.31 & 2,660.52 & 0.00 & 0.00 & 0.00 \\ 13,000.00 & 89.84 & 359.76 & 10,491.72 & 2,596.60 & -871.31 & 2,660.52 & 0.00 & 0.00 & 0.00 \\ 13,000.00 & 89.84 & 359.76 & 10,492.20 & 2,696.60 & -871.31 & 2,660.52 & 0.00 & 0.00 & 0.00 \\ 13,600.00 & 89.84 & 359.76 & 10,492.86 & 2,996.60 & -872.58 & 2,959.57 & 0.$							,			
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$										
$ \begin{array}{cccccccccccccccccccccccccccccccccccc$										
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$										
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$										
11,900.00         89.84         359.76         10,488.00         1,296.62         -865.77         1,364.65         0.00         0.00         0.00           12,000.00         89.84         359.76         10,488.28         1,396.62         -866.20         1,464.33         0.00         0.00         0.00           12,100.00         89.84         359.76         10,488.57         1,496.62         -866.63         1,564.02         0.00         0.00         0.00           12,200.00         89.84         359.76         10,488.61         1,596.62         -867.05         1,663.70         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.14         1,696.61         -867.48         1,763.38         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.72         1,896.61         -867.90         1,863.06         0.00         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.29         2,096.61         -868.75         2,062.43         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.57         2,196.61         -868.75         2,062.43										
12,000.00         89.84         359.76         10,488.28         1,396.62         -866.20         1,464.33         0.00         0.00         0.00           12,100.00         89.84         359.76         10,488.57         1,496.62         -866.63         1,564.02         0.00         0.00         0.00           12,200.00         89.84         359.76         10,488.86         1,596.62         -867.05         1,663.70         0.00         0.00         0.00           12,300.00         89.84         359.76         10,489.14         1,696.61         -867.48         1,763.38         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.43         1,796.61         -867.90         1,863.06         0.00         0.00         0.00         0.00           12,600.00         89.84         359.76         10,489.72         1,896.61         -868.75         2,062.43         0.00         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.57         2,196.61         -869.60         2,261.79         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.86         2,296.61         -870.03 <td></td> <td>0.00</td> <td></td> <td></td> <td>-865.35</td> <td></td> <td>10,487.71</td> <td>359.76</td> <td></td> <td></td>		0.00			-865.35		10,487.71	359.76		
12,100.00         89.84         359.76         10,488.57         1,496.62         -866.63         1,564.02         0.00         0.00         0.00           12,200.00         89.84         359.76         10,488.86         1,596.62         -867.05         1,663.70         0.00         0.00         0.00           12,300.00         89.84         359.76         10,489.14         1,696.61         -867.48         1,763.38         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.43         1,796.61         -867.90         1,863.06         0.00         0.00         0.00           12,500.00         89.84         359.76         10,489.72         1,896.61         -868.33         1,962.74         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.29         2,096.61         -868.75         2,062.43         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.57         2,196.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -870.03         2,361.47         0.00	0.00	0.00	0.00	1,364.65	-865.77	1,296.62	10,488.00	359.76	89.84	11,900.00
12,200.00         89.84         359.76         10,488.86         1,596.62         -867.05         1,663.70         0.00         0.00         0.00           12,300.00         89.84         359.76         10,489.14         1,696.61         -867.48         1,763.38         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.43         1,796.61         -867.90         1,863.06         0.00         0.00         0.00           12,500.00         89.84         359.76         10,489.72         1,896.61         -868.33         1,962.74         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.29         2,996.61         -868.75         2,062.43         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.29         2,996.61         -869.18         2,162.11         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.15         2,396.61         -870.45         2,461.16         0.00	0.00	0.00	0.00	1,464.33	-866.20	1,396.62	10,488.28	359.76	89.84	12,000.00
12,200.00         89.84         359.76         10,488.86         1,596.62         -867.05         1,663.70         0.00         0.00         0.00           12,300.00         89.84         359.76         10,489.14         1,696.61         -867.48         1,763.38         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.43         1,796.61         -867.90         1,863.06         0.00         0.00         0.00           12,500.00         89.84         359.76         10,489.72         1,896.61         -868.33         1,962.74         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.29         2,996.61         -868.75         2,062.43         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.29         2,996.61         -869.18         2,162.11         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.15         2,396.61         -870.45         2,461.16         0.00	0.00	0.00	0.00	1,564.02	-866.63	1,496.62	10,488.57	359.76	89.84	12,100.00
12,300.00         89.84         359.76         10,489.14         1,696.61         -867.48         1,763.38         0.00         0.00         0.00           12,400.00         89.84         359.76         10,489.43         1,796.61         -867.90         1,863.06         0.00         0.00         0.00           12,500.00         89.84         359.76         10,489.72         1,896.61         -868.33         1,962.74         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.00         1,996.61         -868.75         2,062.43         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.57         2,196.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.15         2,396.61         -870.45         2,461.16         0.00	0.00	0.00		1,663.70	-867.05	1,596.62	10,488.86	359.76	89.84	12,200.00
12,400.00         89.84         359.76         10,489.43         1,796.61         -867.90         1,863.06         0.00         0.00         0.00           12,500.00         89.84         359.76         10,489.72         1,896.61         -868.33         1,962.74         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.00         1,996.61         -868.75         2,062.43         0.00         0.00         0.00           12,700.00         89.84         359.76         10,490.29         2,096.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -869.60         2,261.79         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00					-867.48	1.696.61	10,489,14	359.76	89.84	
12,500.00         89.84         359.76         10,489.72         1,896.61         -868.33         1,962.74         0.00         0.00         0.00           12,600.00         89.84         359.76         10,490.00         1,996.61         -868.75         2,062.43         0.00         0.00         0.00           12,700.00         89.84         359.76         10,490.29         2,096.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -869.60         2,261.79         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.15         2,396.61         -870.45         2,461.16         0.00         0.00         0.00           13,100.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,200.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00										
12,600.00         89.84         359.76         10,490.00         1,996.61         -868.75         2,062.43         0.00         0.00         0.00           12,700.00         89.84         359.76         10,490.29         2,096.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -869.60         2,261.79         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.43         2,496.60         -870.45         2,461.16         0.00         0.00         0.00           13,100.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00										,
12,700.00         89.84         359.76         10,490.29         2,096.61         -869.18         2,162.11         0.00         0.00         0.00           12,800.00         89.84         359.76         10,490.57         2,196.61         -869.60         2,261.79         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.43         2,496.60         -870.45         2,461.16         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,200.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00										
12,800.00         89.84         359.76         10,490.57         2,196.61         -869.60         2,261.79         0.00         0.00         0.00           12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.45         2,396.61         -870.45         2,461.16         0.00         0.00         0.00           13,100.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00							-,			
12,900.00         89.84         359.76         10,490.86         2,296.61         -870.03         2,361.47         0.00         0.00         0.00           13,000.00         89.84         359.76         10,491.15         2,396.61         -870.45         2,461.16         0.00         0.00         0.00           13,100.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00										
13,000.00         89.84         359.76         10,491.15         2,396.61         -870.45         2,461.16         0.00         0.00         0.00           13,100.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,600.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00				,						
13,100.00         89.84         359.76         10,491.43         2,496.60         -870.88         2,560.84         0.00         0.00         0.00           13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,600.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00										
13,200.00         89.84         359.76         10,491.72         2,596.60         -871.31         2,660.52         0.00         0.00         0.00           13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,600.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00										
13,300.00         89.84         359.76         10,492.00         2,696.60         -871.73         2,760.20         0.00         0.00         0.00           13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,700.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00						,				
13,400.00         89.84         359.76         10,492.29         2,796.60         -872.16         2,859.88         0.00         0.00         0.00           13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,700.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00										
13,500.00         89.84         359.76         10,492.58         2,896.60         -872.58         2,959.57         0.00         0.00         0.00           13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,700.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00										
13,600.00         89.84         359.76         10,492.86         2,996.60         -873.01         3,059.25         0.00         0.00         0.00           13,700.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00						,				
13,700.00         89.84         359.76         10,493.15         3,096.60         -873.43         3,158.93         0.00         0.00         0.00	0.00	0.00	0.00	2,959.57	-872.58	2,896.60	10,492.58	359.76	89.84	13,500.00
	0.00	0.00	0.00	3,059.25	-873.01	2,996.60	10,492.86	359.76	89.84	13,600.00
	0.00	0.00	0.00	3,158.93	-873.43	3,096.60	10,493.15	359.76	89.84	13,700.00
13,800.00 89.84 359.76 10,493.44 3,196.60 -873.86 3,258.61 0.00 0.00 0.00	0.00	0.00	0.00	3,258.61	-873.86	3,196.60	10,493.44	359.76	89.84	13,800.00
13,900.00 89.84 359.76 10,493.72 3,296.59 -874.28 3,358.29 0.00 0.00 0.00	0.00	0.00						359.76		
14,000.00 89.84 359.76 10,494.01 3,396.59 -874.71 3,457.98 0.00 0.00 0.00		0.00						359.76	89.84	14,000.00
14,100.00 89.84 359.76 10,494.29 3,496.59 -875.13 3,557.66 0.00 0.00 0.00	0.00	0.00	0.00	3,557.66	-875.13	3,496,59	10.494.29	359.76	89.84	14,100,00
14,200.00 89.84 359.76 10,494.58 3,596.59 -875.56 3,657.34 0.00 0.00 0.00						,	,			
14,300.00 89.84 359.76 10,494.87 3,696.59 -875.99 3,757.02 0.00 0.00 0.00										
14,400.00 89.84 359.76 10,495.15 3,796.59 -876.41 3,856.71 0.00 0.00 0.00										
14,500.00 89.84 359.76 10,495.44 3,896.59 -876.84 3,956.39 0.00 0.00 0.00										
						-,				
14,800.00 89.84 359.76 10,496.30 4,196.58 -878.11 4,255.43 0.00 0.00 0.00 0.00						,				/
14,900.00 89.84 359.76 10,496.58 4,296.58 -878.54 4,355.12 0.00 0.00 0.00 0.00										
15,000.00 89.84 359.76 10,496.87 4,396.58 -878.96 4,454.80 0.00 0.00 0.00										
15,100.00 89.84 359.76 10,497.16 4,496.58 -879.39 4,554.48 0.00 0.00 0.00							-,			
15,200.00         89.84         359.76         10,497.44         4,596.58         -879.81         4,654.16         0.00         0.00         0.00										
15,300.00 89.84 359.76 10,497.73 4,696.58 -880.24 4,753.85 0.00 0.00 0.00										
15,400.00 89.84 359.76 10,498.01 4,796.57 -880.67 4,853.53 0.00 0.00 0.00	0.00	0.00	0.00	4,853.53	-880.67	4,796.57	10,498.01	359.76	89.84	15,400.00

Database:	HOPSPP	Local Co-ordinate Reference:	Well Corral Canyon 36_25 Federal Com 331H
Company: Project: Site: Well: Wellbore: Design:	ENGINEERING DESIGNS PRD NM DIRECTIONAL PLANS (NAD 1983) Corral Canyon 36-25 Fed Com Corral Canyon 36_25 Federal Com 331H Wellbore #1 Permitting Plan	TVD Reference: MD Reference: North Reference: Survey Calculation Method:	RKB=26.5' @ 3144.10ft RKB=26.5' @ 3144.10ft Grid Minimum Curvature

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
15,500.00	89.84	359.76	10,498.30	4,896.57	-881.09	4,953.21	0.00	0.00	0.00
15,600.00	89.84	359.76	10,498.59	4,996.57	-881.52	5,052.89	0.00	0.00	0.00
15,700.00	89.84	359.76	10,498.87	5,096.57	-881.94	5,152.57	0.00	0.00	0.00
15,800.00	89.84	359.76	10,499.16		-882.37	5,252.26	0.00	0.00	0.00
				5,196.57					
15,900.00	89.84	359.76	10,499.44	5,296.57	-882.79	5,351.94	0.00	0.00	0.00
16,000.00	89.84	359.76	10,499.73	5,396.57	-883.22	5,451.62	0.00	0.00	0.00
16,100.00	89.84	359.76	10,500.02	5,496.57	-883.64	5,551.30	0.00	0.00	0.00
16,200.00	89.84	359.76	10,500.30	5,596.56	-884.07	5,650.99	0.00	0.00	0.00
16,300.00	89.84	359.76	10,500.59	5,696.56	-884.49	5,750.67	0.00	0.00	0.00
16,400.00	89.84	359.76	10,500.88	5,796.56	-884.92	5,850.35	0.00	0.00	0.00
16,500.00	89.84	359.76	10,501.16	5,896.56	-885.35	5,950.03	0.00	0.00	0.00
16,500.00	89.84	359.76	10,501.16	5,890.50	-880.30	5,950.03	0.00	0.00	
16,600.00	89.84	359.76	10,501.45	5,996.56	-885.77	6,049.71	0.00	0.00	0.00
16,700.00	89.84	359.76	10,501.73	6,096.56	-886.20	6,149.40	0.00	0.00	0.00
16,800.00	89.84	359.76	10,502.02	6,196.56	-886.62	6,249.08	0.00	0.00	0.00
16,900.00	89.84	359.76	10,502.31	6,296.55	-887.05	6,348.76	0.00	0.00	0.00
17,000.00	89.84	359.76	10,502.59	6,396.55	-887.47	6,448.44	0.00	0.00	0.00
,									
17,100.00	89.84	359.76	10,502.88	6,496.55	-887.90	6,548.12	0.00	0.00	0.00
17,200.00	89.84	359.76	10,503.16	6,596.55	-888.32	6,647.81	0.00	0.00	0.00
17,300.00	89.84	359.76	10,503.45	6,696.55	-888.75	6,747.49	0.00	0.00	0.00
17,400.00	89.84	359.76	10,503.74	6,796.55	-889.17	6,847.17	0.00	0.00	0.00
17,500.00	89.84	359.76	10,504.02	6,896.55	-889.60	6,946.85	0.00	0.00	0.00
17,600.00	89.84	359.76	10,504.31	6,996.55	-890.03	7,046.54	0.00	0.00	0.00
17,700.00	89.84	359.76	10,504.60	7,096.54	-890.45	7,146.22	0.00	0.00	0.00
17,800.00	89.84	359.76	10,504.88	7,196.54	-890.88	7,245.90	0.00	0.00	0.00
17,900.00	89.84	359.76	10,505.17	7,296.54	-891.30	7,345.58	0.00	0.00	0.00
18,000.00	89.84	359.76	10,505.45	7,396.54	-891.73	7,445.26	0.00	0.00	0.00
18,100.00	89.84	359.76	10,505.74	7,496.54	-892.15	7,544.95	0.00	0.00	0.00
18,200.00	89.84	359.76	10,506.03	7,596.54	-892.58	7,644.63	0.00	0.00	0.00
18,300.00	89.84	359.76	10,506.31	7,696.54	-893.00	7,744.31	0.00	0.00	0.00
18,400.00	89.84	359.76	10,506.60	7,796.53	-893.43	7,843.99	0.00	0.00	0.00
18,500.00	89.84	359.76	10,506.88	7,896.53	-893.85	7,943.68	0.00	0.00	0.00
18,600.00	89.84	359.76	10,507.17	7,996.53	-894.28	8,043.36	0.00	0.00	0.00
18,700.00	89.84	359.76	10,507.46	8,096.53	-894.71	8,143.04	0.00	0.00	0.00
18,800.00	89.84	359.76	10,507.74	8,196.53	-895.13	8,242.72	0.00	0.00	0.00
18,900.00	89.84	359.76	10,508.03	8,296.53	-895.56	8,342.40	0.00	0.00	0.00
19,000.00	89.84	359.76	10,508.32	8,396.53	-895.98	8,442.09	0.00	0.00	0.00
19,100.00	89.84	359.76	10,508.60	8,496.53	-896.41	8,541.77	0.00	0.00	0.00
19,200.00	89.84	359.76	10,508.89	8,596.52	-896.83	8,641.45	0.00	0.00	0.00
19,300.00	89.84	359.76	10,508.89	8,696.52	-890.85	8,741.13	0.00	0.00	0.00
19,400.00	89.84	359.76	10,509.46	8,796.52	-897.68	8,840.82	0.00	0.00	0.00
19,500.00	89.84	359.76	10,509.75	8,896.52	-898.11	8,940.50	0.00	0.00	0.00
19,600.00	89.84	359.76	10,510.03	8,996.52	-898.53	9,040.18	0.00	0.00	0.00
19,700.00	89.84	359.76	10,510.32	9,096.52	-898.96	9,139.86	0.00	0.00	0.00
19,800.00	89.84	359.76	10,510.60	9,196.52	-899.39	9,239.54	0.00	0.00	0.00
19,900.00	89.84	359.76	10,510.89	9,296.52	-899.81	9,339.23	0.00	0.00	0.00
20,000.00	89.84	359.76	10,511.18	9,396.51	-900.24	9,438.91	0.00	0.00	0.00
20,100.00	89.84	359.76	10,511.46	9,496.51	-900.66	9,538.59	0.00	0.00	0.00
20,200.00	89.84	359.76	10,511.75	9,596.51	-901.09	9,638.27	0.00	0.00	0.00
20,300.00	89.84	359.76	10,512.04	9,696.51	-901.51	9,737.95	0.00	0.00	0.00
20,400.00	89.84	359.76	10,512.32	9,796.51	-901.94	9,837.64	0.00	0.00	0.00
20,500.00	89.84	359.76	10,512.61	9,896.51	-902.36	9,937.32	0.00	0.00	0.00
20,600.00	89.84	359.76	10,512.89	9,996.51	-902.79	10,037.00	0.00	0.00	0.00
20,700.00	89.84	359.76	10,513.18	10,096.50	-903.21	10,136.68	0.00	0.00	0.00

Database:	HOPSPP	Local Co-ordinate Reference:	Well Corral Canyon 36_25 Federal Com 331H
Company: Project: Site: Well: Wellbore: Design:	ENGINEERING DESIGNS PRD NM DIRECTIONAL PLANS (NAD 1983) Corral Canyon 36-25 Fed Com Corral Canyon 36_25 Federal Com 331H Wellbore #1 Permitting Plan	TVD Reference: MD Reference: North Reference: Survey Calculation Method:	RKB=26.5' @ 3144.10ft RKB=26.5' @ 3144.10ft Grid Minimum Curvature

#### Planned Survey


Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
20,800.00	89.84	359.76	10,513.47	10,196.50	-903.64	10,236.37	0.00	0.00	0.00
20,900.00	89.84	359.76	10,513.75	10,296.50	-904.07	10,336.05	0.00	0.00	0.00
21,000.00	89.84	359.76	10,514.04	10,396.50	-904.49	10,435.73	0.00	0.00	0.00
21,100.00	89.84	359.76	10,514.32	10,496.50	-904.92	10,535.41	0.00	0.00	0.00
21,200.00	89.84	359.76	10,514.61	10,596.50	-905.34	10,635.09	0.00	0.00	0.00
21,300.00	89.84	359.76	10,514.90	10,696.50	-905.77	10,734.78	0.00	0.00	0.00
21,370.92	89.84	359.76	10,515.10	10,767.42	-906.07	10,805.47	0.00	0.00	0.00

Desi	ign	Targe	ts
------	-----	-------	----

Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (ft)	+N/-S (ft)	+E/-W (ft)	Northing (usft)	Easting (usft)	Latitude	Longitude
FTP (Corral Canyon - plan hits target cer - Point	0.00 nter	0.00	10,485.10	283.82	-861.47	424,641.30	661,942.80	32° 10' 0.539922 N	103° 56' 36.826682
PBHL (Corral Canyon - plan hits target cer - Point	0.00 nter	0.00	10,515.10	10,767.42	-906.07	435,124.10	661,898.20	32° 11' 44.278287 N	103° 56' 36.903709

## Plan Annotations

Measured	Vertical	Local Coor	dinates	
Depth (ft)	Depth (ft)	+N/-S (ft)	+E/-W (ft)	Comment
()	()	(11)	(11)	Comment
4,780.00	4,780.00	0.00	0.00	Build 1°/100'
5,780.48	5,775.40	-30.68	-81.55	Hold 10° Tangent
9,954.13	9,885.58	-286.04	-760.18	KOP, Build & Turn 10°/100'
10,887.19	10,485.10	283.82	-861.47	Landing Point
21,370.92	10,515.10	10,767.42	-906.07	TD at 21370.92' MD

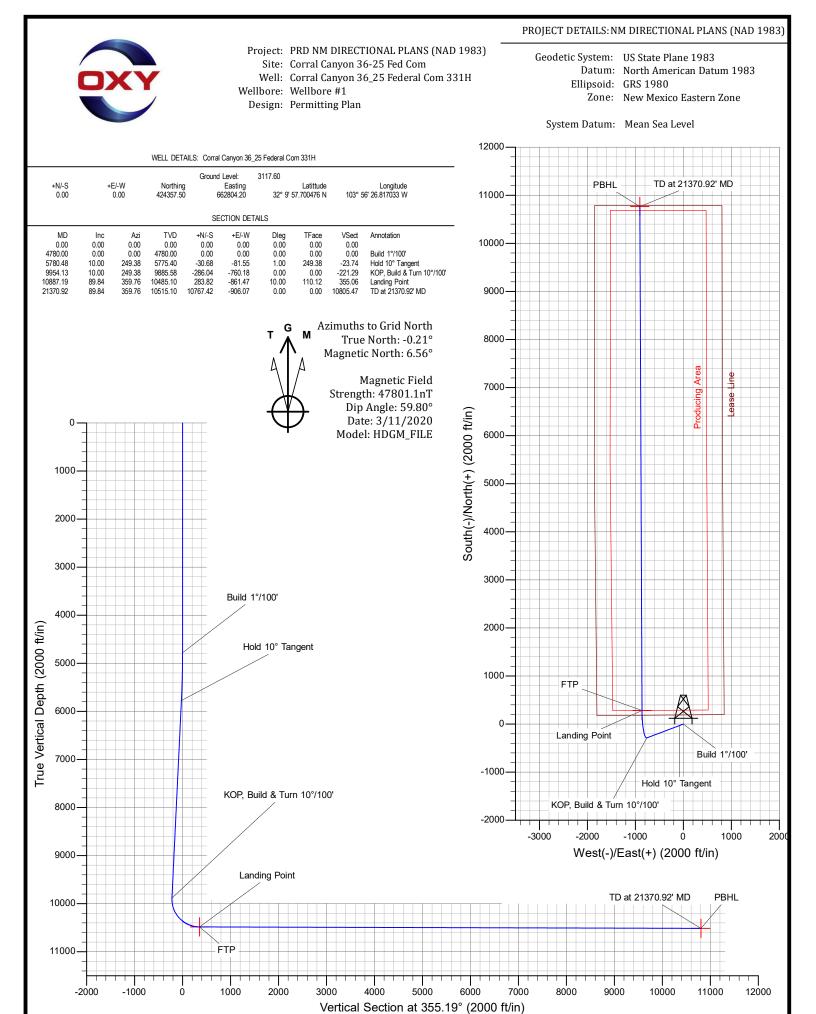

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

#### GAS CAPTURE PLAN

Date: 07/18/2019

 $\boxtimes$  Original

Operator & OGRID No.: OXY USA INC. - 16696

□ Amended - Reason for Amendment:

This Gas Capture Plan outlines actions to be taken by the Operator to reduce well/production facility flaring/venting for new completion (new drill, recomplete to new zone, re-frac) activity.

Note: Form C-129 must be submitted and approved prior to exceeding 60 days allowed by Rule (Subsection A of 19.15.18.12 NMAC).

#### Well(s)/Production Facility – Name of facility

The well(s) that will be located at the production facility are shown in the table below.

Well Name	ΑΡΙ	Well Location (ULSTR)	Footages	Expected MCF/D	Flared or Vented	Comments
Corral Canyon 36-25 Fd Com 331H	Pending	4-1-25S-29E	560 FNL 1013 FWL	5300	0	
Corral Canyon 36-25 Fd Com 332H	Pending	4-1-25S-29E	560 FNL 1048 FWL	5300	0	
Corral Canyon 36-25 Fd Com 333H	Pending	1-1-25S-29E	980 FNL 740 FEL	5300	0	
Corral Canyon 36-25 Fd Com 334H	Pending	1-1-25S-29E	980 FNL 705FEL	5300	0	

#### **Gathering System and Pipeline Notification**

Well(s) will be connected to a production facility after flowback operations are complete, where a gas transporter system is in place. The gas produced from the production facility is sent to <u>ETC Texas Pipeline, LTD ("ETC"</u>) and is connected to <u>ETC</u> high pressure gathering system located in Eddy County, New Mexico. <u>OXY USA INC. ("OXY"</u>) provides (periodically) to <u>ETC</u> a drilling, completion and estimated first production date for wells that are scheduled to be drilled in the foreseeable future. In addition, <u>OXY</u> and <u>ETC</u> have periodic conference calls to discuss changes to drilling and completion schedules. Gas from these wells will be processed at Orla Plant Processing Plant located in Sec. 35, Block 57, T2, T&P RR CO, Reeves, County, Texas. The actual flow of the gas will be based on compression operating parameters and gathering system pressures.

#### **Flowback Strategy**

After the fracture treatment/completion operations, well(s) will be produced to temporary production tanks and gas will be flared or vented. During flowback, the fluids and sand content will be monitored. When the produced fluids contain minimal sand, the wells will be turned to production facilities. Gas sales should start as soon as the wells start flowing through the production facilities, unless there are operational issues on <u>Enterprise</u> system at that time. Based on current information, it is <u>OXY's</u> belief the system can take this gas upon completion of the well(s).

Safety requirements during cleanout operations from the use of underbalanced air cleanout systems may necessitate that sand and non-pipeline quality gas be vented and/or flared rather than sold on a temporary basis.

#### **Alternatives to Reduce Flaring**

Below are alternatives considered from a conceptual standpoint to reduce the amount of gas flared.

- Power Generation On lease
  - Only a portion of gas is consumed operating the generator, remainder of gas will be flared
- Compressed Natural Gas On lease
  - Gas flared would be minimal, but might be uneconomical to operate when gas volume declines
- NGL Removal On lease
  - o Plants are expensive, residue gas is still flared, and uneconomical to operate when gas volume declines

# **OXY USA Inc** APD ATTACHMENT: SPUDDER RIG DATA

## **OPERATOR NAME / NUMBER:** OXY USA Inc


#### 1. SUMMARY OF REQUEST:

Oxy USA respectfully requests approval for the following operations for the surface hole in the drill plan:

1. Utilize a spudder rig to pre-set surface casing for time and cost savings.

#### 2. Description of Operations

- 1. Spudder rig will move in to drill the surface hole and pre-set surface casing on the well.
  - **a.** After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
  - **b.** The spudder rig will utilize fresh water-based mud to drill the surface hole to TD. Solids control will be handled entirely on a closed loop basis. No earth pits will be used.
- 2. The wellhead will be installed and tested as soon as the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange at the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
  - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- 4. Spudder rig operations are expected to take 2-3 days per well on the pad.
- 5. The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 6. Drilling operations will begin with a larger rig and a BOP stack equal to or greater than the pressure rating that was permitted will be nippled up and tested on the wellhead before drilling operations resume on each well.
  - **a.** The larger rig will move back onto the location within 90 days from the point at which the wells are secured and the spudder rig is moved off location.
  - **b.** The BLM will be contacted / notified 24 hours before the larger rig moves back on the pre-set locations.
- 7. Oxy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- **8.** Once the rig is removed, Oxy will secure the wellhead area by placing a guard rail around the cellar area.

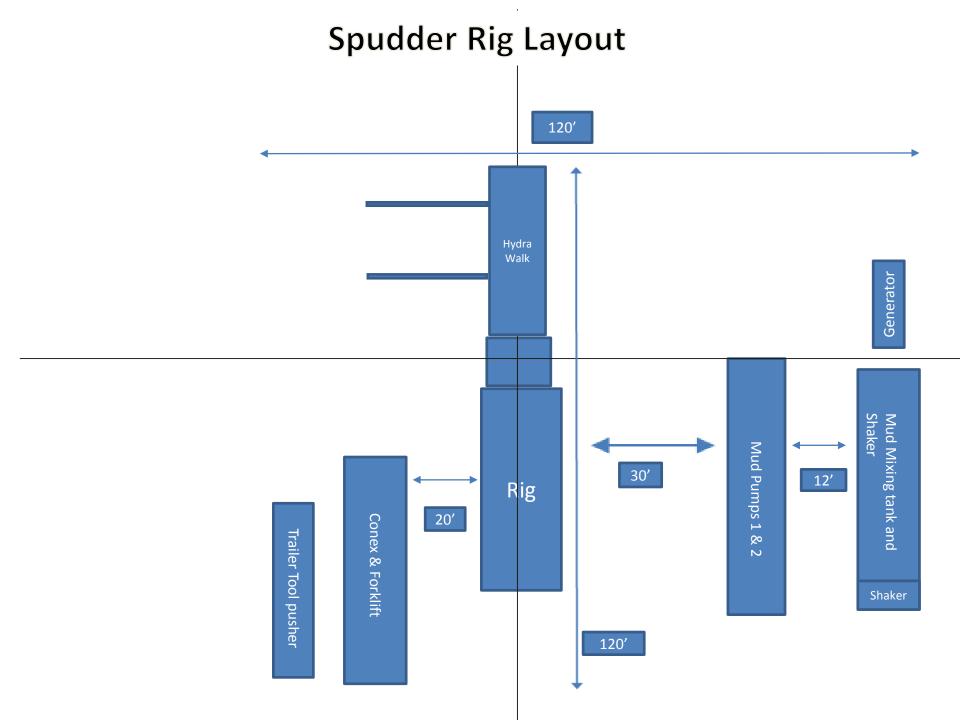

## 1. Geologic Formations

TVD of target	10515'	Pilot Hole Depth	N/A
MD at TD:	21371'	Deepest Expected fresh water:	434'

#### **Delaware Basin**

Formation	TVD - RKB	<b>Expected Fluids</b>
Rustler	279	
Salado	647	Salt
Castile	1,821	Salt
Lamar/Delaware	3,316	Oil/Gas/Brine
Bell Canyon	3,350	Oil/Gas/Brine
Cherry Canyon	4,225	Oil/Gas/Brine
Brushy Canyon	5,590	Losses
Bone Spring	7,097	Oil/Gas
1st Bone Spring	8,022	Oil/Gas
2nd Bone Spring	8,894	Oil/Gas
3rd Bone Spring	9,946	Oil/Gas
Wolfcamp	10,293	Oil/Gas

\*H2S, water flows, loss of circulation, abnormal pressures, etc.

# 2. Casing Program

									Buoyant	Buoyant
Hala Cina (im)	Casing Int	terval	Csg. Size	sg. Size Weight				SF Burst	Body SF	Joint SF
Hole Size (in)	From (ft)	To (ft)	(in)	(lbs)	Grade	Conn.	Collapse	SF Burst	Tension	Tension
14.75	0	587	10.75	40.5	J-55	BTC	1.125	1.2	1.4	1.4
9.875	0	10787	7.625	26.4	L-80 HC	BTC	1.125	1.2	1.4	1.4
6.75	0	21371	5.5	20	P-110	DQX	1.125	1.2	1.4	1.4
							SF Value	es will meet o	or Exceed	

All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 III.B.1.h \*Oxy requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool may be run in case hole conditions merit pumping a second stage cement job to comply with permitted top of cement. If cement circulated to surface during first stage, we will drop a cancelation cone and not pump the second stage.

\*Oxy requests the option to run production casing with DQX, SF TORQ, and/or DQW TORQ connections to accommodate hole conditions or drilling operations.

# **Annular Clearance Variance Request**

As per the agreement reached in the Oxy/BLM face-to-face meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422" annular clearance requirement from Onshore Order #2 under the following conditions:

- 1. Annular clearance to meet or exceed 0.422" between intermediate casing ID and production casing coupling only on the first 500' overlap between both casings.
- 2. Annular clearance less than 0.422" is acceptable for the curve and lateral portions of the production open hole section.

	Y or N				
Is casing new? If used, attach certification as required in Onshore Order #1	Y				
Does casing meet API specifications? If no, attach casing specification sheet.					
Is premium or uncommon casing planned? If yes attach casing specification sheet.					
Does the above casing design meet or exceed BLM's minimum standards? If not provide justification (loading assumptions, casing design criteria).	Y				
Will the intermediate pipe be kept at a minimum 1/3 fluid filled to avoid approaching the collapse pressure rating of the casing?	Y				
Is well located within Capitan Reef?	N				
If yes, does production casing cement tie back a minimum of 50' above the Reef?					
Is well within the designated 4 string boundary.					
Is well located in SOPA but not in R-111-P?	N				
If yes, are the first 2 strings cemented to surface and 3 <sup>rd</sup> string cement tied back 500' into previous casing?					
Is well located in R-111-P and SOPA?	N				
If yes, are the first three strings cemented to surface?					
Is 2 <sup>nd</sup> string set 100' to 600' below the base of salt?					
Is well located in high Cave/Karst?	N				
If yes, are there two strings cemented to surface?					
(For 2 string wells) If yes, is there a contingency casing if lost circulation occurs?					
Is well located in critical Cave/Karst?	N				
If yes, are there three strings cemented to surface?					

# 3. Cementing Program

Casing String	# Sks	Wt. (lb/gal)	Yld (ft3/sack)	H20 (gal/sk)	500# Comp. Strength (hours)	Slurry Description	
Surface (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	
Surface (Tail)	478	14.8	1.33	6.365	5:26	Class C Cement, Accelerator	
Intermediate 1st Stage (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	
Intermediate 1st Stage (Tail)	683	13.2	1.65	8.640	11:54	Class H Cement, Retarder, Dispersant, Salt	
Intermediate 2nd Stag	ge (Tail Slurry	y) to be pumpe	d as Bradenhe	ead Squeeze f	rom surface, o	lown the Intermediate annulus	
Intermediate 2nd Stage (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	
Intermediate 2nd Stage (Tail)	718	12.9	1.92	10.41	23:10	Class C Cement, Accelerator	
Production (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	
Production (Tail)	813	13.2	1.38	6.686	3:39	Class H Cement, Retarder, Dispersant, Salt	

Casing String	Top (ft)	Bottom (ft)	% Excess
Surface (Lead)	N/A	N/A	N/A
Surface (Tail)	0	587	100%
Intermediate 1st Stage (Lead)	N/A	N/A	N/A
Intermediate 1st Stage (Tail)	5840	10787	5%
Intermediate 2nd Stage (Lead)	N/A	N/A	N/A
Intermediate 2nd Stage (Tail)	0	5840	10%
Production (Lead)	N/A	N/A	N/A
Production (Tail)	10287	21371	20%

Oxy requests a variance to cement the 9.625" and/or 7.625" intermediate casing strings offline in accordance to the approved variance, EC Tran 461365.

The summarized operational sequence will be as follows:

- 1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment (float collar and shoe).
- 2. Land casing.
- 3. Fill pipe with kill weight fluid, and confirm well is static.
  - a. If well is not static notify BLM and kill well.
  - b. Once well is static notify BLM with intent to proceed with nipple down and offline cementing.
- 4. Set and pressure test annular packoff.
- 5. After confirmation of both annular barriers and internal barriers, nipple down BOP and install cap flange. If any barrier fails to test, the BOP stack will not be nippled down until after the cement job is completed.
- 6. Skid rig to next well on pad.
- 7. Confirm well is static before removing cap flange.
- 8. If well is not static notify BLM and kill well prior to cementing or nippling up for further remediation.

- 9. Install offline cement tool.
- 10. Rig up cement equipment.
  - a. Notify BLM prior to cement job.
- 11. Perform cement job.
- 12. Confirm well is static and floats are holding after cement job.
- 13. Remove cement equipment, offline cement tools and install night cap with pressure gauge for monitoring.

Oxy requests permission to adjust the CBL requirement after bradenhead cement jobs, on 7-5/8" intermediate casings, as per the agreement reached in the OXY/BLM meeting on September 5, 2019.

## Three string wells:

- CBL will be required on one well per pad
- If the pumped volume of cement is less than permitted in the APD, BLM will be notified and a CBL may be run
- Echometer will be used after bradenhead cement job to determine TOC before pumping top-out cement

## **Pilot Hole Cementing specs:**

Pilot hole depth: N/A KOP: N/A

Plug top	Plug Bottom	% Excess	No. Sacks	Wt. lb/gal	Yld ft3/sack	Water gal/sk	Slurry Description and Cement Type
N/A							
N/A							

## 4. Pressure Control Equipment

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		✓	Tested to:	
	5M		Annula	r	~	70% of working pressure	
9.875" Hole	13-5/8"		Blind Ra	am	1		
9.875" Hole	13-3/8	5M	5M	5M Pipe Ram Double Ram			250 mai / 5000 mai
						~	250 psi / 5000 psi
			Other*				
	5M Annular		r	~	70% of working pressure		
(75" Hala	12 5/0"		Blind Ra	am	✓		
6.75" Hole	13-5/8"	5 M	Pipe Ra	m		250 mai / 5000 mai	
		5M	Double F	Ram	~	250 psi / 5000 psi	
			Other*				

\*Specify if additional ram is utilized.

Oxy will utilize a 5M annular with a 10M BOPE stack. The BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and tested.

Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. See attached schematics.

Formation integrity test will be performed per Onshore Order #2. On Exploratory wells or on that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Will be tested in accordance with Onshore Oil and Gas Order #2 III.B.1.i.						
	ance is requested for the use of a flexible choke line from the BOP to Choke old. See attached for specs and hydrostatic test chart.					
Y	Are anchors required by manufacturer?					
and co per Or require system that is	tibowl or a unionized multibowl wellhead system will be employed. The wellhead onnection to the BOPE will meet all API 6A requirements. The BOP will be tested ashore Order #2 after installation on the surface casing which will cover testing ements for a maximum of 30 days. If any seal subject to test pressure is broken the n must be tested. We will test the flange connection of the wellhead with a test port directly in the flange. We are proposing that we will run the wellhead through the prior to cementing surface casing as discussed with the BLM on October 8, 2015.					
See at	tached schematics.					

## **BOP Break Testing Request**

Oxy requests permission to adjust the BOP break testing requirements as per the agreement reached in the OXY/BLM meeting on September 5, 2019. A separate sundry will be sent prior to spud that reflects the pad based break testing plan.

BOP break test under the following conditions:

- After a full BOP test is conducted
- When skidding to drill an intermediate section where ICP is set into the third Bone Spring or shallower.
- When skidding to drill a production section that does not penetrate into the third Bone Spring or deeper.

If the kill line is broken prior to skid, two tests will be performed.

- 1) Wellhead flange, co-flex hose, kill line connections and upper pipe rams
- 2) Wellhead flange, HCR valve, check valve, upper pipe rams

If the kill line is not broken prior to skid, only one test will be performed.

1) Wellhead flange, co-flex hose, check valve, upper pipe rams

# 5. Mud Program

Depth		Trme	Weight		Water Logg
From (ft)	To (ft)	Туре	(ppg)	Viscosity	Water Loss
0	587	Water-Based Mud	8.6-8.8	40-60	N/C
587	10787	Saturated Brine- Based or Oil-Based Mud	8.0-10.0	35-45	N/C
10787	21371	Water-Based or Oil- Based Mud	9.5-12.0	38-50	N/C

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CACL2. Oxy will use a closed mud system.

What will be used to monitor the loss or gain	PVT/MD Totco/Visual Monitoring
of fluid?	

## 6. Logging and Testing Procedures

Logging, Coring and Testing.		
Yes	Will run GR from TD to surface (horizontal well – vertical portion of hole). Stated logs	
	run will be in the Completion Report and submitted to the BLM.	
No	Logs are planned based on well control or offset log information.	
No	Drill stem test? If yes, explain	
No	Coring? If yes, explain	

Addi	tional logs planned	Interval
No	Resistivity	
No	Density	
No	CBL	
Yes	Mud log	ICP - TD
No	PEX	

# 7. Drilling Conditions

Condition	Specify what type and where?
BH Pressure at deepest TVD	6562 psi
Abnormal Temperature	No
BH Temperature at deepest TVD	165°F

Pump high viscosity sweeps as needed for hole cleaning. The mud system will be monitored visually/manually as well as with an electronic PVT. The necessary mud products for additional weight and fluid loss control will be on location at all times. Appropriately weighted mud will be used to isolate potential gas, oil, and water zones until such time as casing can be cemented into place for zonal isolation.

Hydrogen Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered, measured values and formations will be provided to the BLM.

NH2S is presentYH2S Plan attached

## 8. Other facets of operation

	Yes/No
<ul> <li>Will the well be drilled with a walking/skidding operation? If yes, describe.</li> <li>We plan to drill the two well pad in batch by section: all surface sections, intermediate sections and production sections. The wellhead will be secured with a night cap whenever the rig is not over the well.</li> </ul>	Yes
<ul> <li>Will more than one drilling rig be used for drilling operations? If yes, describe.</li> <li>Oxy requests the option to contract a Surface Rig to drill, set surface casing, and cement for this well. If the timing between rigs is such that Oxy would not be able to preset surface, the Primary Rig will MIRU and drill the well in its entirety per the APD. Please see the attached document for information on the spudder rig.</li> </ul>	Yes

## Total estimated cuttings volume: 1558.8 bbls.

Attachments

- \_x\_\_ Directional Plan
- \_x\_\_ H2S Contingency Plan
- \_x\_\_ Flex III Attachments
- \_x\_\_ Spudder Rig Attachment
- \_x\_\_ Premium Connection Specs

# 9. Company Personnel

Name	<u>Title</u>	Office Phone	Mobile Phone
Garrett Granier	Drilling Engineer	713-513-6633	832-265-0581
William Turner	Drilling Engineer Supervisor	713-350-4951	661-817-4586
Simon Benavides	Drilling Superintendent	713-522-8652	281-684-6897
Diego Tellez	Drilling Manager	713-350-4602	713-303-4932

# OXY USA Inc. APD Attachment Offline Cementing

OXY respectfully requests a variance to cement the 9-5/8" and/or 7-5/8" intermediate casing strings offline.

The summarized operational sequence will be as follows:

- 1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment (float collar and shoe).
- 2. Land casing.
- 3. Fill pipe with kill weight fluid, and confirm well is static.
  - a. If well is not static notify BLM and kill well.
  - b. Once well is static notify BLM with intent to proceed with nipple down and offline cementing.
- 4. Set and pressure test annular packoff.
- 5. After confirmation of both annular barriers and internal barriers, nipple down BOP and install cap flange. If any barrier fails to test, the BOP stack will not be nippled down until after the cement job is completed.
- 6. Skid rig to next well on pad.
- 7. Confirm well is static before removing cap flange.
- 8. If well is not static notify BLM and kill well prior to cementing or nippling up for further remediation.
- 9. Install offline cement tool.
- 10. Rig up cement equipment.
  - a. Notify BLM prior to cement job.
- 11. Perform cement job.
- 12. Confirm well is static and floats are holding after cement job.
- 13. Remove cement equipment, offline cement tools and install night cap with pressure gauge for monitoring.

