Form 3160-5 (June 2015)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SEPORD 2018 sia

FORM APPROVED

	OM	B NO	. 100	4-0	137
	Expin	es: Jan	uary	31,	2018
_					


SUNDRY NOTICES AND REPORTS ON WEIRIGT II-ARTESIA O.C.D.

5. Lease Serial No. NMNM86908

De4 46!									
Do not use thi abandoned wel	6. If Indian, Allottee or Tribe Name								
SUBMIT IN 1	7. If Unit or CA/Agree	ment, Name and/or No.							
Type of Well     ☐ Gas Well    ☐ Oth	8. Well Name and No. MITHCELL 21 FEDERAL 2								
Name of Operator     OXY USA INCORPORATED	9. API Well No. 30-015-28710-00-S1								
3a. Address 5 GREENWAY PLAZA SUITE HOUSTON, TX 77046-0521	110	3b. Phone No. (i Ph: 432.685.	include area code) 5717		10. Field and Pool or E CEDAR CANYO	exploratory Area			
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description	)			11. County or Parish, S	State			
Sec 21 T24S R29E NWSE					EDDY COUNTY	, NM			
12. CHECK THE AF	PROPRIATE BOX(ES)	TO INDICATI	E NATURE OI	F NOTICE,	REPORT, OR OTH	ER DATA			
TYPE OF SUBMISSION TYPE OF ACTION									
Notice of Intent     ■     Notice of Intent     Notice of Inten	☐ Acidize ☐ D		Deepen		ion (Start/Resume)	■ Water Shut-Off			
_	☐ Alter Casing ☐ Hye		ulic Fracturing	☐ Reclam	ation	■ Well Integrity			
☐ Subsequent Report	□ Casing Repair	sing Repair		☐ Recomp		Other			
☐ Final Abandonment Notice	☐ Change Plans		nd Abandon		arily Abandon				
	Convert to Injection	Plug F		☐ Water I	<u> </u>				
13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.  TD-7900' PBTD-7000' Perfs-5219-6302' CIBP-7000'  TD-7900' PBTD-7000' Perfs-5219-6302' CIBP-7000'  TO-3/4" 40.5# csg @ 533' w/ 510sx, 14-3/4" hole, TOC-Surf-Circ  7-5/8" 29.7# csg @ 2810' w/ 760sx, 9-5/8" hole, TOC-Surf-Circ  4-1/2" 11.6# csg @ 7900' DVT @ 5979',4004' w/1165sx,6-3/4" hole, TOC-1000'-CBL  RIH & set CIBP @ 6164' w/ 25sx cmt to 5929' wo C Toc (DVT)  RRH& Set CIBP @ 6164' w/ 25sx cmt to 5929' wo C Toc (DVT)  RRH& Set CIBP @ 6164' w/ 25sx cmt to 5929' wo C Toc (DVT)  M&P 25sx cmt @ 4060-3810' WOC-Tag  M&P 25sx cmt @ 5169' w/ 25sx cmt to 5929' wo C Toc (DVT)  SEE ATTACHED FOR CONDITIONS OF APPROVAL									
	Electronic Submission # For OXY USA	A INCORPORATI	EĎ, sent to the	Carlsbad	-				
Commi Name (Printed/Typed) DAVID ST	tted to AFMSS for process	sing by DEBORA	AH MCKINNEY o	on 08/20/201 ATORY AD	•				
Nume (17 micur 19 peu) DAVID 31	LWAIN		THE REGUL	ATOKT AD	VISOR				
Signature (Electronic S	ubmission)	1	Date 08/17/20	018	<u></u>				
<u> </u>	THIS SPACE FO	OR FEDERAL	OR STATE	OFFICE U	SE				
Approved By James	a. ams.		Title Suft	9. FE	7	8-26-18 Date			
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would enable the applicant to condu	itable title to those rights in the ct operations thereon.	e subject lease	Office Car	shad		Hice			
Title 18 U.S.C. Section 1001 and Title 43	U.S.C. Section 1212, make it a	crime for any pers	on knowingly and	willfully to m	ake to any department or	agency of the United			

(Instructions on page 2) \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

OXY USA Inc. - Current Mitchell 21 Federal #2 API No. 30-015-28710

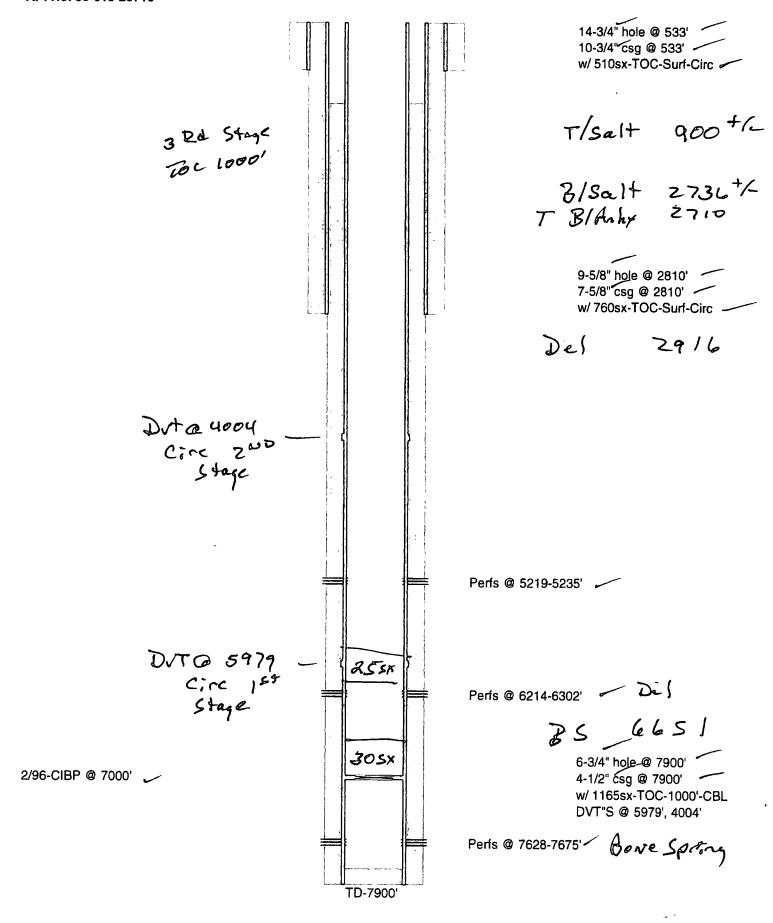

OXY USA Inc. - Proposed Mitchell 21 Federal #2 API No. 30-015-28710

200sx @ 830'-Surface

14-3/4" hole @ 533' 10-3/4" csg @ 533' w/ 510sx-TOC-Surf-Circ


2966 25sx @ <del>2860</del>-2610' WOC-Tag

25sx @ 4060-3810' WOC-Tag

CIBP @ 5169' w/ 25sx to 4920'

CIBP @ 6164' w/ 25sx to 5929'

2/96-CIBP @ 7000'

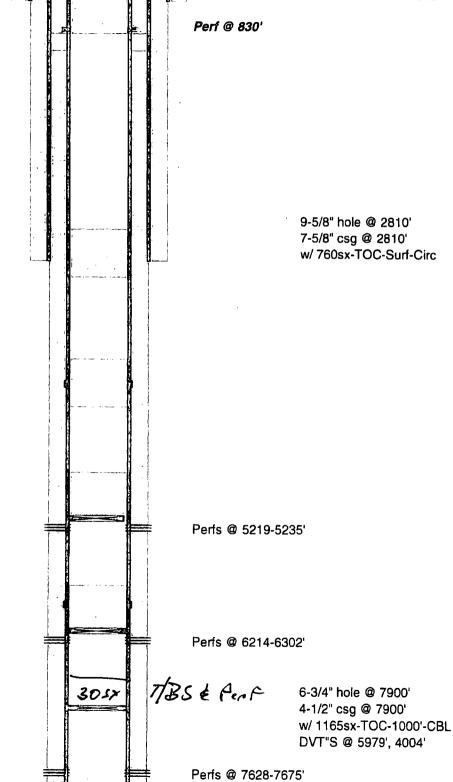

TD-7900

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brime** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.