
Form 3160-5		OCD Artesia			
	UNITED STATES EPARTMENT OF THE INTE BUREAU OF LAND MANAGEN		OMB	M APPROVED NO. 1004-0137 January 31, 2018	
SUNDRY NOTICES AND REPORTS ON WELLS			5. Lease Serial No. NMLC029339	Α	
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			6. If Indian, Allotte	e or Tribe Name	
SUBMIT IN TRIPLICATE - Other Instructions on page 2			7. If Unit or CA/Ag	7. If Unit or CA/Agreement, Name and/or No.	
<ol> <li>Type of Well</li> <li>Oil Well Gas Well Other</li> </ol>			8. Well Name and N GJSAU 14	lo.	
2. Name of Operator Contact: LESLIE GARVIS BURNETT OIL CO.INC. E-Mail: LGARVIS@BURNETTOIL.COM			9. API Well No. 30-015-04136	9. API Well No. 30-015-04136	
3a. Address BURNETT PLAZA - UNIT 9 8 FORT WORTH, TX 76102	3b 301 CHERRY STREET - SUPP F>	. Phone No. (include area code) E 807/078864098701113:17610 K: 817-332-8438-ESIA DISTRIC	10. Field and Pool of Carry 10. Field and		
4. Location of Well (Footage, Sec., 1	T., R., M., or Survey Description)		11. County or Paris	h, State	
Sec 13 T17S R30E Mer NMF	' SWSE 660FSL 1980FEL	JAN 31 2019	EDDY COUN	TY, NM	
12. CHECK THE A	PPROPRIATE BOX(ES) TO	INDICATE NATURE OF NO	TICE, REPORT, OR O	THER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION				
Notice of Intent			Production (Start/Resume)	U Water Shut-Off	
Subsequent Report	Alter Casing		Reclamation	Well Integrity	
Final Abandonment Notice	<ul> <li>Casing Repair</li> <li>Change Plans</li> </ul>		Recomplete Temporarily Abandon	Other	
	Convert to Injection		Water Disposal		
5. Spot 40 sxs cmt @ 1,617' 6. Spot 55 sxs cmt @ 1,294' 7. Spot 50 sxs cmt @ 582' 4 8. Spot 55 sxs cmt @ 225' - 0	-1,517'. Perf/Sqz/Tag - 1,075'. Perf/Sqz/Tag .00' Perf/Sqz/Tag	-	SEE ATTACH CONDITIONS GC 4	S OF APPROVA	
A 1 .	level day hole	marker reau	ired		
Below ground					
14. I hereby certify that the foregoing i	Electronic Submission #4419	920 verified by the BLM Well Info OIL CO.INC., sent to the Carlsb	rmation System ad		
	Electronic Submission #4419 For BURNETT	920 verified by the BLM Well Info OIL CO.INC., sent to the Carlsba	rmation System ad RY MANAGER		
14. I hereby certify that the foregoing i Name (Printed/Typed) LESLIE C	Electronic Submission #4419 For BURNETT	920 verified by the BLM Well Info OIL CO.INC., sent to the Carlsba	ad		
14. 1 hereby certify that the foregoing i Name (Printed/Typed) LESLIE C	Electronic Submission #4419 For BURNETT GARVIS Submission)	920 verified by the BLM Well Info OIL CO.INC., sent to the Carlsba Title REGULATO	ad RY MANAGER		
14. 1 hereby certify that the foregoing i Name (Printed/Typed) LESLIE C	Electronic Submission #4419 For BURNETT GARVIS Submission)	920 verified by the BLM Well Info OIL CO.INC., sent to the Carlsba Title REGULATO Date 10/30/2018	ad RY MANAGER	/- 22 -/ 9 Date	
14. 1 hereby certify that the foregoing i         Name (Printed/Typed)       LESLIE C         Signature       (Electronic         Approved By       Conditions of approved, if any, are attached bertify that the applicant holds legal or equilibrium	Electronic Submission #411 For BURNETT GARVIS Submission) THIS SPACE FOR I Contemposed of this notice does not a quitable title to those rights in the sub-	920 verified by the BLM Well Info OIL CO.INC., sent to the Carlsba Title REGULATO Date 10/30/2018 FEDERAL OR STATE OFF	ad RY MANAGER		
14. 1 hereby certify that the foregoing i Name (Printed/Typed) LESLIE C Signature (Electronic	Electronic Submission #4419 For BURNETT GARVIS Submission) THIS SPACE FOR ed. Approval of this notice does not quitable title to those rights in the sub- luct operations thereon. 3 U.S.C. Section 1212, make it a crim	P20 verified by the BLM Well Info OIL CO.INC., sent to the Carlsba Title REGULATO Date 10/30/2018 FEDERAL OR STATE OFF Title SACT warrant or ject lease Office CFO	NY MANAGER	Date	

Burnett Oil CO., Inc.

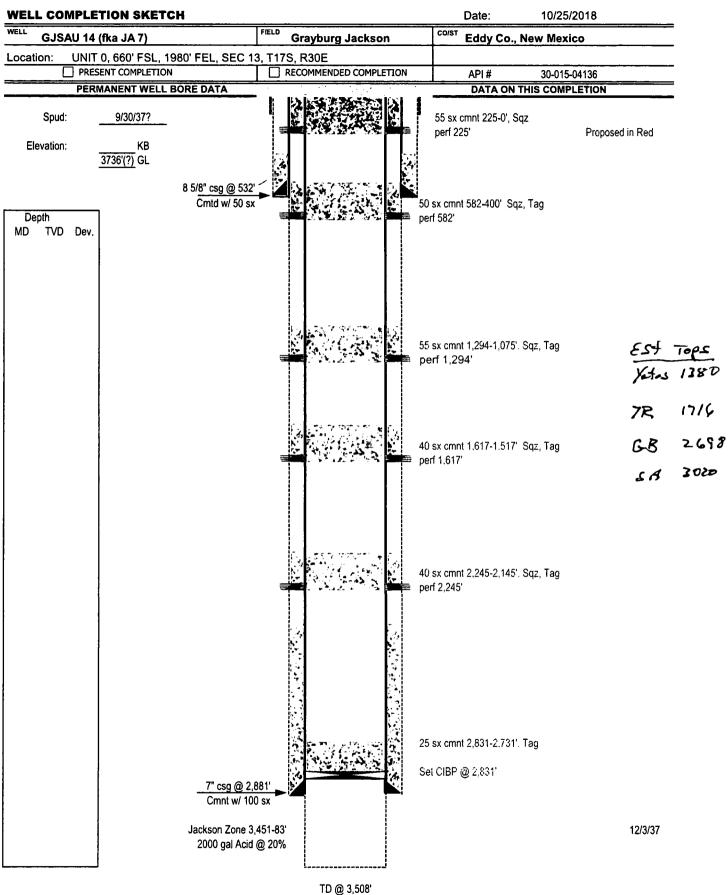

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

. . .

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the <b>BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted