RECEIVED

Form 3160-3, (June 2015)

MAR 2 6 2019 UNITED STATES

DEPARTMENT OF THE INTERIOR

DISTRICT II-ARTESIA O. D. F. LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER

FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018

5. Lease Se	rial No.	
NMNM097	120	
6 If Indian	Allotee or Tribe Name	

1a. Type of work: DRILL RI	EENT	ER			7. If Unit or CA Agre	eement, l	Name and No.
1b. Type of Well: Oil Well Gas Well Ot	her				0.1	U.II NI.	
	ngle Z	one [Multiple Zone		8. Lease Name and V		
Type of completion Type and I take a ring	11510 2	L			BODACIOUS 5-32	FED CO	OM WCB
					⁶⁴ 325	33	8
Name of Operator CHISHOLM ENERGY OPERATING LLC		,	372137	1	9. API Well No.	-4	5837
3a. Address			o. (include area code	2).	10. Field and Pool, o	•	•
801 Cherry St., Suite 1200 Unit 20 Fort Worth TX 76102	(817)469-11	104		PURPLE SAGE / W	VOLFC#	AMP
4. Location of Well (Report location clearly and in accordance w	vith ar	ıy State	requirements.*)		11. Sec., T. R. M. or		•
At surface LOT O / 230 FSL / 1840 FEL / LAT 32.3269	649 /	LONG	-104.313014		SEC 5 / T23S / R26	SE / NM	P
At proposed prod. zone LOT A / 330 FNL / 400 FEL / LA	Т 32.3	355163	/ LONG -104.3080)161			
14. Distance in miles and direction from nearest town or post offi 6 miles	ce*			'	12. County or Parish EDDY		13. State NM
15. Distance from proposed*	16. 1	No of ac	res in lease	17. Spacii	ng Unit dedicated to th	is well	
location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	642.	36		641.579			
18 Distance from proposed location*	19. I	ropose	d Depth	20. BLM/	BIA Bond No. in file		
to nearest well, drilling, completed, 30 feet applied for, on this lease, ft.	9455 feet / 20086 feet FED: NI				/IB001468		
21. Elevations (Show whether DF, KDB, RT, GL, etc.)	22. /	Approxi	mate date work will	start*	23. Estimated duration	on	
3364 feet	01/0	1/2019			30 days		
	24.	Attac	hments				
The following, completed in accordance with the requirements of (as applicable)	Onsh	ore Oil	and Gas Order No. 1	, and the H	Hydraulic Fracturing ru	ıle per 4.	3 CFR 3162.3-3
Well plat certified by a registered surveyor.			4 Bond to cover th	e operation	is unless covered by an	existing	bond on file (see
2. A Drilling Plan.			Item 20 above).	c operation	E unicas covered by un	caising	cond on the (see
A Surface Use Plan (if the location is on National Forest System SUPO must be filed with the appropriate Forest Service Office		ds, the	5. Operator certific 6. Such other site sp BLM.		rmation and/or plans as	may be r	equested by the
25. Signature		Name	(Printed/Typed)			Date	
(Electronic Submission)		Jennif	er Elrod / Ph: (817)953-3728	3	07/25/2	2018
Title Senior Regulatory Technician							
Approved by (Signature)		i .	(Printed/Typed)			Date	
(Electronic Submission)			en / Ph: (575)234-5	5978		12/21/2	2018
Title Wildlife Biologist		Office	: SBAD				
Application approval does not warrant or certify that the applicar	ıt hold			rose riahte	in the subject lease w	hich wou	ld entitle the
applicant to conduct operations thereon. Conditions of approval, if any, are attached.	HVIC	o regai	or educable filte to th	no iigiib	in the subject least W	шен жос	as chine me
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, n	nake ii	a crime	for any nerson know	wingly and	willfully to make to a	nv denar	tment or agency

pproval Date: 12/21/2018

of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*(Instructions on page 2)

INSTRUCTIONS

GENERAL: This form is designed for submitting proposals to perform certain well operations, as indicated on Federal and Indian lands and leases for action by appropriate Federal agencies, pursuant to applicable Federal laws and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from local Federal offices.

ITEM I: If the proposal is to redrill to the same reservoir at a different subsurface location or to a new reservoir, use this form with appropriate notations. Consult applicable Federal regulations concerning subsequent work proposals or reports on the well.

ITEM 4: Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local Federal offices for specific instructions.

ITEM 14: Needed only when location of well cannot readily be found by road from the land or lease description. A plat, or plats, separate or on the reverse side, showing the roads to, and the surveyed location of, the wen, and any other required information, should be furnished when required by Federal agency offices.

ITEMS 15 AND 18: If well is to be, or has been directionany drilled, give distances for subsurface location of hole in any present or objective productive zone.

ITEM 22: Consult applicable Federal regulations, or appropriate officials, concerning approval of the proposal before operations are started.

ITEM 24: If the proposal will involve hydraulic fracturing operations, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The Privacy Act of 1974 and regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 25 U.S.C. 396; 43 CFR 3160

PRINCIPAL PURPOSES: The information will be used to: (1) process and evaluate your application for a permit to drill a new oil, gas, or service wen or to reenter a plugged and abandoned well; and (2) document, for administrative use, information for the management, disposal and use of National Resource Lands and resources including (a) analyzing your proposal to discover and extract the Federal or Indian resources encountered; (b) reviewing procedures and equipment and the projected impact on the land involved; and (c) evaluating the effects of the proposed operation on the surface and subsurface water and other environmental impacts.

ROUTINE USE: Information from the record and/or the record win be transferred to appropriate Federal, State, and local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecution, in connection with congressional inquiries and for regulatory responsibilities.

EFFECT OF NOT PROVIDING INFORMATION: Filing of this application and disclosure of the information is mandatory only if you elect to initiate a drilling or reentry operation on an oil and gas lease.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM conects this information to anow evaluation of the technical, safety, and environmental factors involved with drilling for oil and/or gas on Federal and Indian oil and gas leases. This information will be used to analyze and approve applications. Response to this request is mandatory only if the operator elects to initiate drilling or reentry operations on an oil and gas lease. The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Conection Clearance Officer (WO-630), 1849 C Street, N.W., Mail Stop 401 LS, Washington, D.C. 20240.

Additional Operator Remarks

Location of Well

1. SHL: LOT O / 230 FSL / 1840 FEL / TWSP: 23S / RANGE: 26E / SECTION: 5 / LAT: 32.3269649 / LONG: -104.313014 (TVD: 0 feet, MD: 0 feet)

PPP: LOT P / 330 FSL / 400 FEL / TWSP: 23S / RANGE: 26E / SECTION: 5 / LAT: 32.3272418 / LONG: -104.3083413 (TVD: 9523 feet, MD: 10413 feet)

BHL: LOT A / 330 FNL / 400 FEL / TWSP: 22S / RANGE: 26E / SECTION: 32 / LAT: 32.355163 / LONG: -104.3080161 (TVD: 9455 feet, MD: 20086 feet)

BLM Point of Contact

Name: Priscilla Perez

Title: Legal Instruments Examiner

Phone: 5752345934 Email: pperez@blm.gov

(Form 3160-3, page 3)

Approval Date: 12/21/2018

Review and Appeal Rights

A person contesting a decision shall request a State Director review. This request must be filed within 20 working days of receipt of the Notice with the appropriate State Director (see 43 CFR 3165.3). The State Director review decision may be appealed to the Interior Board of Land Appeals, 801 North Quincy Street, Suite 300, Arlington, VA 22203 (see 43 CFR 3165.4). Contact the above listed Bureau of Land Management office for further information.

(Form 3160-3, page 4)

Approval Date: 12/21/2018

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

OPERATOR'S NAME: | Chisholm Energy Operating, LLC

LEASE NO.: | NMNM-097120

WELL NAME & NO.: | Bodacious 5-32 Fed Com WCA 6H

SURFACE HOLE FOOTAGE: | 0230' FSL & 1840' FEL

BOTTOM HOLE FOOTAGE | 0330' FNL & 0400' FEL Sec. 32, T. 22 S., R 26 E.

LOCATION: | Section 05, T. 23 S., R 26 E., NMPM

COUNTY: | County, New Mexico

Communitization Agreement

The operator will submit a Communitization Agreement to the Carlsbad Field Office, 620 E Greene St. Carlsbad, New Mexico 88220, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.

- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

A. DRILLING OPERATIONS REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

□ Eddy County

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- 1. Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.
- 2. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval. If the drilling rig is removed without approval an Incident of Non-Compliance will be written and will be a "Major" violation.
- 3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works is located, this does not include the dog house or stairway area.
- 4. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

B. CASING

Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.

Centralizers required on surface casing per Onshore Order 2.III.B.1.f.

Wait on cement (WOC) for Water Basin:

After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1)

cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements.

Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

Medium Cave/Karst

Possible water flows in the Salado and Castile.

Possible lost circulation in the Salado, Castile, and Delaware.

Abnormal pressure may be encountered in the 3rd Bone Spring and all subsequent formations.

- 1. The 13-3/8 inch surface casing shall be set at approximately 420 feet (a minimum of 25 feet into the Rustler Anhydrite and above the salt) and cemented to the surface. If salt is encountered, set casing at least 25 feet above the salt.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
 - b. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Formation below the 13-3/8" shoe to be tested according to Onshore Order 2.III.B.1.i. Test to be done as a mud equivalency test using the mud weight

necessary for the pore pressure of the formation below the shoe and the mud weight for the bottom of the hole. Report results to BLM office. 2. The minimum required fill of cement behind the 9-5/8 inch intermediate casing is: Operator has proposed DV tool at depth of 1500', but will adjust cement proportionately if moved. DV tool shall be set a minimum of 50' below previous shoe and a minimum of 200' above current shoe. Operator shall submit sundry if DV tool depth cannot be set in this range. If an ECP is used, it is to be set a minimum of 50' below the shoe to provide cement across the shoe. If it cannot be set below the shoe, a CBL shall be run to verify cement coverage. a. First stage to DV tool:____ Cement to circulate. If cement does not circulate, contact the appropriate BLM office before proceeding with second stage cement job. Operator should have plans as to how they will achieve circulation on the next stage. Excess calculates to negative 38% - Additional cement may be required. b. Second stage above DV tool: Cement to surface. If cement does not circulate, contact the appropriate BLM office. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst.

If cement does not circulate to surface on the intermediate casing, the cement on the production casing must come to surface.

Formation below the 9-5/8" shoe to be tested according to Onshore Order 2.III.B.1.i. Test to be done as a mud equivalency test using the mud weight necessary for the pore pressure of the formation below the shoe (not the mud weight required to prevent dissolving the salt formation) and the mud weight for the bottom of the hole. Report results to BLM office.

Centralizers required on horizontal leg, must be type for horizontal service and a minimum of one every other joint.

3.	The minimum required fill of cement behind the 5-1/2 inch production casing is:
	☐ Cement should tie-back at least 200 feet into previous casing string. Operator
	shall provide method of verification.

4. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

C. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API 53.
- 2. Variance approved to use flex line from BOP to choke manifold. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor. If the BLM inspector questions the straightness of the hose, a BLM engineer will be contacted and will review in the field or via picture supplied by inspector to determine if changes are required (operator shall expect delays if this occurs).
- 3. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.

Page 5 of 7

- d. Operator shall perform the intermediate casing integrity test to 70% of the casing burst. This will test the multi-bowl seals.
- e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.

5M system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.

- 4. The appropriate BLM office shall be notified a minimum of hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - a. The tests shall be done by an independent service company utilizing a test plug **not** a **cup** or **J-packer**.
 - b. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
 - c. The results of the test shall be reported to the appropriate BLM office.
 - d. All tests are required to be recorded on a calibrated test chart. A copy of the

BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.

- e. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- f. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the **Wolfcamp** formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

D. **DRILLING MUD**

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the **Wolfcamp** formation, and shall be used until production casing is run and cemented.

E. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

F. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

JAM 121318

PECOS DISTRICT SURFACE USE CONDITIONS OF APPROVAL

OPERATOR'S NAME: | CHISHOLM ENERGY OPERATING

LEASE NO.: NMNM97120

WELL NAME & NO.: | 6H- BODACIOUS 5-32 FED COM WCB

SURFACE HOLE FOOTAGE: 230'/S & 1840'/E BOTTOM HOLE FOOTAGE 330'/N & 400'/E

LOCATION: Section. 5.,T23S.,R.26E., NMP COUNTY: EDDY County, New Mexico

TABLE OF CONTENTS

Standard Conditions of Approval (COA) apply to this APD. If any deviations to these standards exist or special COAs are required, the section with the deviation or requirement will be checked below.

General ProvisionsPermit ExpirationArchaeology, Paleontology, and Historical SitesNoxious WeedsSpecial Requirements
Cave/Karst
Watershed
☐ Construction
 Notification
Topsoil
Closed Loop System
Federal Mineral Material Pits
Well Pads
Roads
□ Road Section Diagram
☐ Production (Post Drilling)
Well Structures & Facilities
Interim Reclamation
☐ Final Abandonment & Reclamation

Page 1 of 14

GENERAL PROVISIONS

The approval of the Application For Permit To Drill (APD) is in compliance with all applicable laws and regulations: 43 Code of Federal Regulations 3160, the lease terms, Onshore Oil and Gas Orders, Notices To Lessees, New Mexico Oil Conservation Division (NMOCD) Rules, National Historical Preservation Act As Amended, and instructions and orders of the Authorized Officer. Any request for a variance shall be submitted to the Authorized Officer on Form 3160-5, Sundry Notices and Report on Wells.

II. PERMIT EXPIRATION

If the permit terminates prior to drilling and drilling cannot be commenced within 60 days after expiration, an operator is required to submit Form 3160-5, Sundry Notices and Reports on Wells, requesting surface reclamation requirements for any surface disturbance. However, if the operator will be able to initiate drilling within 60 days after the expiration of the permit, the operator must have set the conductor pipe in order to allow for an extension of 60 days beyond the expiration date of the APD. (Filing of a Sundry Notice is required for this 60 day extension.)

III. ARCHAEOLOGICAL, PALEONTOLOGY & HISTORICAL SITES

Any cultural and/or paleontological resource discovered by the operator or by any person working on the operator's behalf shall immediately report such findings to the Authorized Officer. The operator is fully accountable for the actions of their contractors and subcontractors. The operator shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery shall be made by the Authorized Officer to determine the appropriate actions that shall be required to prevent the loss of significant cultural or scientific values of the discovery. The operator shall be held responsible for the cost of the proper mitigation measures that the Authorized Officer assesses after consultation with the operator on the evaluation and decisions of the discovery. Any unauthorized collection or disturbance of cultural or paleontological resources may result in a shutdown order by the Authorized Officer.

IV. NOXIOUS WEEDS

The operator shall be held responsible if noxious weeds become established within the areas of operations. Weed control shall be required on the disturbed land where noxious weeds exist, which includes the roads, pads, associated pipeline corridor, and adjacent land affected by the establishment of weeds due to this action. The operator shall consult with the Authorized Officer for

Page 2 of 14

acceptable weed control methods, which include following EPA and BLM requirements and policies.

V. SPECIAL REQUIREMENT(S)

Karst

Cave/Karst Surface Mitigation

The following stipulations will be applied to minimize impacts during construction, drilling and production:

Construction:

In the advent that any underground voids are opened up during construction activities, construction activities will be halted and the BLM will be notified immediately.

No Blasting:

No blasting will be utilized for pad construction. The pad will be constructed and leveled by adding the necessary fill and caliche.

Pad Berming:

- The entire perimeter of the well pad will be bermed to prevent oil, salt, and other chemical contaminants from leaving the well pad.
- The compacted berm shall be constructed at a minimum of 12 inches high with impermeable mineral material (e.g., caliche).
- No water flow from the uphill side(s) of the pad shall be allowed to enter the well pad.
- The topsoil stockpile shall be located outside the bermed well pad.
- Topsoil, either from the well pad or surrounding area, shall not be used to construct the berm.
- No storm drains, tubing or openings shall be placed in the berm.
- If fluid collects within the bermed area, the fluid must be vacuumed into a safe container and disposed of properly at a state approved facility.
- The integrity of the berm shall be maintained around the surfaced pad throughout the life of the well and around the downsized pad after interim reclamation has been completed.
- Any access road entering the well pad shall be constructed so that the integrity of the berm height surrounding the well pad is not compromised. (Any access road crossing the berm cannot be lower than the berm height.)
- Following a rain event, all fluids will vacuumed off of the pad and hauled offsite and disposed at a proper disposal facility.

Tank Battery Liners and Berms:

Tank battery locations and all facilities will be lined and bermed. A 20 mil permanent liner will be installed with a 4 oz. felt backing, or equivalent, to prevent tears or punctures. Tank battery berms must be large enough to contain $1\frac{1}{2}$ times the content of the largest tank.

Leak Detection System:

A method of detecting leaks is required. The method could incorporate gauges to measure loss, situating values and lines so they can be visually inspected, or installing electronic sensors to alarm when a leak is present. Leak detection plan will be submitted to BLM for approval.

Automatic Shut-off Systems:

Automatic shut off, check values, or similar systems will be installed for pipelines and tanks to minimize the effects of catastrophic line failures used in production or drilling.

Cave/Karst Subsurface Mitigation

The following stipulations will be applied to protect cave/karst and ground water concerns:

Rotary Drilling with Fresh Water:

Fresh water will be used as a circulating medium in zones where caves or karst features are expected. SEE ALSO: Drilling COAs for this well.

Directional Drilling:

Kick off for directional drilling will occur at least 100 feet below the bottom of the cave occurrence zone. SEE ALSO: Drilling COAs for this well.

Lost Circulation:

ALL lost circulation zones from the surface to the base of the cave occurrence zone will be logged and reported in the drilling report.

Regardless of the type of drilling machinery used, if a void of four feet or more and circulation losses greater than 70 percent occur simultaneously while drilling in any cave-bearing zone, the BLM will be notified immediately by the operator. The BLM will assess the situation and work with the operator on corrective actions to resolve the problem.

Page 4 of 14

Approval Date: 12/21/2018

Abandonment Cementing:

Upon well abandonment in cave karst areas additional plugging conditions of approval may be required. The BLM will assess the situation and work with the operator to ensure proper plugging of the wellbore.

Pressure Testing:

The operator will perform annual pressure monitoring on all casing annuli and reported in a sundry notice. If the test results indicated a casing failure has occurred, remedial action will be undertaken to correct the problem to the BLM's approval.

Watershed

- 1. Containment berms will be constructed around both tank battery production facilities designed to hold fluids. The containment berms will be constructed with compacted material capable of holding 1½ time the capacity of the largest tank.
- 2. Topsoil will be stockpiled on the pads to enhance future reclamation.
- 3. The entire well pad will be bermed to prevent oil, salt, and other chemical contaminants from leaving the well pad. A water diversion ditch will placed along the south, west and northwest sides of the pad. Topsoil shall not be used to construct the berm. No water flow from the uphill side(s) of the pad shall be allowed to enter the well pad. The berm shall be maintained through the life of the well and after interim reclamation has been completed. Any water erosion that may occur due to the construction of the well pad during the life of the well will be quickly corrected and proper measures will be taken to prevent future erosion.
- A closed loop drilling system will be used.
- 5. The entire well pad will be bermed to prevent oil, salt, and other chemical contaminants from leaving the well pad. A water diversion ditch will placed along the south, west and northwest sides of the pad. Topsoil shall not be used to construct the berm. No water flow from the uphill side(s) of the pad shall be allowed to enter the well pad. The berm shall be maintained through the life of the well and after interim reclamation has been completed.
- 6. Any water erosion that may occur due to the construction of the well pad during the life of the well will be quickly corrected and proper measures will be taken to prevent future erosion
- 7. Drainage turnouts shall have straw wattles installed.
- 8. <u>Surface Pipeline</u>: A leak detection plan will be submitted to the BLM Carlsbad Field Office for approval prior to pipeline installation. The method could incorporate gauges to detect pressure drops, situating values and lines so they can be visually inspected periodically or installing electronic sensors to alarm when a leak is present. The leak detection plan will incorporate an automatic

Page 5 of 14

shut off system that will be installed for proposed pipelines to minimize the effects of an undesirable event.

VI. CONSTRUCTION

A. NOTIFICATION

The BLM shall administer compliance and monitor construction of the access road and well pad. Notify the Carlsbad Field Office at (575) 234-5909 at least 3 working days prior to commencing construction of the access road and/or well pad.

When construction operations are being conducted on this well, the operator shall have the approved APD and Conditions of Approval (COA) on the well site and they shall be made available upon request by the Authorized Officer.

B. TOPSOIL

The operator shall strip the top portion of the soil (root zone) from the entire well pad area and stockpile the topsoil along the edge of the well pad as depicted in the APD. The root zone is typically six (6) inches in depth. All the stockpiled topsoil will be redistributed over the interim reclamation areas. Topsoil shall not be used for berming the pad or facilities. For final reclamation, the topsoil shall be spread over the entire pad area for seeding preparation.

Other subsoil (below six inches) stockpiles must be completely segregated from the topsoil stockpile. Large rocks or subsoil clods (not evident in the surrounding terrain) must be buried within the approved area for interim and final reclamation.

C. CLOSED LOOP SYSTEM

Tanks are required for drilling operations: No Pits.

The operator shall properly dispose of drilling contents at an authorized disposal site.

D. FEDERAL MINERAL MATERIALS PIT

Payment shall be made to the BLM prior to removal of any federal mineral materials. Call the Carlsbad Field Office at (575) 234-5972.

E. WELL PAD SURFACING

Surfacing of the well pad is not required.

Page 6 of 14

If the operator elects to surface the well pad, the surfacing material may be required to be removed at the time of reclamation. The well pad shall be constructed in a manner which creates the smallest possible surface disturbance, consistent with safety and operational needs.

F. EXCLOSURE FENCING (CELLARS & PITS)

Exclosure Fencing

The operator will install and maintain exclosure fencing for all open well cellars to prevent access to public, livestock, and large forms of wildlife before and after drilling operations until the pit is free of fluids and the operator initiates backfilling. (For examples of exclosure fencing design, refer to BLM's Oil and Gas Gold Book, Exclosure Fence Illustrations, Figure 1, Page 18.)

G. ON LEASE ACCESS ROADS

Road Width

The access road shall have a driving surface that creates the smallest possible surface disturbance and does not exceed fourteen (14) feet in width. The maximum width of surface disturbance, when constructing the access road, shall not exceed twenty-five (25) feet.

Surfacing

Surfacing material is not required on the new access road driving surface. If the operator elects to surface the new access road or pad, the surfacing material may be required to be removed at the time of reclamation.

Where possible, no improvements should be made on the unsurfaced access road other than to remove vegetation as necessary, road irregularities, safety issues, or to fill low areas that may sustain standing water.

The Authorized Officer reserves the right to require surfacing of any portion of the access road at any time deemed necessary. Surfacing may be required in the event the road deteriorates, erodes, road traffic increases, or it is determined to be beneficial for future field development. The surfacing depth and type of material will be determined at the time of notification.

Crowning

Crowning shall be done on the access road driving surface. The road crown shall have a grade of approximately 2% (i.e., a 1" crown on a 14' wide road). The road shall conform to Figure 1; cross section and plans for typical road construction.

Ditchina

Ditching shall be required on both sides of the road.

Turnouts

Page 7 of 14


Vehicle turnouts shall be constructed on the road. Turnouts shall be intervisible with interval spacing distance less than 1000 feet. Turnouts shall conform to Figure 1; cross section and plans for typical road construction.

Drainage

Drainage control systems shall be constructed on the entire length of road (e.g. ditches, sidehill outsloping and insloping, lead-off ditches, culvert installation, and low water crossings).

A typical lead-off ditch has a minimum depth of 1 foot below and a berm of 6 inches above natural ground level. The berm shall be on the down-slope side of the lead-off ditch.

Cross Section of a Typical Lead-off Ditch

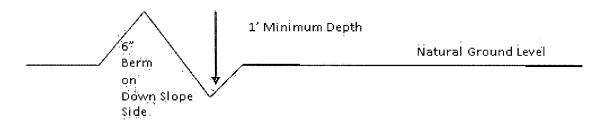

All lead-off ditches shall be graded to drain water with a 1 percent minimum to 3 percent maximum ditch slope. The spacing interval are variable for lead-off ditches and shall be determined according to the formula for spacing intervals of lead-off ditches, but may be amended depending upon existing soil types and centerline road slope (in %);

Formula for Spacing Interval of Lead-off Ditches

Example - On a 4% road slope that is 400 feet long, the water flow shall drain water into a lead-off ditch. Spacing interval shall be determined by the following formula:

400 foot road with 4% road slope:
$$\frac{400'}{4\%} + 100' = 200'$$
 lead-off ditch interval

Cattle guards

An appropriately sized cattle guard sufficient to carry out the project shall be installed and maintained at fence/road crossings. Any existing cattle guards on the access road route shall be repaired or replaced if they are damaged or have deteriorated beyond practical use. The operator shall be responsible for the condition of the existing cattle guards that are in place and are utilized during lease operations.

Fence Requirement

Page 8 of 14

Where entry is granted across a fence line, the fence shall be braced and tied off on both sides of the passageway prior to cutting. The operator shall notify the private surface landowner or the grazing allotment holder prior to crossing any fences.

Public Access

Public access on this road shall not be restricted by the operator without specific written approval granted by the Authorized Officer.

Page 9 of 14

Approval Date: 12/21/2018

Construction Steps

- 1. Salvage topsoil
- 3. Redistribute topsoil
- 2. Construct road
- 4. Revegetate slopes

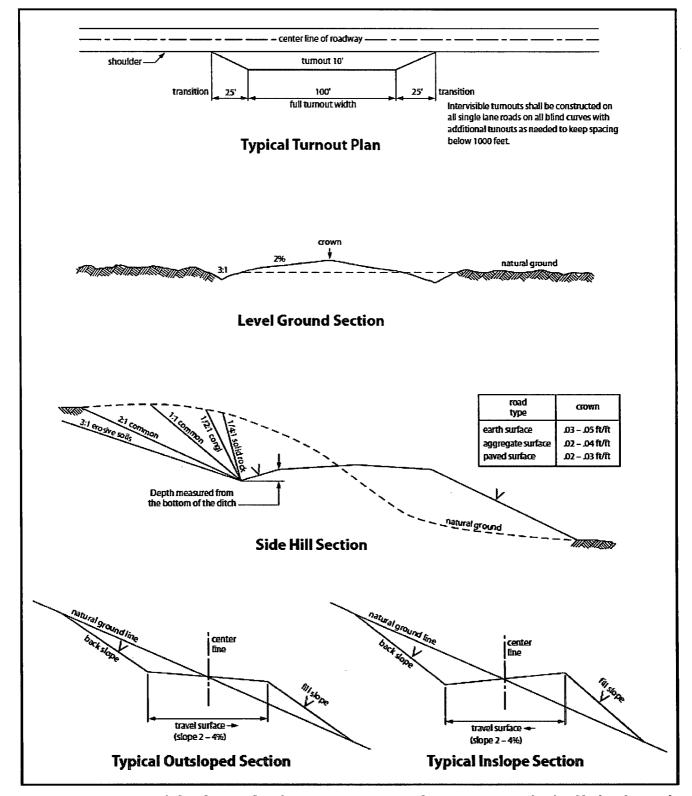


Figure 1. Cross-sections and plans for typical road sections representative of BLM resource or FS local and higher-class roads.

VII. PRODUCTION (POST DRILLING)

A. WELL STRUCTURES & FACILITIES

Placement of Production Facilities

Production facilities should be placed on the well pad to allow for maximum interim recontouring and revegetation of the well location.

Exclosure Netting (Open-top Tanks)

Immediately following active drilling or completion operations, the operator will take actions necessary to prevent wildlife and livestock access, including avian wildlife, to all open-topped tanks that contain or have the potential to contain salinity sufficient to cause harm to wildlife or livestock, hydrocarbons, or Resource Conservation and Recovery Act of 1976-exempt hazardous substances. At a minimum, the operator will net, screen, or cover open-topped tanks to exclude wildlife and livestock and prevent mortality. If the operator uses netting, the operator will cover and secure the open portion of the tank to prevent wildlife entry. The operator will net, screen, or cover the tanks until the operator removes the tanks from the location or the tanks no longer contain substances that could be harmful to wildlife or livestock. Use a maximum netting mesh size of 1 ½ inches. The netting must not be in contact with fluids and must not have holes or gaps.

Chemical and Fuel Secondary Containment and Exclosure Screening

The operator will prevent all hazardous, poisonous, flammable, and toxic substances from coming into contact with soil and water. At a minimum, the operator will install and maintain an impervious secondary containment system for any tank or barrel containing hazardous, poisonous, flammable, or toxic substances sufficient to contain the contents of the tank or barrel and any drips, leaks, and anticipated precipitation. The operator will dispose of fluids within the containment system that do not meet applicable state or U. S. Environmental Protection Agency livestock water standards in accordance with state law; the operator must not drain the fluids to the soil or ground. The operator will design, construct, and maintain all secondary containment systems to prevent wildlife and livestock exposure to harmful substances. At a minimum, the operator will install effective wildlife and livestock exclosure systems such as fencing, netting, expanded metal mesh, lids, and grate covers. Use a maximum netting mesh size of 1 ½ inches.

Open-Vent Exhaust Stack Exclosures

The operator will construct, modify, equip, and maintain all open-vent exhaust stacks on production equipment to prevent birds and bats from entering, and to discourage perching, roosting, and nesting. (*Recommended exclosure structures on open-vent exhaust stacks are in the shape of a cone.*) Production

Page 11 of 14

equipment includes, but may not be limited to, tanks, heater-treaters, separators, dehydrators, flare stacks, in-line units, and compressor mufflers.

Containment Structures

Proposed production facilities such as storage tanks and other vessels will have a secondary containment structure that is constructed to hold the capacity of 1.5 times the largest tank, plus freeboard to account for precipitation, unless more stringent protective requirements are deemed necessary.

Painting Requirement

All above-ground structures including meter housing that are not subject to safety requirements shall be painted a flat non-reflective paint color, **Shale Green** from the BLM Standard Environmental Color Chart (CC-001: June 2008).

VIII. INTERIM RECLAMATION

During the life of the development, all disturbed areas not needed for active support of production operations should undergo interim reclamation in order to minimize the environmental impacts of development on other resources and uses.

Within six (6) months of well completion, operators should work with BLM surface management specialists (Jim Amos: 575-234-5909) to devise the best strategies to reduce the size of the location. Interim reclamation should allow for remedial well operations, as well as safe and efficient removal of oil and gas.

During reclamation, the removal of caliche is important to increasing the success of revegetating the site. Removed caliche that is free of contaminants may be used for road repairs, fire walls or for building other roads and locations. In order to operate the well or complete workover operations, it may be necessary to drive, park and operate on restored interim vegetation within the previously disturbed area. Disturbing revegetated areas for production or workover operations will be allowed. If there is significant disturbance and loss of vegetation, the area will need to be revegetated. Communicate with the appropriate BLM office for any exceptions/exemptions if needed.

All disturbed areas after they have been satisfactorily prepared need to be reseeded with the seed mixture provided below.

Upon completion of interim reclamation, the operator shall submit a Sundry Notices and Reports on Wells, Subsequent Report of Reclamation (Form 3160-5).

IX. FINAL ABANDONMENT & RECLAMATION

Page 12 of 14

At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land are restored.

Earthwork for final reclamation must be completed within six (6) months of well plugging. All pads, pits, facility locations and roads must be reclaimed to a satisfactory revegetated, safe, and stable condition, unless an agreement is made with the landowner or BLM to keep the road and/or pad intact.

After all disturbed areas have been satisfactorily prepared, these areas need to be revegetated with the seed mixture provided below. Seeding should be accomplished by drilling on the contour whenever practical or by other approved methods. Seeding may need to be repeated until revegetation is successful, as determined by the BLM.

Operators shall contact a BLM surface protection specialist prior to surface abandonment operations for site specific objectives (Jim Amos: 575-234-5909).

Page 13 of 14

Seed Mixture 1 for Loamy Sites

Holder shall seed all disturbed areas with the seed mixture listed below. The seed mixture shall be planted in the amounts specified in pounds of pure live seed (PLS)* per acre. There shall be no primary or secondary noxious weeds in the seed mixture. Seed shall be tested and the viability testing of seed will be done in accordance with State law(s) and within nine (9) months prior to purchase. Commercial seed shall be either certified or registered seed. The seed container shall be tagged in accordance with State law(s) and available for inspection by the Authorized Officer.

Seed shall be planted using a drill equipped with a depth regulator to ensure proper depth regulator to ensure proper depth of planting where drilling is possible. The seed mixture shall be evenly and uniformly planted over the disturbed area (small/heavier seeds have a tendency to drop the bottom of the drill and are planted first). Holder shall take appropriate measures to ensure this does not occur. Where drilling is not possible, seed shall be broadcast and the area shall be raked or chained to cover the seed. When broadcasting the seed, the pounds per acre shall be doubled. The seeding shall be repeated until a satisfactory stand is established as determined by the Authorized Officer. Evaluation of growth may not be made before completion of at least one full growing season after seeding.

Species to be planted in pounds of pure live seed* per acre:

<u>Species</u>

	<u>lb/acre</u>
Plains lovegrass (Eragrostis intermedia)	0.5
Sand dropseed (Sporobolus cryptandrus)	1.0
Sideoats grama (Bouteloua curtipendula)	5.0
Plains bristlegrass (Setaria macrostachya)	2.0

^{*}Pounds of pure live seed:

Pounds of seed x percent purity x percent germination = pounds pure live seed



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

©perator Certification Data Report 03/21/2019

Operator Certification

I hereby certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions which currently exist; that I have full knowledge of state and Federal laws applicable to this operation; that the statements made in this APD package are, to the best of my knowledge, true and correct; and that the work associated with the operations proposed herein will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of false statements.

NAME: Jennifer Elrod Signed on: 07/25/2018

Title: Senior Regulatory Technician

Street Address: 801 CHERRY STREET, SUITE 1200-UNIT 20

City: Fort Worth State: TX Zip: 76102

Phone: (817)953-3728

Email address:

Email address: jelrod@chisholmenergy.com

Field Representative

Representative Name:		
Street Address:		
City:	State:	Zip:
Phone:		



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Application Data Report

03/21/2019

APD ID: 10400032174

Submission Date: 07/25/2018

Highlighted data reflects the most

Operator Name: CHISHOLM ENERGY OPERATING LLC

Well Number: 6H

recent changes **Show Final Text**

Well Name: BODACIOUS 5-32 FED COM WCB

Well Type: CONVENTIONAL GAS WELL

Well Work Type: Drill

Section 1 - General

APD ID:

10400032174

Tie to previous NOS? 10400030145

Submission Date: 07/25/2018

BLM Office: CARLSBAD

User: Jennifer Elrod

Title: Senior Regulatory Technician

Federal/Indian APD: FED

Is the first lease penetrated for production Federal or Indian? FED

Lease number: NMNM097120

Lease Acres: 642.36

Surface access agreement in place?

Allotted?

Reservation:

Agreement in place? NO

Federal or Indian agreement:

Agreement number:

Agreement name:

Keep application confidential? NO

Permitting Agent? NO

APD Operator: CHISHOLM ENERGY OPERATING LLC

Operator letter of designation:

Operator Info

Operator Organization Name: CHISHOLM ENERGY OPERATING LLC

Operator Address: 801 Cherry St., Suite 1200 Unit 20

Operator PO Box:

Zip: 76102

Operator City: Fort Worth

State: TX

Operator Phone: (817)469-1104

Operator Internet Address:

Section 2 - Well Information

Well in Master Development Plan? NO

Mater Development Plan name:

Well in Master SUPO? NEW

Master SUPO name: Bodacious

Well in Master Drilling Plan? NEW

Master Drilling Plan name: BODACIOUS WC

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Well API Number:

Field/Pool or Exploratory? Field and Pool

Field Name: PURPLE SAGE

Pool Name: WOLFCAMP

Is the proposed well in an area containing other mineral resources? USEABLE WATER

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Describe other minerals:

Is the proposed well in a Helium production area? N Use Existing Well Pad? YES

New surface disturbance? Y

Type of Well Pad: MULTIPLE WELL

Multiple Well Pad Name:

Number: 4H,5H,6H

Well Class: HORIZONTAL

BODACIOUS 5-32 FED COM

Number of Legs: 1

Well Work Type: Drill

Well Type: CONVENTIONAL GAS WELL

Describe Well Type:

Well sub-Type: INFILL

Describe sub-type:

Distance to town: 6 Miles

Distance to nearest well: 30 FT

Distance to lease line: 230 FT

Reservoir well spacing assigned acres Measurement: 641.579 Acres

Well plat:

BODACIOUS_5_32_FED_COM_WCA_6H_APD_C102_07172018_20180725124927.pdf

Well work start Date: 01/01/2019

Duration: 30 DAYS

Section 3 - Well Location Table

Survey Type: RECTANGULAR

Describe Survey Type:

Datum: NAD83

Vertical Datum: NAVD88

Survey number: 6285

	NS-Foot	NS Indicator	EW-Foot	EW Indicator	Twsp	Range	Section	Aliquot/Lot/Tract	Latitude	Longitude	County	State	Meridian	Lease Type	Lease Number	Elevation	MD	TVD
SHL	230	FSL	184	FEL	23S	26E	5	Lot	32.32696	-	EDD		NEW	F	NMNM	336	0	0
Leg			0					0	49	104.3130	Υ	l	MEXI		097120	4		
#1										14		СО	CO					
KOP	230	FSL	184	FEL	23S	26E	5	Lot	32.32696	-	EDD	NEW	NEW	F	NMNM	-	835	832
Leg			0					0	49	104.3130	Υ	MEXI			097120		0	7
#1		i e								14		СО	СО			3		
PPP	330	FSL	400	FEL	23S	26E	5	Lot	32.32724	-	EDD	NEW	NEW	F	NMNM	-	104	952
Leg								Р	18	104.3083	Υ		MEXI		097120	615	13	3
#1										413		CO	СО			9		

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

	NS-Foot	NS Indicator	EW-Foot	EW Indicator	Twsp	Range	Section	Aliquot/Lot/Tract	Latitude	Longitude	County	State	Meridian	Lease Type	Lease Number	Elevation	MD	TVD
EXIT Leg #1	330	FNL	400	FEL	228	26E	32	Lot A	32.35516 3.	- 104.3080 161	EDD Y	NEW MEXI CO	NEW MEXI CO	S	STATE	- 609 1	200 86	945 5
BHL Leg #1	330	FNL	400	FEL	228	26E	32	Lot A	32.35516 3	- 104.3080 161	EDD Y	NEW MEXI CO	—	S	STATE	- 609 1	200 86	945 5



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Drilling Plan Data Report

03/21/2019

APD ID: 10400032174

Submission Date: 07/25/2018

Highlighted data reflects the most

Operator Name: CHISHOLM ENERGY OPERATING LLC

recent changes

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Show Final Text

Well Type: CONVENTIONAL GAS WELL

Well Work Type: Drill

Section 1 - Geologic Formations

Formation		i.	True Vertical	Measured	·		Producing
ID	Formation Name	Elevation	Depth	Depth	Lithologies	Mineral Resources	Formation
1	DELAWARE	3364	1814	1814	SHALE,SANDSTONE,SI LTSTONE	NONE	No
2	BONE SPRING	-1582	4946	4946	LIMESTONE,SHALE	NATURAL GAS,OIL	No
3	BONE SPRING 1ST	-2542	5906	5906	SHALE,SANDSTONE,SI LTSTONE	NATURAL GAS,OIL	No
4	BONE SPRING 2ND	-2976	6340	6340	SHALE,SANDSTONE,SI LTSTONE	NATURAL GAS,OIL	No
5	BONE SPRING 3RD	-4775	8139	8139	SHALE,SANDSTONE,SI LTSTONE	NATURAL GAS,OIL	No
6	WOLFCAMP	-5166	8530	8530	LIMESTONE,SHALE,SIL TSTONE	NATURAL GAS,OIL	No
7	WOLFCAMP	-5278	8642	8642	LIMESTONE, SHALE, SIL TSTONE	NATURAL GAS,OIL	No
8	WOLFCAMP	-5571	8935	8935	LIMESTONE	NATURAL GAS,OIL	No
9	WOLFCAMP	-5910	9274	9274	LIMESTONE,SHALE,SIL TSTONE	NATURAL GAS,OIL	Yes

Section 2 - Blowout Prevention

Pressure Rating (PSI): 5M

Rating Depth: 12500

Equipment: Rotating head, Mud Gas Separator, Flare Line, Remote Kill Line

Requesting Variance? YES

Variance request: WE PROPOSE UTILIZING A CACTUS SPEED HEAD MULTI-BOWL WELLHEAD FOR THIS WELL. PLEASE SEE ATTACHED DIAGRAM AND PRESSURE TESTING STATEMENT. ALSO WE REQUEST TO USE A FLEX CHOKE HOSE: PLEASE SEE ATTACHMENT.

Testing Procedure: As per Onshore Order #2 BOP testing procedure -N/U the rig's BOP. Use 3rd party testers to perform the following: -Test the pipe rams, blind rams, floor valves (IBOP and/or upper Kelly valve), choke lines and manifold to 250 psi/5,000 psi with a test plug and a test pump. -Test the Hyrdil annular to 250 psi/2,500 psi with same as above.

Choke Diagram Attachment:

5M Choke Manifold Diagram 20180718085955.pdf

BOP Diagram Attachment:

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

5M_Choke_Manifold_Diagram_20180718085955.pdf

5m_BOP_Diagram_20180718090005.pdf

Section 3 - Casing

Casing ID	String Type	Hole Size	Csg Size	Condition	Standard	Tapered String	Top Set MD	Bottom Set MD	Top Set TVD	Bottom Set TVD	Top Set MSL	Bottom Set MSL	Calculated casing length MD	Grade	Weight	Joint Type	Collapse SF	Burst SF	Joint SF Type	Joint SF	Body SF Type	Body SF
1	SURFACE	17.5	13.375	NEW	API	N	0	420	0	420			420	J-55	48	STC	3.85	12.3 3	BUOY	18.4 5	BUOY	24.8
2	INTERMED IATE	12.2 5	9.625	NEW	API	N	0	7900	0	7900			7900	L-80		OTHER - BTC	1.66	1.51	BUOY	3.84	BUOY	3.34
3	PRODUCTI ON	8.75	5.5	NEW	API	N	0	20086	0	9455			20086	P- 110	20	витт	2.16	2.24	BUOY	4.11	BUOY	4.11

Casing Attachments

Casing ID: 1

String Type: SURFACE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Casing_Calculator_20180725125621.pdf

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Casing Attachments

Casing ID: 2

String Type: INTERMEDIATE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Casing_Calculator_20180725125610.pdf

Casing ID: 3

String Type: PRODUCTION

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Casing_Calculator_20180725125602.pdf

Section 4 - Cement

String Type	Lead/Tail	Stage Tool Depth	Top MD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
SURFACE	Lead		0	420	420	1.24	14.8	455	85	Class C Premium Plus	Cellophane Flakes

INTERMEDIATE	Lead	1500	0	1150	410	2.28	11.5	935	150	Plus	Sodium Metasilicate, Defoamer, KCL, Kol- Seal, Cellophane Flakes, ROF SealCheck
INTERMEDIATE	Tail		1150	1500	235	1.38	14.8	325	150	CLASS C PREMIUM PLUS	N/A

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

String Type	Lead/Tail	Stage Tool Depth	Top MD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
INTERMEDIATE	Lead	1500	1500	7600	3055	2.28	11.5	6965	150	CLASS C PREMIUM PLUS	SODIUM METASILICATE, DEFOAMER, KCL, KOL-SEAL, CELLOPHANE FLAKES, ROF SEAL CHECK
INTERMEDIATE	Tail		7600	7900	300	1.38	14.8	235	150	CLASS C PREMIUM PLUS	N/A
PRODUCTION	Lead		0	8800	975	2.28	11.5	2223	10	Liteweight	Fluid Loss, Expanding Agent, Retarder, Defoamer, Dispersant, Extender, Viscosifier
PRODUCTION	Tail		8800	2008 6	2415	1.18	14.5	2850	10	Class H Premium	Extender, Fluid Loss, Retarder, Defoamer, Dispersant

Section 5 - Circulating Medium

Mud System Type: Closed

Will an air or gas system be Used? NO

Description of the equipment for the circulating system in accordance with Onshore Order #2:

Diagram of the equipment for the circulating system in accordance with Onshore Order #2:

Describe what will be on location to control well or mitigate other conditions: Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times

Describe the mud monitoring system utilized: PVT, Pason/CanRig, Visual Monitoring

Circulating Medium Table

Top Depth	Bottom Depth	Mud Type	Min Weight (Ibs/gal)	Max Weight (lbs/gal)	Density (lbs/cu ft)	Gel Strength (lbs/100 sqft)	Hd	Viscosity (CP)	Salinity (ppm)	Filtration (cc)	Additional Characteristics
7900	2008 6	OIL-BASED MUD	10.5	12.5							

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Top Depth	Bottom Depth	Mud Type	Min Weight (lbs/gal)	Max Weight (lbs/gal)	Density (lbs/cu ft)	Gel Strength (lbs/100 sqft)	ЬН	Viscosity (CP)	Salinity (ppm)	Filtration (cc)	Additional Characteristics
0	420	WATER-BASED MUD	8.5	8.8							
420	2600	SALT SATURATED	10	10.2							
2600	7900	OTHER : Brine/Diesel Emulsion	8.9	9.3							

Section 6 - Test, Logging, Coring

List of production tests including testing procedures, equipment and safety measures:

N/A

List of open and cased hole logs run in the well:

CBL,DS,GR,MWD,MICROLO

Coring operation description for the well:

N/A

Section 7 - Pressure

Anticipated Bottom Hole Pressure: 4727

Anticipated Surface Pressure: 2631.94

Anticipated Bottom Hole Temperature(F): 160

Anticipated abnormal pressures, temperatures, or potential geologic hazards? NO

Describe:

Contingency Plans geoharzards description:

Contingency Plans geohazards attachment:

Hydrogen Sulfide drilling operations plan required? YES

Hydrogen sulfide drilling operations plan:

Eddy County H2S plan 20180718091127.pdf

Well Name: BODACIOUS 5-32 FED COM WCB Well Number: 6H

Section 8 - Other Information

Proposed horizontal/directional/multi-lateral plan submission:


Bodacious_5_32_Fed_Com_WCB_6H_Plan_1__AC_Report__20180718091223.pdf Bodacious_5_32_Fed_Com_WCB_6H_Plan_1_20180718091224.pdf


Other proposed operations facets description:

Other proposed operations facets attachment:

Other Variance attachment:

Cactus_Speed_Head_Installation_Procedure_20180718091153.pdf
Cactus_Speed_Head_Pressure_Testing_Statement_20180718091154.pdf
Cactus_Speedhead_Diagram_20180718091154.pdf
Choke_Hose_M55_1_07102017_145204_66_1225_04_14_2014__20180718091155.pdf
Choke_Hose_M55_2_07102017_145421_66_1042_05_03_2013__20180718091155.pdf

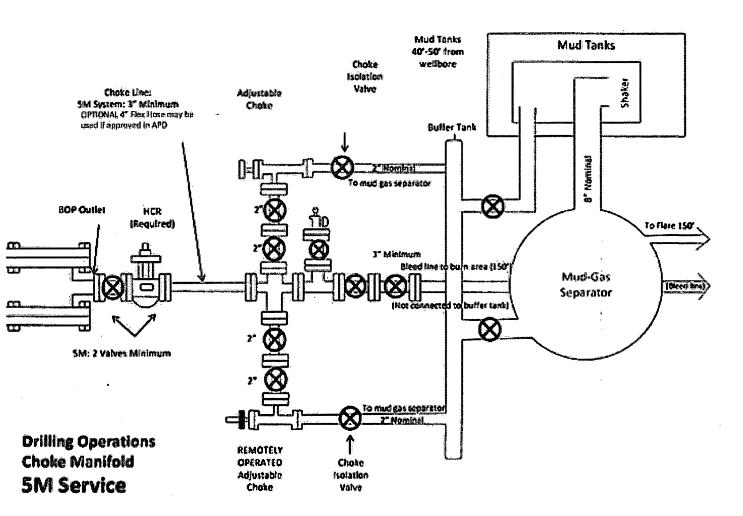

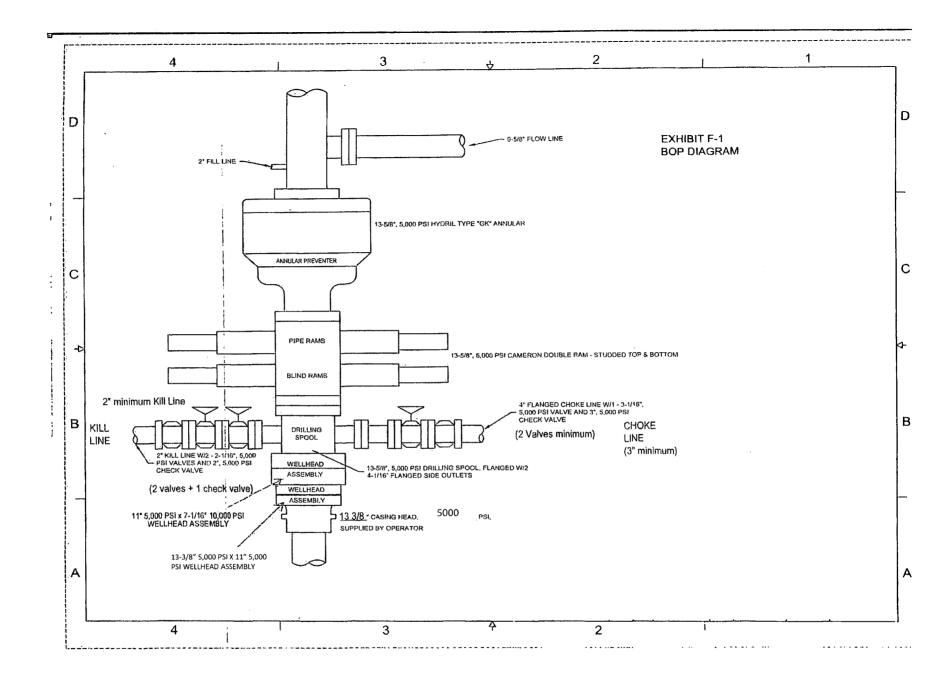

Casing Program: Bodacious 5-32 Fed Com WCB (13 3/8" x 9 5/8" x 5 1/2")

Open Hole Size (Inches)	Casing Depth; From (ft)	Casing Setting Depth (ft) MD	Casing Setting Depth (ft) TVD	Casing Size (inches)	Casing Weight (lb/ft)	Casing Grade	Thread	Condition	Anticipated Mud Weight (ppg)	Burst (psi)	Burst SF (1.125)	Collapse (psi)
Surface												
17.5"	0'	420'	420'	13 3/8"	48.0	J-55	STC	New	8.8	2370	12.33	740
Intermediate	•											
12.25"	0'	7,900'	7,900'	9 5/8"	40	HCL-80	BTC	New	9.3	5750	1.51	4230
Production	•	•										
8.75"	0'	20,086'	9,455'	5 1/2"	20	P-110	BTC	New	11.5	12640	2.24	12200

Casing Design Criteria and Casing Loading Assumptions:	
Surface	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	8.8 ppg
Collapse A 1.125 design factor with full internal evacuation and collapse force equal to a mud gradient of:	8.8 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	8.8 ppg
Intermediate	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	9.3 ppg
Collapse A 1.125 design factor with 1/3 TVD internal evacuation and collapse force equal to a mud gradient of:	9.3 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	9.3 ppg
<u>Production</u>	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	11.5 ppg
Collapse A 1.125 design factor with full internal evacuation and collapse force equal to a mud gradient of:	11.5 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	11.5 ppg

Casing Program: Bodacious 5-32 Fed Com WCB (13 3/8" x 9 5/8" x 5 1/2")

Open Hole Size (Inches)	Casing Depth; From (ft)	Casing Setting Depth (ft) MD	Casing Setting Depth (ft) TVD	Casing Size (inches)	Casing Weight (lb/ft)	Casing Grade	Thread	Condition	Anticipated Mud Weight (ppg)	Burst (psi)	Burst SF (1.125)	Collapse (psi)
Surface												
17.5"	0'	420'	420'	13 3/8"	48.0	J-55	STC	New	8.8	2370	12.33	740
Intermediate	•											
12.25"	0'	7,900'	7,900'	9 5/8"	40	HCL-80	втс	New	9.3	5750	1.51	4230
Production	1,	<u> </u>				_						
8.75"	0'	20,086'	9,455'	5 1/2"	20	P-110	BTC	New	11.5	12640	2.24	12200

Casing Design Criteria and Casing Loading Assumptions:	
<u>Surface</u>	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	8.8 ppg
Collapse A 1.125 design factor with full internal evacuation and collapse force equal to a mud gradient of:	8.8 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	8.8 ppg
Intermediate	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	9.3 ppg
Collapse A 1.125 design factor with 1/3 TVD internal evacuation and collapse force equal to a mud gradient of:	9.3 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	9.3 ppg
<u>Production</u>	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	11.5 ppg
Collapse A 1.125 design factor with full internal evacuation and collapse force equal to a mud gradient of:	11.5 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	11.5 ppg

Casing Program: Bodacious 5-32 Fed Com WCB (13 3/8" x 9 5/8" x 5 1/2")

Open Hole Size (Inches)	Casing Depth; From (ft)	Casing Setting Depth (ft) MD	Casing Setting Depth (ft) TVD	Casing Size (inches)	Casing Weight (lb/ft)	Casing Grade	Thread	Condition	Anticipated Mud Weight (ppg)	Burst (psi)	Burst SF (1.125)	Collapse (psi)
Surface												
17.5"	0'	420'	420'	13 3/8"	48.0	J-55	STC	New	8.8	2370	12.33	740
Intermediate	•				<u> </u>							
12.25"	0'	7,900'	7,900'	9 5/8"	40	HCL-80	втс	New	9.3	5750	1.51	4230
Production	•	•										
8.75"	0'	20,086'	9,455'	5 1/2"	20	P-110	BTC	New	11.5	12640	2.24	12200

Casing Design Criteria and Casing Loading Assumptions:	
<u>Surface</u>	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	8.8 ppg
Collapse A 1.125 design factor with full internal evacuation and collapse force equal to a mud gradient of:	8.8 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	8.8 ppg
<u>Intermediate</u>	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	9.3 ppg
Collapse A 1.125 design factor with 1/3 TVD internal evacuation and collapse force equal to a mud gradient of:	9.3 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	9.3 ppg
<u>Production</u>	
Tension A 1.8 design factor with effects of buoyancy with a fluid equal to a mud weight of:	11.5 ppg
Collapse A 1.125 design factor with full internal evacuation and collapse force equal to a mud gradient of:	11.5 ppg
Burst A 1.125 design factor with full external evacuation and burst force equal to a mud gradient of:	11.5 ppg

Chisholm Energy Operating, LLC

801 Cherry St., Suite 1200-Unit 20 Fort Worth, TX 76102

H2S Contingency Plan Eddy County, NM

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crew should then block entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are NO homes or buildings in or near the ROE.

Assumed 100 ppm ROE = 3000' 100 ppm H2S concentration shall trigger activation of this plan

Emergency Procedures

In the event of a release of gas containing H2S, the first responder(s) must:

- « Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- « Evacuate any public places encompassed by the 100 ppm ROE.
- « Be equipped with H2S monitors and air packs in order to control the release.
- « Use the "buddy system" to ensure no injuries occur during the response.
- « Take precautions to avoid personal injury during this operation.
- « Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- « Have received training

in the: Detection of

H2S, and

Measures for protection against the gas,

Equipment used for protection and emergency response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (S02). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally, the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas.

Characteristics of <u>H2S</u> and SO,

Common	Chemical	Specific	Threshold	Hazardous	Lethal
Name	Formula	Gravity	Limit	Limit	Concentration
Hydrogen Sulfide	H2S	1.189 Air=1	10 ppm	100 ppm/hr	600 ppm

Sulfur Dioxide	SO2	2.21 Air=1	2 ppm	N/A	1000 ppm
----------------	-----	------------	-------	-----	----------

Contacting Authorities

Chisholm Energy Operating personnel must liaise with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available including directions to sit e. The following call list of essential and potential responders has been prepared for use during a release. Chisholm Energy Operating, LLC response must be in coordination with the State of New Mexico's "Hazardous Materials Emergency Response Plan" (HMERP).

Hydrogen Sulfide Drilling Operations Plan

- 1 <u>All Company and Contract personnel admitted on location must be trained</u> by a qualified H2S safety instructor to the following:
 - A. Characteristics of H2S
 - B. Physical effects and hazards
 - C. Principal and operation of H2S detectors, warning system and briefing areas.
 - D. Evacuation procedure, routes and first aid.
 - E. Proper use of safety equipment & life support systems
 - F. Essential personnel meeting Medical Evaluation criteria will receive additional training on the proper use of 30-minute pressure demand air packs.

2 H2S Detection and Alarm Systems:

- A. H2S sensors/detectors to be located on the drilling rig floor, in the base of the sub structure/cellar area, on the mud pits in the shale shaker area. Additional H2S detectors may play placed as deemed necessary.
- B. An audio alarm system will be installed on the derrick floor and in the top doghouse.

3 Windsock and/or wind streamers:

- A. Windsock at mudpit area should be high enough to be visible.
- B. Windsock on the rig floor and/ or top doghouse should be high enough to be visible.

4 Condition Flags and Signs

- A. Warning sign on access road to location.
- B. Flags to be displayed on sign at entrance to location. Green flag

indicates normal safe condition. Yellow flag indicates potential pressure and danger. Red flag indicates danger (H2S present in dangerous concentration). Only H2S trained and certified personnel admitted to location.

5 Well control equipment:

A. See exhibit BOP and Choke Diagrams

6 Communication:

- A. While working under masks chalkboards will be used for communication.
- B. Hand signals will be used where chalk board is inappropriate.
- C. Two-way radio will be used to communicate off location in case of emergency help is required. In most cases, cellular telephones will be available at most drilling foreman's trailer or living quarters.

7 Drill stem Testing:

No DSTs are planned at this time.

- 8 Drilling contractor supervisor will be required to be familiar with the effects H2S has on tubular goods and other mechanical equipment.
- 9 If H25 is encountered, mud system will be altered if necessary to maintain control of formation. A mud gas separator will be brought into service along with H2S scavengers if necessary.

Emergency Assistance Telephone List

Chisholm Energy Holdings, LLC

Chisholm Energy Operating, LLC	Office:	(817)953-6063
Vice President of Operations-Brad Grandstaff	Office:	(817)953-3150
	Cell:	(972)977-9221
Drilling Superintendent-Russell Simons	Cell:	(830)285-7501
Production Superintendent-Paul Martinez	Cell:	(325)206-1722

Eddy County Sheriff's Department Eddy County Emergency Management Lea County Fire Service Fire Department Artesia Fire Department Sun Country Volunteer Fire Department Number: Cottonwood Volunteer Fire	Public Safety:			911 or		
Lea County Fire Service Fire Department: Artesia Fire Department Sun Country Volunteer Fire Department Number: (575)746-5060 Sun Country Volunteer Fire Department Number: (505)484-3599 Riverside Volunteer Fire Department Number: (505)365-7900 Cottonwood Volunteer Fire Department Number: (505)748-7344 Atoka Fire Department Number: (505)748-7344 Atoka Fire Department Number: (505)981-2498 Joel Volunteer Fire Department Number: (505)885-4966 Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (505)887-6353 Loco Hills Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)788-333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (575)887-4100 AirMed: Medevac Number: (575)887-9000 New Mexico OCD-Dist. 2-Artesia Office Emergency Number: (575)748-336 Eddy County Road Department-South Number: (575)746-9540	Eddy County Sheriff's Department		Number:	(575)887-7551		
Fire Department: Artesia Fire Department Sun Country Volunteer Fire Department Number: (505)484-3599 Riverside Volunteer Fire Department Number: (505)365-7900 Cottonwood Volunteer Fire Department Number: (505)748-7344 Atoka Fire Department Number: (505)748-7344 Atoka Fire Department Number: (505)746-9562 Queen Volunteer Fire Department Number: (505)881-2498 Joel Volunteer Fire Department Number: (505)885-4966 Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (505)844-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Dept. of Public Safety Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-9540 Eddy County Road Department-North Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	Eddy County Emergency Managemen	t ·	Number:	(575)628-5450		
Artesia Fire Department Number: (575)746-5060 Sun Country Volunteer Fire Department Number: (505)484-3599 Riverside Volunteer Fire Department Number: (505)365-7900 Cottonwood Volunteer Fire Department Number: (505)748-7344 Atoka Fire Department Number: (505)746-9562 Queen Volunteer Fire Department Number: (505)81-2498 Joel Volunteer Fire Department Number: (505)885-4966 Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (575)885-3125 Hope Volunteer Fire Department Number: (575)885-3125 Hope Volunteer Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)77-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Number: (575)788-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (575)887-4100 AirMed: Medevac Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: (575)626-0830 Eddy County Road Department-North Number: (575)746-9540	Lea County Fire Service		Number:	(575)628-5450		
Sun Country Volunteer Fire Department Riverside Volunteer Fire Department Riverside Volunteer Fire Department Cottonwood Volunteer Fire Department Rumber: C505)365-7900 Cottonwood Volunteer Fire Department Number: C505)748-7344 Atoka Fire Department Number: C505)746-9562 Queen Volunteer Fire Department Number: C505)881-2498 Joel Volunteer Fire Department Number: C505)885-4966 Otis Fire Rescue Number: C575)236-6113 La Huerta Volunteer Fire Department Number: C505)887-6353 Carlsbad Fire Department Number: C505)887-6353 Carlsbad Fire Department Number: C505)484-3351 Loco Hills Fire Department Number: C505)677-2349 Loving Fire Department Number: C505)745-3600 White's City Fire Department Number: C505)745-3600 White's City Fire Department Number: C505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: C575)748-3333 Carlsbad Medevac Number: C575)887-4100 AirMed: Medevac Number: C505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: C575)748-1283 Emergency Number: C575)748-1283 Eddy County Road Department-North Number: C575)746-9540	Fire Department:					
Riverside Volunteer Fire Department Cottonwood Volunteer Fire Department Number: (505)748-7344 Atoka Fire Department Number: (505)746-9562 Queen Volunteer Fire Department Number: (505)885-4966 Queen Volunteer Fire Department Number: (505)885-4966 Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (505)885-3125 Hope Volunteer Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: (575)748-1283 Emergency Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	Artesia Fire Department		Number:	(575)746-5060		
Cottonwood Volunteer Fire Department Atoka Fire Department Atoka Fire Department Queen Volunteer Fire Department Number: (505)746-9562 Queen Volunteer Fire Department Number: (505)885-4966 Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)77-2349 Loving Fire Department Number: (505)77-2349 Loving Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (575)887-4100 AirMed: Medevac Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Eddy County Road Department-North Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	Sun Country Volunteer Fire De	epartment	Number:	(505)484-3599		
Atoka Fire Department	Riverside Volunteer Fire Depa	rtment	Number:	(505)365-7900		
Queen Volunteer Fire Department Number: (505)981-2498 Joel Volunteer Fire Department Number: (505)885-4966 Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (575)885-3125 Hope Volunteer Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-North Number: (575)746-9540	Cottonwood Volunteer Fire D	epartment	Number:	(505)748-7344		
Joel Volunteer Fire Department Otis Fire Rescue Number: (575)236-6113 La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (575)885-3125 Hope Volunteer Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (575)887-4100 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Emergency Number: (575)748-1283 Eddy County Road Department-North Number: (575)746-9540	Atoka Fire Department		Number:	(505)746-9562		
Otis Fire Rescue La Huerta Volunteer Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (575)885-3125 Hope Volunteer Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (575)887-4100 AirMed: Medevac Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Emergency Number: (575)748-1283 Emergency Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	Queen Volunteer Fire Departi	ment	Number: (505)981-2498			
La Huerta Volunteer Fire Department Carlsbad Fire Department Number: (505)887-6353 Carlsbad Fire Department Number: (575)885-3125 Hope Volunteer Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (888)303-9112 Dept. of Public Safety Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Number: (575)746-9540	Joel Volunteer Fire Departme	nt	Number:	(505)885-4966		
Carlsbad Fire Department Hope Volunteer Fire Department Loco Hills Fire Department Loco Hills Fire Department Loving Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (588)303-9112 Dept. of Public Safety Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Number: (575)885-4835 Eddy County Road Department-North	Otis Fire Rescue		Number:	(575)236-6113		
Hope Volunteer Fire Department Loco Hills Fire Department Loving Fire Department Number: (505)484-3351 Loco Hills Fire Department Number: (505)677-2349 Loving Fire Department Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Dept. of Public Safety Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	La Huerta Volunteer Fire Depa	Number:	(505)887-6353			
Loco Hills Fire Department Loving Fire Department Number: (505)677-2349 Number: (505)745-3600 White's City Fire Department Number: (505)785-2219 Hospital: Artesia General Hospital Carlsbad Medical Center Number: (575)748-3333 Carlsbad Medical Center Number: (575)887-4100 AirMed: Medevac Number: (888)303-9112 Dept. of Public Safety Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	Carlsbad Fire Department	Number:	(575)885-3125			
Loving Fire Department White's City Fire Department Hospital: Artesia General Hospital Carlsbad Medical Center AirMed: Medevac Dept. of Public Safety Number: (505)745-3600 Number: (505)785-2219 Number: (575)748-3333 Number: (575)887-4100 Number: (575)887-4100 Number: (5888)303-9112 Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Eddy County Road Department-North Number: (575)746-9540	Hope Volunteer Fire Departm	ent	Number:	(505)484-3351		
White's City Fire Department Hospital: Artesia General Hospital Carlsbad Medical Center AirMed: Medevac Dept. of Public Safety Number: (575)887-4100 Number: (575)887-4100 Number: (888)303-9112 Number: (505)827-9000 Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Eddy County Road Department-North Number: (575)746-9540	Loco Hills Fire Department		Number:	(505)677-2349		
Hospital: Artesia General Hospital Carlsbad Medical Center AirMed: Medevac Dept. of Public Safety Number: Number: (575)887-4100 Number: (888)303-9112 Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Eddy County Road Department-North Number: (575)746-9540	Loving Fire Department		Number:	(505)745-3600		
Artesia General Hospital Carlsbad Medical Center AirMed: Medevac Dept. of Public Safety Number: (575)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Eddy County Road Department-South Eddy County Road Department-North Number: (575)748-3333 Number: (575)887-4100 Number: (505)827-9000 Number: (575)748-1283 Emergency Number: (575)626-0830 Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	White's City Fire Department		Number:	(505)785-2219		
Carlsbad Medical Center AirMed: Medevac Dept. of Public Safety Number: (575)887-4100 Number: (888)303-9112 Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Emergency Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Eddy County Road Department-North Number: (575)885-4835 Eddy County Road Department-North	Hospital:					
AirMed: Medevac Dept. of Public Safety Number: (505)827-9000 New Mexico OCD-Dist. 2-Artesia Office Emergency Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Eddy County Road Department-North Number: (575)746-9540	Artesia General Hospital		Number:	(575)748-3333		
Dept. of Public Safety New Mexico OCD-Dist. 2-Artesia Office Emergency Number: (505)827-9000 Number: (575)748-1283 Emergency Number: (575)626-0830 Eddy County Road Department-South Eddy County Road Department-North Number: (575)885-4835 Eddy County Road Department-North	Carlsbad Medical Center		Number:	(575)887-4100		
New Mexico OCD-Dist. 2-ArtesiaOfficeNumber:(575)748-1283Eddy County Road Department-SouthEddy County Road Department-NorthNumber:(575)885-4835Eddy County Road Department-NorthNumber:(575)746-9540	AirMed: Medevac		Number:	(888)303-9112		
Emergency Number: (575)626-0830 Eddy County Road Department-South Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	Dept. of Public Safety		Number:	(505)827-9000		
Eddy County Road Department-South Number: (575)885-4835 Eddy County Road Department-North Number: (575)746-9540	New Mexico OCD-Dist. 2-Artesia	Office	Number:	(575)748-1283		
Eddy County Road Department-North Number: (575)746-9540		Emergency	Number:	(575)626-0830		
	Eddy County Road Department-South	1	Number:	(575)885-4835		
NMDOT Number: (505)827-5100	Eddy County Road Department-North	l	Number:	(575)746-9540		
	NMDOT		Number:	(505)827-5100		

Job# Rig: Latshaw 17

Chisholm Energy Holdings

Eddy County, NM (NAD 83) Bodacious 5-32 Fed Com API# WCB 6H

Wellbore #1

Sperry Drilling Services

Ellipse Separation Anticollision Report

Minimum Magnetic Interference Warning level is 50' center to center

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference) Reference Design: Bodacious 5-32 Fed Com - WCB 6H - Wellbore #1 - Plan 1

Well Coordinates:

32° 19' 37.07" N 104° 18' 46.85" W North American Datum 1983 New Mexico Eastern Zone 482,682.59 N 547,613.81 E

Ground Level: 3,364.50 usft

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

Scan Radius is 2,208.61 usft . Clearance Factor cutoff is Unlimited. Max Ellipse Separation is Unlimited

Version: 5000.1 Build: 81E

Report Version: Midcon Ellipse v1.50

HALLIBURTON

Anticollision Report for WCB 6H - Plan 1

Anticollision Summary

Reference Design: Bodacious 5-32 Fed Com - WCB 6H - Wellbore #1 - Plan 1

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

Site Name Comparison Well Name - Wellbore Name - Design	Measured Depth (usft)	Minimum Distance (usft)	@Measured Depth (usft)	Ellipse Separation (usft)	@Measured Depth usft	Clearance Factor	Summary Based on Minimum
Bodacious 5-32 Fed Com	Compagnition of the Compag						
3BS 4H - Wellbore #1 - Plan 1	503.99	59.95	503.99	56.44	503.49	17.100	Centre Distance / Ellipse Separation
	7,938.63	141.85	7,938.63	104.56	7,929.64	3.804	Clearance Factor
WCA 5H - Wellbore #1 - Plan 1	1,200.00	S0.01	1,200.00	23.52	1,199.90	4.621	Centre Distance / Ellipse Separation
	8,000.00	99.91	8,000.00	62.91	7,991.26	2.700	Clearance Factor

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

•	Uncertainty Data for Reference Well					Uncertainty	Data for Compa	arison Well		Separation (Ref. > Comp.)				
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor	
100.00	100.00	-0.09	-59.95	0.51	99.90	99.90	-0.04	-29.94	0.51	a 🚁 · 30.01	27.71	89.90	13.047	
200.00	200.00	-0.09	-59.95	0.59	199.90	199.90	-0.04	-29.94	0.59	30.01	27.55	89.90	12.195	
300.00	300.00	-0.09	-59.95	0.73	299.90	299.90	-0.04	-29.94	0.73	30.01	27.26	89.90	10.923	
400.00	400.00	-0.09	-59.95	0.91	399.90	399.90	-0.04	-29.94	0.91	30.01	26.91	89.90	9.676	
500.00	500.00	-0.09	-59.95	1.10	499.90	499.90	-0.04	-29.94	1.10	30.01	26.52	89.90	8.597	
600.00	600.00	-0.09	-59.95	1.31	599.90	599.90	-0.04	-29.94	1.31	30.01	26.11	89.90	7.697	
700.00	700.00	-0.09	-59.95	1.52	699.90	699.90	-0.04	-29.94	1.52	30.01	25.69	89.90	6.948	
800.00	800.00	-0.09	-59.95	1.73	799.90	799.90	-0.04	-29.94	1.73	30.01	25.26	89.90	6.322	
900.00	900.00	-0.09	-59.95	1.95	899.90	899.90	-0.04	-29.94	1.95	30.01	24.83	89.90	5.794	
1,000.00	1,000.00	-0.09	-59.95	2.16	999.90	999.90	-0.04	-29.94	2.16	30.01	24.39	89.90	5.344	
1,100.00	1,100.00	-0.09	-59.95	2.38	1,099.90	1,099.90	-0.04	-29.94	2.38	30.0 1	23.96	89.90	4.957	
1,200.00	1,200.00	-0.09	-59.95	2.60	1,199.90	1,199.90	-0.04	-29.94	2.60	30.0ú	23.52	89.90	4.621	
1,300.00	1,300.00	-0.09	-59.95	2.82	1,298.83	1,298.81	-0.04	-28.24	2.81	* 31 <u>.7</u> 8	24.81	89.91	4.585	
1,400.00	1,400.00	-0.09	-59.95	3.05	1,397.51	1,397.36	-0.04	-23.13	3.01	36.90	29.57	89.92	5.031	
1,500.00	1,500.00	-0.09	-59.95	3.27	1,496.46	1,495.97	-0.04	-14.99	3.22	45.18	37.38	89.94	5.821	
1,600.00	1,600.00	-0.09	-59.95	3.49	1,596.08	1,595.21	-0.04	-6.31	3.44	53.85	45.67	89.95	6.585	
1,700.00	1,700.00	-0.09	-59.95	3.71	1,695.70	1,694.45	-0.04	2.38	3.66	62.56	53.96	89.95	7.271	
1,800.00	1,800.00	-0.09	-59.95	3.94	1,795.32	1,793.69	-0.04	11.06	3.90	71.28	62.24	89.96	7.889	
1,900.00	1,900.00	-0.09	-59.95	4.16	1,894.94	1,892.93	-0.04	19.74	4.13	79.99	70.53	89.96	8.448	
2,000.00	2,000.00	-0.09	-59.95	4.38	1,994.56	1,992.17	-0.04	28.42	4.38	88.71	78.80	89.97	8.955	
2,100.00	2,099.98	-0.09	-58.20	4.59	2,094.31	2,091.54	-0.04	37.12	4.62	95.69	85.36	-0.03	9.264	
2,200.00	2,199.84	-0.09	-52.97	4.79	2,194.24	2,191.09	-0.04	45.83	4.87	99.18	88.43	-0.03	9.232	
2,300.00	2,299.49	-0.09	-44 .69	5.00	2,294.24	2,290.71	-0.04	54.54	5.12	99.61	88.45	-0.03	8.925	
2,309.51	2,308.96	-0.09	-43.86	5.02	2,303.75	2,300.18	-0.04	55.37	5.15	99.61	88.41	-0.03	8.893	
2,400.00	2,399.11	-0.09	-35.98	5.21	2,394.24	2,390.33	-0.04	63.26	5.38	99.61	88.03	-0.03	8.599	
2,500.00	2,498.73	-0.09	-27.26	5.43	2,494.24	2,489.95	-0.04	71.97	5.63	99.61	87.60	-0.03	8.293	
2,600.00	2,598.35	-0.09	-18.54	5.66	2,594.24	2,589.57	-0.04	80.69	5.89	99.61	87.17	-0.03	8.007	
2,600.44	2,598.79	-0.09	-18.51	5.66	2,594.68	2,590.01	-0.04	80.73	5.89	99.61	87.17	-0.03	8.006	
2,700.00	2,697.97	-0.09	-9.83	5.89	2,694.24	2,689.19	-0.04	89.40	6.15	99.61	86.74	-0.03	7.738	
2,800.00	2,797.59	-0.09	-1.11	6.12	2,794.24	2,788.81	-0.04	98.12	6.41	99.61	86.30	-0.03	7.485	

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	y Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
2,821.13	2,818.64	-0.09	0.73	6.17	2,815.37	2,809.86	-0.04	99.96	6.47	99.61	86.21	-0.03	7.433
2,900.00	2,897.21	-0.09	7.60	6.36	2,894.24	2,888.43	-0.04	106.84	6.67	99.61	85.87	-0.03	7.246
2,904.82	2,902.01	-0.09	8.02	6.37	2,899.06	2,893.23	-0.04	107.26	6.68	99.61	85.84	-0.03	7.235
3,000.00	2,996.83	-0.09	16.32	6.59	2,994.24	2,988.05	-0.04	115.55	6.93	99.61	85.43	-0.03	7.022
3,100.00	3,096.45	-0.09	25.03	6.84	3,094.24	3,087.67	-0.04	124.27	7.20	99.61	84.98	-0.03	6.810
3,200.00	3,196.07	-0.09	33.75	7.08	3,194.24	3,187.29	-0.04	132.98	7.46	99.61	84.54	-0.03	6.610
3,205.39	3,201.44	-0.09	34.22	7.09	3,199.63	3,192.66	-0.04	133.45	7.48	99.61	84.52	-0.03	6.599
3,300.00	3,295.69	-0.09	42.46	7.33	3,294.24	3,286.91	-0.04	141.70	7.73	99.61	84.10	-0.03	6.421
3,400.00	3,395.31	-0.09	51.18	7.57	3,394.24	3,386.52	-0.04	150.41	7.99	99.61	83.65	-0.03	6.241
3,500.00	3,494.93	-0.09	59.90	7.82	3,494.24	3,486.14	-0.04	159.13	8.26	99.61	83.20	-0.03	6.071
3,503.42	3,498.33	-0.09	60.19	7.83	3,497.66	3,489.55	-0.04	159.43	8.27	99.61	83.19	-0.03	6.066
3,600.00	3,594.55	-0.09	68.61	8.07	3,594.24	3,585.76	-0.04	167.84	8.52	99.61	82.76	-0.03	5.910
3,700.00	3,694.17	-0.09	77.33	8.33	3,694.24	3,685.38	-0.04	176.56	8.79	99.61	82.31	-0.03	5.756
3,733.51	3,727.54	-0.09	80.25	8.41	3,727.75	3,718.76	-0.04	179.48	8.88	99.61	82.16	-0.03	5.707
3,800.00	3,793.78	-0.09	86.04	8.58	3,794.24	3,785.00	-0.04	185.28	9.06	99.61	81.86	-0.03	5.610
3,850.70	3,844.29	-0.09	90.46	8.71	3,844.94	3,835.51	-0.04	189.69	9.19	99.61	81.63	-0.03	5.539
3,900.00	3,893.40	-0.09	94.76	8.84	3,894.24	3,884.62	-0.04	193.99	9.32	99.61	81.41	-0.03	5.471
4,000.00	3,993.02	-0.09	103.47	9.09	3,994.24	3,984.24	-0.04	202.71	9.59	99.61	80.95	-0.03	5.339
4,100.00	4,092.64	-0.09	112.19	9.35	4,094.24	4,083.86	-0.04	211.42	9.86	99.61	80.50	-0.03	5.213
4,167.05	4,159.44	-0.09	118.03	9.52	4,161.29	4,150.65	-0.04	217.27	10.04	99.61	80.20	-0.03	5.131
4,200.00	4,192.26	-0.09	120.91	9.61	4,194.24	4,183.48	-0.04	220.14	10.13	99.61	80.05	-0.03	5.092
4,300.00	4,291.88	-0.09	129.62	9.87	4,294.24	4,283.10	-0.04	228.85	10.40	99.61	79.59	-0.03	4.976
4,304.69	4,296.55	-0.09	130.03	9.88	4,298.93	4,287.77	-0.04	229.26	10.41	99.61	79.57	-0.03	4.971
4,400.00	4,391.50	-0.09	138.34	10.13	4,394.24	4,382.72	-0.04	237.57	10.67	99.61	79.14	-0.03	4.866
4,452.93	4,444.23	-0.09	142.95	10.26	4,447.17	4,435.44	-0.04	242.18	10.81	99.61	78.90	-0.03	4.809
4,500.00	4,491.12	-0.09	147.05	10.39	4,494.24	4,482.34	-0.04	246.28	10.94	99.61	78.68	-0.03	4.760
4,600.00	4,590.74	-0.09	155.77	10.65	4,594.24	4,581.96	-0.04	255.00	11.21	99.61	78.23	-0.03	4.659
4,695.42	4,685.79	-0.09	164.08	10.90	4,689.66	4,677.01	-0.04	263.32	11.46	99.61	77.79	-0.03	4.566
4,700.00	4,690.36	-0.09	164.48	10.91	4,694.24	4,681.58	-0.04	263.72	11.48	99.61	77.77	-0.03	4.561

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	/ Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
4,800.00	4.789.98	-0.09	173.20	11,17	4,794.24	4,781.20	-0.04	272.43	11.75	99.61	77.32	-0.03	4.468
4,900.00	4,889.60	-0.09	181.91	11.43	4,894.24	4,880.82	-0.04	281.15	12.02	99.61	76.86	-0.03	4.378
4,948.43	4,937.84	-0.09	186.13	11.56	4,942.67	4,929.06	-0.04	285.37	12.15	99.61	76.64	-0.03	4.336
5,000.00	4,989.22	-0.09	190.63	11.70	4,994.24	4,980.44	-0.04	289.86	12.29	99.61	76.40	-0.03	4.292
5,062.43	5,051.41	-0.09	196.07	11.86	5,056.67	5,042.63	-0.04	295.30	12.46	99.61	76.12	-0.03	4.240
5,100.00	5,088.84	-0.09	199.35	11.96	5,094.24	5,080.06	-0.04	298.58	12.56	99.61	75.94	-0.03	4.209
5,198.87	5,187.33	-0.09	207.96	12.22	5,193.11	5,178.55	-0.04	307.19	12.83	99.61	75.49	-0.03	4.130
5,200.00	5,188.46	-0.09	208.06	12.23	5,194.24	5,179.68	-0.04	307.29	12.83	99.61	75.49	-0.03	4.129
5,300.00	5,288.08	-0.09	216.78	12.49	5,294.24	5,279.29	-0.04	316.01	13.10	99.61	75.03	-0.03	4.052
5,400.00	5,387.70	-0.09	225.49	12.76	5,394.24	5,378.91	-0.04	324.72	13.37	99.61	74.57	-0.03	3.978
5,402.46	5,390.15	-0.09	225.71	12.76	5,396.70	5,381.37	-0.04	324.94	13.38	99.61	74.56	-0.03	3.976
5,500.00	5,487.32	-0.09	234.21	13.02	5,494.24	5,478.53	-0.04	333.44	13.64	99.61	74.11	-0.03	3.906
5,600.00	5,586.94	-0.09	242.92	13.29	5,594.24	5,578.15	-0.04	342.16	13.91	99.61	73.65	-0.03	3.837
5,606.67	5,593.58	-0.09	243.50	13.31	5,600.91	5,584.79	-0.04	342.74	13.93	99.61	73.62	-0.03	3.833
5,700.00	5,686.55	-0.09	251.64	13.55	5,694.24	5,677.77	-0.04	350.87	14.18	99.61	73.19	-0.03	3.770
5,800.00	5,786.17	-0.09	260.35	13.82	5,794.24	5,777.39	-0.04	359.59	14.46	99.61	72.73	-0.03	3.706
5,900.00	5,885.79	-0.09	269.07	14.09	5,894.24	5,877.01	-0.04	368.30	14.73	99.61	72.27	-0.03	3.643
5,904.66	5,890.44	-0.09	269.48	14.10	5,898.90	5,881.65	-0.04	368.71	14.74	99.61	72.25	-0.03	3.641
6,000.00	5,985.41	-0.09	277.79	14.35	5,994.24	5,976.63	-0.04	377.02	15.00	99.61	71.81	-0.03	3.583
6,105.22	6,090.23	-0.09	286.96	14.64	6,099.46	6,081.45	-0.04	386.19	15.29	99.61	71.33	-0.03	3.522
6,100.00	6,085.03	-0.09	286.50	14.62	6,094.24	6,076.25	-0.04	385.73	15.27	99.61	71.35	-0.03	3.525
6,200.00	6,184.65	-0.09	295.22	14.89	6,194.24	6,175.87	-0.04	394.45	15.54	99.61	70.89	-0.03	3.468
6,312.39	6,296.61	-0.09	305.01	15.19	6,306.63	6,287.83	-0.04	404.24	15.85	99.61	70.37	-0.03	3.407
6,300.00	6,284.27	-0.09	303.93	15.16	6,294.24	6,275.49	-0.04	403.16	15.81	99.61	70.43	-0.03	3.413
6,328.87	6,313.03	-0.09	306.45	15.23	6,323.11	6,304.25	-0.04	405.68	15.89	99.61	70.30	-0.03	3.398
6,400.00	6,383.89	-0.09	312.65	15.43	6,394.24	6,375.11	-0.04	411.88	16.09	99.61	69.97	-0.03	3.360
6,500.00	6,483.51	-0.09	321.36	15.69	6,494.24	6,474.73	-0.04	420.60	16.36	99.61	69.51	-0.03	3.309
6,614.43	6,597.50	-0.09	331.34	16.00	6,608.67	6,588.72	-0.04	430.57	16.67	99.61	68.98	-0.03	3.252
6,600.00	6,583.13	-0.09	330.08	15.96	6,594.24	6,574.35	-0.04	429.31	16.63	99.61	69.05	-0.03	3.259
6,700.00	6,682.75	-0.09	338.79	16.23	6,694.24	6,673.97	-0.04	438.03	16.90	99.61	68.58	-0.03	3.210

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	y Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)		Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
6,728.87	6,711.51	-0.09	341.31	16.31	6,723.11	6,702.73	-0.04	440.54	16.98	99.61	68.45	-0.03	3.197
6,800.00	6,782.37	-0.09	347.51	16.50	6,794.24	6,773.59	-0.04	446.74	17.18	99.61	68.12	-0.03	3.163
6,900.00	6,881.99	-0.09	356.23	16.77	6,894.24	6,873.21	-0.04	455.46	17.45	99.61	67.66	-0.03	3.118
7,000.00	6,981.61	-0.09	364.94	17.04	6,994.24	6,972.83	-0.04	464.17	17.72	99.61	67.20	-0.03	3.073
7,004.80	6,986.39	-0.09	365:36	17.05	6,999.04	6,977.61	-0.04	464.59	17.73	99.61	67.18	-0.03	3.071
7,100.00	7,081.23	-0.09	373.66	17.31	7,094.24	7,072.45	-0.04	472.89	17.99	99.61	66.74	-0.03	3.030
7,200.00	7,180.85	-0.09	382.37	17.58	7,194.24	7,172.06	-0.04	481.60	18.26	99.61	66.28	-0.03	2.988
7,204.80	7,185.63	-0.09	382.79	17.59	7,199.04	7,176.85	-0.04	482.02	18.28	99.61	66.25	-0.03	2.986
7,300.00	7,280.47	-0.09	391.09	17.85	7,294.24	7,271.68	-0.04	490.32	18.54	99.61	65.81	-0.03	2.947
7,400.00	7,380.09	-0.09	399.80	18.12	7,394.24	7,371.30	-0.04	499.04	18.81	99.61	65.35	-0.03	2.907
7,500.00	7,479.70	-0.09	408.52	18.39	7,494.24	7,470.92	-0.04	507.75	19.08	99.61	64.89	-0.03	2.869
7,518.67	7,498.30	-0.09	410.15	18.44	7,512.91	7,489.52	-0.04	509.38	19.13	99.61	64.80	-0.03	2.862
7,600.00	7,579.32	-0.09	417.23	18.66	7,594.24	7,570.54	-0.04	516.47	19.36	99.61	64.43	-0.03	2.831
7,700.00	7,678.94	-0.09	425.95	18.93	7,694.24	7,670.16	-0.04	525.18	19.63	99.61	63.96	-0.03	2.794
7,700.66	7,679.60	-0.09	426.01	18.93	7,694.90	7,670.82	-0.04	525.24	19.63	99.61	63.96	-0.03	2.794
7,800.00	7,778.56	-0.09	434.67	19.20	7,794.24	7,769.78	-0.04	533.90	19.90	99.61	63.50	-0.03	2.758
7,900.00	7,878.18	-0.09	443.38	19.47	7,894.24	7,869.40	-0.04	542.61	20.17	99.61	63.04	-0.03	2.723
7,902.98	7,881.15	-0.09	443.64	19.47	7,897.22	7,872.37	-0.04	542.87	20.18	99.61	63.02	-0.03	2.722
8,000.00	7,977.80	-0.09	452.10	19.74	7,991.26	7,966.03	-0.04	551.32	20.44	99.91	62.91	-0.03	2.700
8,100.00	8,077.42	-0.09	460.81	20.01	8,075.39	8,048.56	-0.04	567.24	20.76	110.25	73.35	-0.03	2.988
8,200.00	8,177.17	-0.09	467.79	20.24	8,154.90	8,123.63	-0.04	593.24	21.15	136.36	100.12	-0.02	3.762
8,300.00	8,277.11	-0.09	471.28	20.42	8,226.26	8,187.37	-0.04	625.22	21.61	178.14	142.91	-0.02	5.057
8,400.00	8,377.10	-0.09	471.71	20.59	8,287.98	8,238.94	-0.04	659.09	22.08	232.75	198.67	89.98	6.829
8,500.00	8,477.10	-0.09	471.71	20.78	8,341.15	8,280.22	-0.04	692.57	22.54	295.81	262.88	89.99	8.983
8,600.00	8,577.10	-0.09	471.71	20.96	8,386.80	8,313.05	-0.04	724.26	22.99	365.31	333.46	89.99	11.472
8,700.00	8,677.10	-0.09	471.71	21.15	8,425.93	8,339.12	-0.04	753.44	23.41	439.92	409.06	89.99	14.252
8,800.00	8,777.10	-0.09	471.71	21.34	8,450.00	8,354.14	-0.04	772.24	23.68	518.78	489.15	89.99	17.513
8,900.00	8,876.81	-0.09	477.73	21.59	8,500.00	8,382.75	-0.04	813.23	24.30	597.12	567.58	-0.01	20.213
9,000.00	8,974.00	-0.09	500.72	21.97	8,524.51	8,395.44	-0.04	834.20	24.63	667.70	639.36	-0.01	23.565

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertaint	y Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
9,100.00	9,065.72	-0.09	540.24	22.51	8,559.74	8,412.09	-0.04	865.24	25.12	729.88	702.47	0.00	26.621
9,200.00	9,149.19	-0.09	595.09	23.21	8,637.22	8,445.83	4.49	934.78	26.23	781.01	753.35	-0.37	28.239
9,300.00	9,221.86	-0.09	663.60	24.10	8,725.24	8,483.29	22.18	1,012.34	27.52	816.98	788.94	-1.63	29.135
9,400.00	9,281.53	-0.09	743.69	25.21	8,810.02	8,517.72	51.49	1,083.96	28.76	837.68	809.42	-3.56	29.643
9,500.00	9,326.39	-0.09	832.92	26.56	8,886.06	8,546.61	87.50	1,144.31	29.83	844.13	815.82	-5.96	29.815
9,602.72	9,361.59	6.33	929.08	28.10	8,955.67	8,570.94	127.97	1,195.40	30.76	843.03	814.74	-5.30	29.799
9,600.00	9,360.67	5.93	926.55	28.06	8,950.00	8,569.04	124.42	1,191.41	30.69	843.04	814.86	-5.20	29.920
9,700.00	9,393.70	28.92	1,017.95	29.60	9,019.32	8,591.11	170.73	1,237.97	31.55	844.10	815.88	-4.13	29.909
9,800.00	9,424.71	68.44	1,104.28	31.11	9,083.16	8,609.08	218.59	1,276.14	32.29	846.85	818.79	-3.05	30.179
9,900.00	9,452.75	123.28	1,182.89	32.54	9,150.00	8,625.24	273.41	1,310.73	32.99	850.58	822.65	-2.22	30.453
10,000.00	9,476.97	191.79	1,251.41	33.82	9,200.00	8,635.42	317.12	1,332.74	33.46	854.61	827.39	-1.23	31.389
10,100.00	9,496.64	271.87	1,307.76	34.92	9,268.68	8,646.57	380.26	1,357.24	34.03	858.28	831.16	-0.79	31.649
10,200.00	9,511.16	361.10	1,350.21	35.82	9,329.35	8,653.60	438.37	1,373.10	34.46	861.24	834.34	-0.39	32.014
10,300.00	9,520.08	456.76	1,377.48	36.52	9,389.75	8,657.87	497.72	1,383.33	34.83	863.11	836.16	-0.15	32.031
10,400.00	9,523.14	555.95	1,388.75	37.03	9,450.00	8,659.37	557.75	1,387.88	35.14	863.67	836.29	-0.06	31.538
10,480.10	9,522.96	636.03	1,390.55	37.37	9,522.25	8,658.92	629.99	1,388.69	35.47	863.96	835.88	· -0.12	30.768
10,500.00	9,522.50	655.94	1,389.85	37.46	9,542.15	8,658.78	649.89	1,388.88	35.57	863.64	835.36	-0.06	30.540
10,600.00	9,521.80	755.93	1,390.80	37.94	9,642.15	8,658.08	749.88	1,389.84	36.09	863.64	834.39	-0.06	29.522
10,700.00	9,521.10	855.92	1,391.76	38.48	9,742.15	8,657.38	849.88	1,390.81	36.67	863.64	833.37	-0.06	28.531
10,800.00	9,520.40	955.92	1,392.71	39.07	9,842.15	8,656.68	949.87	1,391.77	37.32	863.64	832.32	-0.06	27.572
10,900.00	9,519.70	1,055.91	1,393.67	39.73	9,942.15	8,655.98	1,049.86	1,392.74	38.03	863.65	831.24	-0.06	26.647
11,000.00	9,519.00	1,155.90	1,394.62	40.45	10,042.15	8,655.27	1,149.85	1,393.70	38.81	863.65	830.12	-0.06	25.760
11,100.00	9,518.30	1,255.90	1,395.57	41.22	10,142.15	8,654.57	1,249.85	1,394.67	39.65	863.65	828.98	-0.06	24.910
11,200.00	9,517.60	1,355.89	1,396.53	42.06	10,242.15	8,653.87	1,349.84	1,395.63	40.56	863.65	827.81	-0.06	24.098
11,300.00	9,516.91	1,455.88	1,397.48	42.96	10,342.15	8,653.17	1,449.83	1,396.59	41.52	863.66	826.63	-0.06	23.323
11,400.00	9,516.21	1,555.88	1,398.44	43.92	10,442.15	8,652.47	1,549.83	1,397.56	42.54	863.66	825.42	-0.05	22.585
11,500.00	9,515.51	1,655.87	1,399.39	44.94	10,542.15	8,651.77	1,649.82	1,398.52	43.62	863.66	824.19	-0.05	21.883
11,600.00	9,514.81	1,755.86	1,400.35	46.01	10,642.15	8,651.07	1,749.81	1,399.49	44.75	863.66	822.95	-0.05	21.214
11,700.00	9,514.11	1,855.85	1,401.30	47.13	10,742.15	8,650.36	1,849.80	1,400.45	45.93	863.67	821.70	-0.05	20.577
11,800.00	9,513.41	1,955.85	1,402.26	48.29	10,842.15	8,649.66	1,949.80	1,401.42	47.16	863.67	820.43	-0.05	19.972

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	/ Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
11.900.00	9.512.71	2,055.84	1,403.21	49.51	10,942.15	8,648.96	2,049.79	1,402.38	48.42	863.67	819.14	-0.05	19.396
12,000.00	9,512.01	2,155.83	1,404.17	50.76	11,042.15	8,648.26	2,149.78	1,403.35	49.73	863.67	817.85	-0.05	18.847
12,100.00	9,511.31	2,255.83	1,405.12	52.06	11,142.15	8,647.56	2,249.78	1,404.31	51.07	863.68	816.55	-0.05	18.325
12,200.00	9,510.62	2,355.82	1,406.08	53.38	11,242.15	8,646.86	2,349.77	1,405.27	52.45	863.68	815.23	-0.05	17.827
12,300.00	9,509.92	2,455.81	1,407.03	54.75	11,342.15	8,646.16	2,449.76	1,406.24	53.85	863.68	813.91	-0.05	17.353
12,400.00	9,509.22	2,555.81	1,407.99	56.14	11,442.15	8,645.45	2,549.76	1,407.20	55.29	863.68	812.58	-0.05	16.901
12,500.00	9,508.52	2,655.80	1,408.94	57.56	11,542.15	8,644.75	2,649.75	1,408.17	56.75	863.69	811.24	-0.05	16.469
12,600.00	9,507.82	2,755.79	1,409.90	59.01	11,642.15	8,644.05	2,749.74	1,409.13	58.23	863.69	809.90	-0.05	16.057
12,700.00	9,507.12	2,855.78	1,410.85	60.48	11,742.15	8,643.35	2,849.73	1,410.10	59.74	863.69	808.55	-0.05	15.663
12,800.00	9,506.42	2,955.78	1,411.81	61.97	11,842.15	8,642.65	2,949.73	1,411.06	61.26	863.69	807.19	-0.05	15.286
12,900.00	9,505,72	3,055.77	1,412.76	63.49	11,942.15	8,641.95	3,049.72	1,412.03	62.80	863.70	805.83	-0.05	14.926
13,000.00	9,505.02	3,155.76	1,413.72	65.02	12,042.15	8,641.25	3,149.71	1,412.99	64.36	863.70	804.47	-0.04	14.581
13,100.00	9,504.33	3,255.76	1,414.67	66.57	12,142.15	8,640.54	3,249.71	1,413.95	65.94	863.70	803.09	-0.04	14.251
13,200.00	9,503.63	3,355.75	1,415.63	68.13	12,242.15	8,639.84	3,349.70	1,414.92	67.53	863.70	801.72	-0.04	13.934
13,300.00	9,502.93	3,455.74	1,416.58	69.71	12,342.15	8,639.14	3,449.69	1,415.88	69.13	863.71	800.34	-0.04	13.630
13,400.00	9,502.23	3,555.74	1,417.54	71.30	12,442.15	8,638.44	3,549.68	1,416.85	70.75	863.71	798.96	-0.04	13.338
13,500.00	9,501.53	3,655.73	1,418.49	72.91	12,542.15	8,637.74	3,649.68	1,417.81	72.37	863.71	797.57	-0.04	13.058
13,600.00	9,500.83	3,755.72	1,419.45	74.52	12,642.15	8,637.04	3,749.67	1,418.78	74.01	863.71	796.18	-0.04	12.789
13,700.00	9,500.13	3,855.71	1,420.40	76.15	12,742.15	8,636.34	3,849.66	1,419.74	75.65	863.72	794.79	-0.04	12.530
13,800.00	9,499.43	3,955.71	1,421.36	77.79	12,842.15	8,635.63	3,949.66	1,420.71	77.31	863.72	793.39	-0.04	12.281
13,900.00	9,498.73	4,055.70	1,422.31	79.44	12,942.15	8,634.93	4,049.65	1,421.67	78.97	863.72	791.99	-0.04	12.041
14,000.00	9,498.04	4,155.69	1,423.27	81.09	13,042.15	8,634.23	4,149.64	1,422.63	80.64	863.72	790.59	-0.04	11.810
14,100.00	9,497.34	4,255.69	1,424.22	82.75	13,142.15	8,633.53	4,249.63	1,423.60	82.32	863.73	789.18	-0.04	11.587
14,200.00	9,496.64	4,355.68	1,425.18	84.42	13,242.15	8,632.83	4,349.63	1,424.56	84.01	863.73	787.78	-0.04	11.372
14,300.00	9,495.94	4,455.67	1,426.13	86.10	13,342.15	8,632.13	4,449.62	1,425.53	85.70	863.73	786.37	-0.04	11.165
14,400.00	9,495.24	4,555.67	1,427.09	87.79	13,442.15	8,631.43	4,549.61	1,426.49	87.40	863.73	784.96	-0.04	10.964
14,500.00	9,494.54	4,655.66	1,428.04	89.48	13,542.15	8,630.72	4,649.61	1,427.46	89.10	863.74	783.55	-0.04	10.771
14,600.00	9,493.84	4,755.65	1,429.00	91.17	13,642.15	8,630.02	4,749.60	1,428.42	90.81	863.74	782.13	-0.03	10.584
14,700.00	9,493.14	4,855.64	1,429.95	92.88	13,742.15	8,629.32	4,849.59	1,429.39	92.52	863.74	780.72	-0.03	10.403

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	y Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 6	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)		Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
14,800.00	9,492.44	4,955.64	1,430.91	94.58	13,842.15	8,628.62	4,949.58	1,430.35	94.24	863.75	779.30	-0.03	10.228
14,900.00	9,491.75	5,055.63	1,431.86	96.30	13,942.15	8,627.92	5,049.58	1,431.31	95.96	863.75	777.88	-0.03	10.059
15,000.00	9,491.05	5,155.62	1,432.82	98.01	14,042.15	8,627.22	5,149.57	1,432.28	97.69	863.75	776.46	-0.03	9.895
15,100.00	9,490.35	5,255.62	1,433.77	99.73	14,142.15	8,626.52	5,249.56	1,433.24	99.42	863.75	775.03	-0.03	9.736
15,200.00	9,489.65	5,355.61	1,434.73	101.46	14,242.15	8,625.81	5,349.56	1,434.21	101.15	863.76	773.61	-0.03	9.582
15,300.00	9,488.95	5,455.60	1,435.68	103.19	14,342.15	8,625.11	5,449.55	1,435.17	102.89	863.76	772.19	-0.03	9.433
15,400.00	9,488.25	5,555.60	1,436.64	104.92	14,442.15	8,624.41	5,549.54	1,436.14	104.63	863.76	770.76	-0.03	9.288
15,500.00	9,487.55	5,655.59	1,437.59	106.65	14,542.15	8,623.71	5,649.53	1,437.10	106.38	863.76	769.33	-0.03	9.147
15,600.00	9,486.85	5,755.58	1,438.55	108.39	14,642.15	8,623.01	5,749.53	1,438.07	108.12	863.77	767.90	-0.03	9.011
15,700.00	9,486.15	5,855.57	1,439.50	110.13	14,742.15	8,622.31	5,849.52	1,439.03	109.87	863.77	766.47	-0.03	8.878
15,800.00	9.485.46	5,955.57	1,440.46	111.88	14,842.15	8,621.61	5,949.51	1,439.99	111.62	863.77	765.04	-0.03	8.749
15,900.00	9,484.76	6,055.56	1,441.41	113.63	14,942.15	8,620.90	6,049.51	1,440.96	113.38	863.77	763.61	-0.03	8.624
16,000.00	9,484.06	6,155.55	1,442.37	115.38	15,042.15	8,620.20	6,149.50	1,441.92	115.14	863.78	762.18	-0.03	8.502
16,100.00	9,483.36	6,255.55	1,443.32	117.13	15,142.15	8,619.50	6,249.49	1,442.89	116.90	863.78	760.74	-0.03	8.384
16,200.00	9,482.66	6,355.54	1,444.28	118.89	15,242.15	8,618.80	6,349.48	1,443.85	118.66	863.78	759.31	-0.02	8.268
16,300.00	9,481.96	6,455.53	1,445.23	120.64	15,342.15	8,618.10	6,449.48	1,444.82	120.42	863.78	757.88	-0.02	8.156
16,400.00	9,481.26	6,555.53	1,446.19	122.40	15,442.15	8,617.40	6,549.47	1,445.78	122.19	863.79	756.44	-0.02	8.047
16,500.00	9,480.56	6,655.52	1,447.14	124.16	15,542.15	8,616.70	6,649.46	1,446.75	123.95	863.79	755.00	-0.02	7.940
16,600.00	9,479.86	6,755.51	1,448.10	125.93	15,642.15	8,615.99	6,749.46	1,447.71	125.72	863.79	753.56	-0.02	7.837
16,700.00	9,479.17	6,855.50	1,449.05	127.69	15,742.15	8,615.29	6,849.45	1,448.67	127.49	863.79	752.13	-0.02	7.735
16,800.00	9,478.47	6,955.50	1,450.01	129.46	15,842.15	8,614.59	6,949.44	1,449.64	129.27	863.80	750.69	-0.02	7.637
16,900.00	9,477.77	7,055.49	1,450.96	131.23	15,942.15	8,613.89	7,049.44	1,450.60	131.04	863.80	749.25	-0.02	7.541
17,000.00	9,477.07	7,155.48	1,451.92	133.00	16,042.15	8,613.19	7,149.43	1,451.57	132.82	863.80	747.81	-0.02	7.447
17,100.00	9,476.37	7,255.48	1,452.87	134.77	16,142.15	8,612.49	7,249.42	1,452.53	134.59	863.80	746.37	-0.02	7.355
17,200.00	9,475.67	7,355.47	1,453.83	136.55	16,242.15	8,611.79	7,349.41	1,453.50	136.37	863.81	744.93	-0.02	7.266
17,300.00	9,474.97	7,455.46	1,454.78	138.32	16,342.15	8,611.08	7,449.41	1,454.46	138.15	863.81	743.48	-0.02	7.179
17,400.00	9,474.27	7,555.46	1,455.74	140.10	16,442.15	8,610.38	7,549.40	1,455.43	139.93	863.81	742.04	-0.02	7.094
17,500.00	9,473.57	7,655.45	1,456.69	141.88	16,542.15	8,609.68	7,649.39	1,456.39	141.72	863.81	740.60	-0.02	7.011
17,600.00	9,472.88	7,755.44	1,457.65	143.66	16,642.15	8,608.98	7,749.39	1,457.35	143.50	863.82	739.15	-0.02	6.929
17,700.00	9,472.18	7,855.43	1,458.60	145.44	16,742.15	8,608.28	7,849.38	1,458.32	145.29	863.82	737.71	-0.02	6.850

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - WCA 5H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	y Data for Refer	rence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
17,800,00	9,471,48	7,955.43	1,459.56	147.22	16,842.15	8,607.58	7,949.37	1,459.28	147.07	863.82	736.27	-0.01	6.772
17,900.00	9,470.78	8,055.42	1,460.51	149.01	16,942.15	8,606.88	8,049.36	1,460.25	148.86	863.82	734.82	-0.01	6.696
18,000.00	9,470.08	8,155.41	1,461.47	150.79	17,042.15	8,606.17	8,149.36	1,461.21	150.65	863.83	733.38	-0.01	6.622
18,100.00	9,469.38	8,255.41	1,462.42	152.57	17,142.15	8,605.47	8,249.35	1,462.18	152.43	863.83	731.93	-0.01	6.549
18,200.00	9,468.68	8,355.40	1,463.38	154.36	17,242.15	8,604.77	8,349.34	1,463.14	154.22	863.83	730.48	-0.01	6.478
18,300.00	9,467.98	8,455.39	1,464.33	156.15	17,342.15	8,604.07	8,449.34	1,464.11	156.02	863.83	729.04	-0.01	6.408
18,400.00	9,467.28	8,555.39	1,465.29	157.94	17,442.15	8,603.37	8,549.33	1,465.07	157.81	863.84	727.59	-0.01	6.340
18,500.00	9,466.59	8,655.38	1,466.24	159.73	17,542.15	8,602.67	8,649.32	1,466.03	159.60	863.84	726.14	-0.01	6.273
18,600.00	9,465.89	8,755.37	1,467.20	161.52	17,642.15	8,601.97	8,749.31	1,467.00	161.39	863.84	724.69	-0.01	6.208
18,700.00	9,465.19	8,855.36	1,468.15	163.31	17,742.15	8,601.26	8,849.31	1,467.96	163.19	863.84	723.25	-0.01	6.144
18,800.00	9,464.49	8,955.36	1,469.11	165.10	17,842.15	8,600.56	8,949.30	1,468.93	164.98	863.85	721.80	-0.01	6.081
18,900.00	9,463.79	9,055.35	1,470.06	166.89	17,942.15	8,599.86	9,049.29	1,469.89	166.78	863.85	720.35	-0.01	6.020
19,000.00	9,463.09	9,155.34	1,471.02	168.69	18,042.15	8,599.16	9,149.29	1,470.86	168.57	863.85	718.90	-0.01	5.960
19,100.00	9,462.39	9,255.34	1,471.97	170.48	18,142.15	8,598.46	9,249.28	1,471.82	170.37	863.85	717.45	-0.01	5.901
19,200.00	9,461.69	9,355.33	.1,472.93	172.27	18,242.15	8,597.76	9,349.27	1,472.79	172.17	863.86	716.00	-0.01	5.843
19,300.00	9,460.99	9,455.32	1,473.88	174.07	18,342.15	8,597.06	9,449.26	1,473.75	173.97	863.86	714.55	0.00	5.786
19,400.00	9,460.30	9,555.32	1,474.84	175.87	18,442.15	8,596.36	9,549.26	1,474.71	175.77	863.86	713.10	0.00	5.730
19,500.00	9,459.60	9,655.31	1,475.79	177.66	18,542.15	8,595.65	9,649.25	1,475.68	177.57	863.86	711.65	0.00	5.675
19,600.00	9,458.90	9,755.30	1,476.75	179.46	18,642.15	8,594.95	9,749.24	1,476.64	179.37	863.87	710.20	0.00	5.622
19,700.00	9,458.20	9,855.29	1,477.70	181.26	18,742.15	8,594.25	9,849.24	1,477.61	181.17	863.87	708.75	0.00	5.569
19,800.00	9,457.50	9,955.29	1,478.66	183.06	18,842.15	8,593.55	9,949.23	1,478.57	182.97	863.87	707.30	0.00	5.517
19,900.00	9,456.80	10,055.28	1,479.61	184.86	18,942.15	8,592.85	10,049.22	1,479.54	184.77	863.87	705.85	0.00	5.467
20,000.00	9,456.10	10,155.27	1,480.57	186.66	19,042.15	8,592.15	10,149.21	1,480.50	186.57	863.88	704.39	0.00	5.417
20,086.11	9,455.50	10,241.38	1,481.39	188.21	19,128.27	8,591.54	10,235.32	1,481.33	188.12	863.88	703.14	0.00	5.375

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)		Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
100.00	100.00	-0.09	-59.95	0.51	99.50	99.50	0.00	0.00	0.51	59.95	57.65	89.91	26.064
200.00	200.00	-0.09	-59.95	0.59	199.50	199.50	0.00	0.00	0.59	59.95	57.49	89.91	24.367
300.00	300.00	-0.09	-59.95	0.73	299.50	299.50	0.00	0.00	0.73	59.95	57.20	89.91	21.825
400.00	400.00	-0.09	-59.95	0.91	399.50	399.50	0.00	0.00	0.91	59.95	56.85	89.91	19.334
500.00	500.00	-0.09	-59.95	1.10	499.50	499.50	0.00	0.00	1.10	59.95	56.46	89.91	17.179
503.99	503.99	-0.09	-59.95	1.11	503.49	503.49	0.00	0.00	1.11	59.95	56.44	89.91	17.100
600.00	600.00	-0.09	-59.95	1.31	598.48	598.48	0.04	0.41	1.30	60.37	56.47	89.88	15.506
700.00	700.00	-0.09	-59.95	1.52	696.32	696.26	0.33	3.72	1.49	63.76	59.45	89.63	14.807
800.00	800.00	-0.09	-59.95	1.73	793.81	793.52	0.90	10.33	1.69	70.54	65.80	89.19	14.895
900.00	900.00	-0.09	-59.95	1.95	893.28	892.61	1.66	18.96	1.92	79.23	74.08	88.73	15.379
1,000.00	1,000.00	-0.09	-59.95	2.16	992.90	991.85	2.42	27.61	2.15	87.93	82.35	88.36	15.772
1,100.00	1,100.00	-0.09	-59.95	2.38	1,092.52	1,091.09	3.17	36.26	2.40	96.63	90.63	88.06	16.094
1,200.00	1,200.00	-0.09	-59.95	2.60	1,192.14	1,190.33	3.93	44.91	2.65	105.33	98.90	87.81	16.361
1,300.00	1,300.00	-0.09	-59.95	2.82	1,291.76	1,289.57	4.69	53.56	2.90	114.04	107.16	87.59	16.586
1,400.00	1,400.00	-0.09	-59.95	3.05	1,391.38	1,388.81	5.44	62.21	3.16	122.75	115.43	87.41	16.778
1,500.00	1,500.00	-0.09	-59.95	3.27	1,491.00	1,488.05	6.20	70.86	3.42	131.46	123.70	87.25	16.943
1,600.00	1,600.00	-0.09	-59.95	3.49	1,590.62	1,587.29	6.96	79.50	3.68	140.17	131.96	87.11	17.087
1,700.00	1,700.00	-0.09	-59.95	3.71	1,690.24	1,686.53	7.71	88.15	3.94	148.88	140.23	86.98	17.213
1,800.00	1,800.00	-0.09	-59.95	3.94	1,789.86	1,785.77	8.47	96.80	4.20	157.59	148.49	86.87	17.325
1,900.00	1,900.00	-0.09	-59.95	4.16	1,889.48	1,885.01	9.23	105.45	4.47	166.30	156.75	86.78	17.424
2,000.00	2,000.00	-0.09	-59.95	4.38	1,989.10	1,984.25	9.98	114.10	4.74	175.01	165.02	86.69	17.513
2,100.00	2,099.98	-0.09	-58.20	4.59	2,088.85	2,083.62	10.74	122.76	5.00	181.98	171.56	-3.42	17.452
2,200.00	2,199.84	-0.09	-52.97	4.79	2,188.78	2,183.18	11.50	131.44	5.27	185.48	174.63	-3.58	17.092
2,300.00	2,299.49	-0.09	-44.69	5.00	2,288.77	2,282.79	12.26	140.12	5.54	185.93	174.65	-3.81	16.483
2,400.00	2,399.11	-0.09	-35.98	5.21	2,388.77	2,382.41	13.02	148.80	5.81	185.95	174.24	-4.04	15.876
2,500.00	2,498.73	-0.09	-27.26	5.43	2,488.77	2,482.02	13.78	157.49	6.08	185.97	173.83	-4.28	15.309
2,600.00	2,598.35	-0.09	-18.54	5.66	2,588.76	2,581.64	14.54	166.17	6.35	186.00	173.41	-4.51	14.779
2,700.00	2,697.97	-0.09	-9.83	5.89	2,688.76	2,681.26	15.30	174.85	6.62	186.03	173.00	-4.74	14.282
2,800.00	2,797.59	-0.09	-1.11	6.12	2,788.76	2,780.87	16.06	183.53	6.89	186.06	172.59	-4.98	13.815
2,900.00	2,897.21	-0.09	7.60	6.36	2,888.76	2,880.49	16.82	192.21	7.16	186.09	172.18	-5.21	13.377

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	/ Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 6	Comp.)	
Measured	Vertical	Ellipse C		Ellipse	Measured	Vertical	Ellipse C	entre	Ellipse	Between	Between	Relative	
Depth (usft)	Depth (usft)	+N/-S (usft)	+E/-W (usft)	Major Axis/2	Depth (usft)	Depth (usft)	+N/-S (usft)	+E/-W (usft)	Major Axis/2	Centres (usft)	Ellipsoids (usft)	Highside Bearing	Clearance Factor
3,000.00	2.996.83	-0.09	16.32	6.59	2,988.75	2,980.11	17.58	200.90	7.43	186.13	171.77	-5.45	12.964
3,100.00	3,096.45	-0.09	25.03	6.84	3,088.75	3,079.72	18.34	209.58	7.70	186.17	171.37	-5.68	12.575
3,200.00	3,196.07	-0.09	33.75	7.08	3,188.75	3,179.34	19.10	218.26	7.98	186.21	170.96	-5.91	12.208
3,300.00	3,295.69	-0.09	42.46	7.33	3,288.74	3,278.96	19.85	226.94	8.25	186.26	170.56	-6.15	11.861
3,400.00	3,395.31	-0.09	51.18	7.57	3,388.74	3,378.57	20.61	235.63	8.52	186.31	170.16	-6.38	11.532
3,500.00	3,494.93	-0.09	59.90	7.82	3,488.74	3,478.19	21.37	244.31	8.79	186.36	169.76	-6.61	11.221
3,600.00	3,594.55	-0.09	68.61	8.07	3,588.74	3,577.81	22.13	252.99	9.06	186.42	169.36	-6.85	10.926
3,700.00	3,694.17	-0.09	77.33	8.33	3,688.73	3,677.42	22.89	261.67	9.33	186.48	168.96	-7.08	10.646
3,800.00	3,793.78	-0.09	86.04	8.58	3,788.73	3,777.04	23.65	270.35	9.61	186.54	168.57	-7.31	10.379
3,900.00	3,893.40	-0.09	94.76	8.84	3,888.73	3,876.66	24.41	279.04	9.88	186.61	168.18	-7.54	10.125
4,000.00	3,993.02	-0.09	103.47	9.09	3,988.72	3,976.27	25.17	287.72	10.15	186.68	167.79	-7.78	9.884
4,100.00	4,092.64	-0.09	112.19	9.35	4,088.72	4,075.89	25.93	296.40	10.42	186.75	167.40	-8.01	9.653
4,200.00	4,192.26	-0.09	120.91	9.61	4,188.72	4,175.51	26.69	305.08	10.70	186.82	167.02	-8.24	9.433
4,300.00	4,291.88	-0.09	129.62	9.87	4,288.72	4,275.12	27.45	313.76	10.97	186.90	166.63	-8.47	9.222
4,400.00	4,391.50	-0.09	138.34	10.13	4,388.71	4,374.74	28.21	322.45	11.24	186.98	166.25	-8.71	9.021
4,500.00	4,491.12	-0.09	147.05	10.39	4,488.71	4,474.36	28.97	331.13	11.51	187.07	165.88	-8.94	8.829
4,600.00	4,590.74	-0.09	155.77	10.65	4,588.71	4,573.97	29.73	339.81	11.79	187.15	165.50	-9.17	8.644
4,700.00	4,690.36	-0.09	164.48	10.91	4,688.70	4,673.59	30.49	348.49	12.06	187.24	165.13	-9.40	8.467
4,800.00	4,789.98	-0.09	173.20	11.17	4,788.70	4,773.21	31.25	357.18	12.33	187.33	164.76	-9.63	8.297
4,900.00	4,889.60	-0.09	181.91	11.43	4,888.70	4,872.82	32.01	365.86	12.61	187.43	164.39	-9.86	8.134
5,000.00	4,989.22	-0.09	190.63	11.70	4,988.70	4,972.44	32.77	374.54	12.88	187.53	164.02	-10.09	7.978
5,100.00	5,088.84	-0.09	199.35	11.96	5,088.69	5,072.06	33.53	383.22	13.15	187.63	163.66	-10.32	7.827
5,200.00	5,188.46	-0.09	208.06	12.23	5,188.69	5,17 1 .6 7	34.29	391.90	13.42	187.74	163.30	-10.55	7.682
5,300.00	5,288.08	-0.09	216.78	12.49	5,288.69	5,271.29	35.05	400.59	13.70	187.85	162.94	-10.78	7.542
5,400.00	5,387.70	-0.09	225.49	12.76	5,388.68	5,370.91	35.81	409.27	13.97	187.96	162.58	-11.01	7.408
5,500.00	5,487.32	-0.09	234.21	13.02	5,488.68	5,470.52	36.57	417.95	14.24	188.07	162.23	-11.24	7.278
5,600.00	5,586.94	-0.09	242.92	13.29	5,588.68	5,570.14	37.33	426.63	14.52	188.19	161.88	-11.47	7.153
5,700.00	5,686.55	-0.09	251.64	13.55	5,688.68	5,669.76	38.09	435.31	14.79	188.31	161.53	-11.70	7.032
5,800.00	5,786.17	-0.09	260.35	13.82	5,788.67	5,769.37	38.84	444.00	15.06	188.43	161.18	-11.92	6.916

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	y Data for Refer	ence Well			Uncertainty	Data for Compa	ırison Well		Sepa	ration (Ref. > 0	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)		Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse Co +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
5,900.00	5.885.79	-0.09	269.07	14.09	5,888.67	5,868.99	39.60	452.68	15.34	188.56	160.84	-12.15	6.803
6,000.00	5,985.41	-0.09	277.79	14.35	5,988.67	5,968.60	40.36	461.36	15.61	188.69	160.50	-12.38	6.694
6,100.00	6,085.03	-0.09	286.50	14.62	6,088.66	6,068.22	41.12	470.04	15.88	188.82	160.16	-12.61	6.588
6,200.00	6,184.65	-0.09	295.22	14.89	6,188.66	6,167.84	41.88	478.73	16.16	188.95	159.82	-12.83	6.486
6,300.00	6,284.27	-0.09	303.93	15.16	6,288.66	6,267.45	42.64	487.41	16.43	189.09	159.49	-13.06	6.387
6,400.00	6,383.89	-0.09	312.65	15.43	6,388.65	6,367.07	43.40	496.09	16.70	189.23	159.16	-13.29	6.292
6,500.00	6,483.51	-0.09	321.36	15.69	6,488.65	6,466.69	44.16	504.77	16.98	189.38	158.83	-13.51	6.199
6,600.00	6,583.13	-0.09	330.08	15.96	6,588.65	6,566.30	44.92	513.45	17.25	189.52	158.50	-13.74	6.109
6,700.00	6,682.75	-0.09	338.79	16.23	6,688.65	6,665.92	45.68	522.14	17.52	189.67	158.17	-13.96	6.022
6,800.00	6,782.37	-0.09	347.51	16.50	6,788.64	6,765.54	46.44	530.82	17.80	189.83	157.85	-14.19	5.937
6,900.00	6,881.99	-0.09	356.23	16.77	6,888.64	6,865.15	47.20	539.50	18.07	189.98	157.53	-14.41	5.855
7,000.00	6,981.61	-0.09	364.94	17.04	6,988.64	6,964.77	47.96	548.18	18.34	190.14	157.21	-14.64	5.775
7,100.00	7,081.23	-0.09	373.66	17.31	7,088.63	7,064.39	48.72	556.86	18.62	190.30	156.90	-14.86	5.697
7,200.00	7,180.85	-0.09	382.37	17.58	7,188.63	7,164.00	49.48	565.55	18.89	190.47	156.59	-15.09	5.622
7,300.00	7,280.47	-0.09	391.09	17.85	7,295.15	7,270.25	50.14	573.06	19.10	189.02	154.70	-15.42	5.507
7,400.00	7,380.09	-0.09	399.80	18.12	7,401.83	7,376.86	50.45	576.64	19.29	183.93	149.20	-15.99	5.296
7,500.00	7,479.70	-0.09	408.52	18.39	7,504.17	7,479.20	50.48	576.96	19.45	175.87	140.71	-16.77	5.002
7,600.00	7,579.32	-0.09	417.23	18.66	7,603.79	7,578.82	50.48	576.96	19.63	167.54	131.91	-17.63	4.703
7,700.00	7,678.94	-0.09	425.95	18.93	7,703.41	7,678.44	50.48	576.96	19.80	159.25	123.15	-18.58	4.411
7,800.00	7,778.56	-0.09	434.67	19.20	7,803.03	7,778.06	50.48	576.96	19.98	151.01	114.43	-19.63	4.128
7,900.00	7,878,18	-0.09	443.38	19.47	7,900.00	7,875.03	50.48	577.11	20.15	143.00	105.90	-20.75	3.855
7,938.63	7,916.66	-0.09	446.75	19.57	7,929.64	7,904.61	50.48	578.78	20.23	141.85	104.56	-20.88	3.804
8,000.00	7,977.80	-0.09	452.10	19.74	7,975.00	7,949.55	50.48	584.87	` 20.37	144.76	107.47	-20.58	3.882
8,100.00	8,077.42	-0.09	460.81	20.01	8,053.12	8,024.87	50.48	605.24	20.71	161.63	124.76	-18.82	4.383
8,200.00	8,177.17	-0.09	467.79	20.24	8,125.00	8,090.41	50.48	634.60	21.13	194.48	158.55	-16.47	5.412
8,300.00	8,277.11	-0.09	471.28	20.42	8,182.53	8,139.23	50.48	664.97	21.55	242.79	208.43	-14.46	7.065
8,400.00	8,377.10	-0.09	471.71	20.59	8,232.91	8,178.71	50.48	696.24	21.98	303.53	270.60	77.31	9.217
8,500.00	8,477.10	-0.09	471.71	20.78	8,275.00	8,209.02	50.48	725.42	22.38	372.19	340.60	78.73	11.781
8,600.00	8,577.10	-0.09	471.71	20.96	8,311.02	8,232.83	50.48	752.43	22.76	446.70	416.26	79.79	14.676
8,700.00	8,677.10	-0.09	471.71	21.15	8,341.21	8,251.18	50.48	776.41	23.10	525.72	496.29	80.58	17.860

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	y Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 6	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
8,800.00	8,777.10	-0.09	471.71	21.34	8,366.88	8,265.55	50.48	797.67	23.42	608.26	579.66	81.18	21.268
8,900.00	8,876.81	-0.09	477.73	21.59	8,390.93	8,277.97	50.48	818.26	23.73	690.31	662.49	-6.81	24.808
9,000.00	8,974.00	-0.09	500.72	21.97	8,417.13	8,290.30	50.48	841.37	24.08	765.10	738.10	-5.37	28.345
9,100.00	9,065.72	0.09	540.24	22.51	8,467.00	8,311.49	51.94	886.47	24.77	831.08	804.36	-4.49	31.107
9,200.00	9,149.19	-0.09	595.09	23.21	8,540.53	8,342.06	63.30	952.30	25.83	884.46	857.52	-4.64	32.826
9,300.00	9,221.86	-0.09	663.60	24.10	8,615.00	8,371.78	86.01	1,016.61	26.91	924.02	896.92	-5.66	34.092
9,400.00	9,281.53	-0.09	743.69	25.21	8,684.39	8,397.73	116.84	1,073.01	27.89	949.92	922.78	-7.21	34.994
9,500.00	9,326.39	-0.09	832.92	26.56	8,744.81	8,418.52	150.78	1,118.43	28.70	963.12	936.01	-9.04	35.526
9,600.00	9,360.67	5.93	926.55	28.06	8,800.00	8,435.74	187.05	1,156.24	29.40	969.61	942.48	-8.55	35.742
9,700.00	9,393.70	28.92	1,017.95	29.60	8,850.00	8,449.67	223.87	1,187.03	29.98	978.18	951.19	-7.54	36.239
9,800.00	9,424.71	68.44	1,104.28	31.11	8,900.00	8,461.88	264.01	1,214.19	30.52	988.13	961.35	-6.73	36.888
9,900.00	9,452.75	123.28	1,182.89	32.54	8,950.00	8,472.21	307.04	1,237.41	31.00	998.61	972.11	-6.11	37.687
10,000.00	9,476.97	191.79	1,251.41	33.82	9,000.00	8,480.56	352.50	1,256.43	31.43	1,008.81	982.66	-5.69	38.581
10,100.00	9,496.64	271.87	1,307.76	34.92	9,050.00	8,486.83	399.87	1,271.05	31.81	1,018.05	992.25	-5.44	39.464
10,200.00	9,511.16	361.10	1,350.21	35.82	9,093.39	8,490.55	442.15	1,280.05	32.09	1,025.73	1,000.32	-5.28	40.371
10,300.00	9,520.08	456.76	1,377.48	36.52	9,141.05	8,492.72	489.37	1,285.88	32.35	1,031.45	1,006.09	-5.36	40.679
10,400.00	9,523.14	555.95	1,388.75	37.03	9,201.49	8,492.87	549.77	1,287.68	32.63	1,034.74	1,008.99	-5.59	40.189
10,500.00	9,522.50	655.94	1,389.85	37.46	9,301.49	8,492.18	649.76	1,288.65	33.12	1,034.80	1,008.17	-5.61	38.868
10,600.00	9,521.80	755.93	1,390.80	37.94	9,401.49	8,491.48	749.75	1,289.62	33.68	1,034.79	1,007.23	-5. 6 1	37.550
10,700.00	9,521.10	855.92	1,391.76	38.48	9,501.49	8,490.79	849.74	1,290.59	34.31	1,034.79	1,006.24	-5.61	36.254
10,800.00	9,520.40	955.92	1,392.71	39.07	9,601.49	8,490.09	949.74	1,291.55	35.01	1,034.78	1,005.21	-5.61	34.990
10,900.00	9,519.70	1,055.91	1,393.67	39.73	9,701.49	8,489.40	1,049.73	1,292.52	35.78	1,034.78	1,004.13	-5.61	33.766
11,000.00	9,519.00	1,155.90	1,394.62	40.45	9,801.49	8,488.70	1,149.72	1,293.49	36.62	1,034.77	1,003.02	-5.61	32.587
11,100.00	9,518.30	1,255.90	1,395.57	41.22	9,901.49	8,488.01	1,249.72	1,294.45	37.54	1,034.77	1,001.87	-5.60	31.456
11,200.00	9,517.60	1,355.89	1,396.53	42.06	10,001.49	8,487.31	1,349.71	1,295.42	38.51	1,034.76	1,000.70	-5.60	30.376
11,300.00	9,516.91	1,455.88	1,397.48	42.96	10,101.49	8,486.62	1,449.70	1,296.39	39.55	1,034.76	999.50	-5.60	29.345
11,400.00	9,516.21	1,555.88	1,398.44	43.92	10,201.49	8,485.92	1,549.69	1,297.35	40.65	1,034.75	998.27	-5.60	28.364
11,500.00	9,515.51	1,655.87	1,399.39	44.94	10,301.49	8,485.23	1,649.69	1,298.32	41.80	1,034.75	997.03	-5.60	27.431
11,600.00	9,514.81	1,755.86	1,400.35	46.01	10,401.49	8,484.53	1,749.68	1,299.29	43.01	1,034.74	995.76	-5.60	26.544

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Sepa	ration (Ref. > 6	Comp.)	
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
11,700.00	9,514,11	1,855.85	1,401.30	47.13	10,501.49	8,483.84	1,849.67	1,300.26	44.26	1,034.74	994.48	-5.60	25.702
11,800.00	9,513.41	1,955.85	1,402.26	48.29	10,601.49	8,483.14	1,949.67	1,301.22	45.55	1,034.73	993.18	-5.60	24.903
11,900.00	9,512.71	2,055.84	1,403.21	49.51	10,701.49	8,482.45	2,049.66	1,302.19	46.89	1,034.73	991.87	-5.60	24.143
12,000.00	9,512.01	2,155.83	1,404.17	50.76	10,801.49	8,481.75	2,149.65	1,303.16	48.26	1,034.72	990.55	-5.60	23.422
12,100.00	9,511.31	2,255.83	1,405.12	52.06	10,901.49	8,481.06	2,249.64	1,304.12	49.66	1,034.72	989.21	-5.60	22.737
12,200.00	9,510.62	2,355.82	1,406.08	53.38	11,001.49	8,480.36	2,349.64	1,305.09	51.09	1,034.71	987.87	-5.60	22.086
12,300.00	9,509.92	2,455.81	1,407.03	54.75	11,101.49	8,479.66	2,449.63	1,306.06	52.56	1,034.71	986.51	-5.60	21.467
12,400.00	9,509.22	2,555.81	1,407.99	56.14	11,201.49	8,478.97	2,549.62	1,307.02	54.04	1,034.70	985.14	-5.60	20.878
12,500.00	9,508.52	2,655.80	1,408.94	57.56	11,301.49	8,478.27	2,649.62	1,307.99	55.55	1,034.70	983.77	-5.60	20.317
12,600.00	9,507.82	2,755.79	1,409.90	59.01	11,401.49	8,477.58	2,749.61	1,308.96	57.08	1,034.69	982.39	-5.59	19.783
12,700.00	9,507.12	2,855.78	1,410.85	60.48	11,501.49	8,476.88	2,849.60	1,309.93	58.63	1,034.69	981.00	-5.59	19.273
12,800.00	9,506.42	2,955.78	1,411.81	61.97	11,601.49	8,476.19	2,949.60	1,310.89	60.20	1,034.68	979.61	-5.59	18.787
12,900.00	9,505.72	3,055.77	1,412.76	63.49	11,701.49	8,475.49	3,049.59	1,311.86	61.78	1,034.68	978.21	-5.59	18.323
13,000.00	9,505.02	3,155.76	1,413.72	65.02	11,801.49	8,474.80	3,149.58	1,312.83	63.37	1,034.67	976.80	-5.59	17.879
13,100.00	9,504.33	3,255.76	1,414.67	66.57	11,901.49	8,474.10	3,249.57	1,313.79	64.98	1,034.67	975.39	-5.59	17.456
13,200.00	9,503.63	3,355.75	1,415.63	68.13	12,001.49	8,473.41	3,349.57	1,314.76	66.61	1,034.66	973.98	-5.59	17.050
13,300.00	9,502.93	3,455.74	1,416.58	69.71	12,101.49	8,472.71	3,449.56	1,315.73	68.24	1,034.66	972.56	-5.59	16.661
13,400.00	9,502.23	3,555.74	1,417.54	71.30	12,201.49	8,472.02	3,549.55	1,316.69	69.88	1,034.65	971.14	-5.59	16.289
13,500.00	9,501.53	3,655.73	1,418.49	72.91	12,301.49	8,471.32	3,649.55	1,317.66	71.54	1,034.65	969.71	-5.59	15.933
13,600.00	9,500.83	3,755.72	1,419.45	74.52	12,401.49	8,470.63	3,749.54	1,318.63	73.20	1,034.64	968.28	-5.59	15.590
13,700.00	9,500.13	3,855.71	1,420.40	76.15	12,501.49	8,469.93	3,849.53	1,319.60	74.87	1,034.64	966.85	-5.59	15.261
13,800.00	9,499.43	3,955.71	1,421.36	77.79	12,601.49	8,469.24	3,949.52	1,320.56	76.55	1,034.63	965.41	-5.59	14.946
13,900.00	9,498.73	4,055.70	1,422.31	79.44	12,701.49	8,468.54	4,049.52	1,321.53	78.24	1,034.63	963.97	-5.59	14.642
14,000.00	9,498.04	4,155.69	1,423.27	81.09	12,801.49	8,467.85	4,149.51	1,322.50	79.93	1,034.63	962.53	-5.59	14.350
14,100.00	9,497.34	4,255.69	1,424.22	82.75	12,901.49	8,467.15	4,249.50	1,323.46	81.63	1,034.62	961.08	-5.59	14.069
14,200.00	9,496.64	4,355.68	1,425.18	84.42	13,001.49	8,466.46	4,349.50	1,324.43	83.33	1,034.62	959.63	-5.58	13.798
14,300.00	9,495.94	4,455.67	1,426.13	, 86.10	13,101.49	8,465.76	4,449.49	1,325.40	85.05	1,034.61	958.18	-5.58	13.537
14,400.00	9,495.24	4,555.67	1,427.09	87.79	13,201.49	8,465.07	4,549.48	1,326.37	86.76	1,034.61	956.73	-5.58	13.285
14,500.00	9,494.54	4,655.66	1,428.04	89.48	13,301.49	8,464.37	4,649.47	1,327.33	88.48	1,034.60	955.28	5.58	13.043
14,600.00	9,493.84	4,755.65	1,429.00	91.17	13,401.49	8,463.68	4,749.47	1,328.30	90.21	1,034.60	953.82	-5.58	12.808

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well	Separation (Ref. > Comp.)				
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor
14,700.00	9,493.14	4,855.64	1,429.95	92.88	13,501.49	8,462.98	4,849.46	1,329.27	91.93	1,034.59	952.36	-5.58	12.582
14,800.00	9,492.44	4,955.64	1,430.91	94.58	13,601.49	8,462.29	4,949.45	1,330.23	93.67	1,034.59	950.90	-5.58	12.363
14,900.00	9,491.75	5,055.63	1,431.86	96.30	13,701.49	8,461.59	5,049.45	1,331.20	95.40	1,034.58	949.44	-5.58	12.151
15,000.00	9,491.05	5,155.62	1,432.82	98.01	13,801.49	8,460.90	5,149.44	1,332.17	97.14	1,034.58	947.98	-5.58	11.947
15,100.00	9,490.35	5,255.62	1,433.77	99.73	13,901.49	8,460.20	5,249.43	1,333.13	98.89	1,034.57	946.51	-5.58	11.749
15,200.00	9,489.65	5,355.61	1,434.73	101.46	14,001.49	8,459.51	5,349.43	1,334.10	100.63	1,034.57	945.05	-5.58	11.557
15,300.00	9,488.95	5,455.60	1,435.68	103.19	14,101.49	8,458.81	5,449.42	1,335.07	102.38	1,034.56	943.58	-5.58	11.371
15,400.00	9,488.25	5,555.60	1,436.64	104.92	14,201.49	8,458.12	5,549.41	1,336.04	104.14	1,034.56	942.11	-5.58	11.191
15,500.00	9,487.55	5,655.59	1,437.59	106.65	14,301.49	8,457.42	5,649.40	1,337.00	105.89	1,034.55	940.64	-5.58	11.016
15,600.00	9,486.85	5,755.58	1,438.55	108.39	14,401.49	8,456.73	5,749.40	1,337.97	107.65	1,034.55	939.17	-5.58	10.847
15,700.00	9,486.15	5,855.57	1,439.50	110.13	14,501.49	8,456.03	5,849.39	1,338.94	109.41	1,034.54	937.70	-5.57	10.683
15,800.00	9,485.46	5,955.57	1,440.46	111.88	14,601.49	8,455.34	5,949.38	1,339.90	111.17	1,034.54	936.23	-5.57	10.523
15,900.00	9,484.76	6,055.56	1,441.41	113.63	14,701.49	8,454.64	6,049.38	1,340.87	112.94	1,034.53	934.75	- 5.57	10.368
16,000.00	9,484.06	6,155.55	1,442.37	115.38	14,801.49	8,453.95	6,149.37	1,341.84	114.70	1,034.53	933.28	-5.57	10.218
16,100.00	9,483.36	6,255.55	1,443.32	117.13	14,901.49	8,453.25	6,249.36	1,342.80	116.47	1,034.52	931.80	-5.57	10.071
16,200.00	9,482.66	6,355.54	1,444.28	118.89	15,001.49	8,452.56	6,349.35	1,343.77	118.24	1,034.52	930.32	-5.57	9.929
16,300.00	9,481.96	6,455.53	1,445.23	120.64	15,101.49	8,451.86	6,449.35	1,344.74	120.01	1,034.51	928.85	-5.57	9.790
16,400.00	9,481.26	6,555.53	1,446.19	122.40	15,201.49	8,451.16	6,549.34	1,345.71	121.79	1,034.51	927.37	- 5.57	9.656
16,500.00	9,480.56	6,655.52	1,447.14	124.16	15,301.49	8,450.47	6,649.33	1,346.67	123.56	1,034.50	925.89	-5.57	9.525
16,600.00	9,479.86	6,755.51	1,448.10	125.93	15,401.49	8,449.77	6,749.33	1,347.64	125.34	1,034.50	924.41	-5.57	9.397
16,700.00	9,479.17	6,855.50	1,449.05	127.69	15,501.49	8,449.08	6,849.32	1,348.61	127.12	1,034.49	922.93	-5.57	9.273
16,800.00	9,478.47	6,955.50	1,450.01	129.46	15,601.49	8,448.38	6,949.31	1,349.57	128.90	1,034.49	921.45	-5.57	9.152
16,900.00	9,477.77	7,055.49	1,450.96	131.23	15,701.49	8,447.69	7,049.30	1,350.54	130.68	1,034.48	919.97	-5.57	9.033
17,000.00	9,477.07	7,155.48	1,451.92	133.00	15,801.49	8,446.99	7,149.30	1,351.51	132.46	1,034.48	918.48	-5.57	8.918
17,100.00	9,476.37	7,255.48	1,452.87	134.77	15,901.49	8,446.30	7,249.29	1,352.48	134.25	1,034.47	917.00	-5.57	8.806
17,200.00	9,475.67	7,355.47	1,453.83	136.55	16,001.49	8,445.60	7,349.28	1,353.44	136.03	1,034.47	915.52	-5.57	8.697
17,300.00	9,474.97	7,455.46	1,454.78	138.32	16,101.49	8,444.91	7,449.28	1,354.41	137.82	1,034.46	914.03	-5.56	8.590
17,400.00	9,474.27	7,555.46	1,455.74	140.10	16,201.49	8,444.21	7,549.27	1,355.38	139.61	1,034.46	912.55	-5.56	8.485
17,500.00	9,473.57	7,655.45	1,456.69	141.88	16,301.49	8,443.52	7,649.26	1,356.34	141.40	1,034.45	911.06	-5.56	8.384

Anticollision Report for WCB 6H - Plan 1

Offset Design: Bodacious 5-32 Fed Com - 3BS 4H - Wellbore #1 - Plan 1

0-MWD

Closest Approach 3D Proximity Scan on Current Survey Data (Highside Reference)

Scan Range: 0.00 to 20,086.11 usft. Measured Depth.

	Uncertainty	/ Data for Refer	ence Well			Uncertainty	Data for Compa	arison Well		Separation (Ref. > Comp.)				
Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Measured Depth (usft)	Vertical Depth (usft)	Ellipse C +N/-S (usft)	entre +E/-W (usft)	Ellipse Major Axis/2	Between Centres (usft)	Between Ellipsoids (usft)	Relative Highside Bearing	Clearance Factor	
17,600.00	9,472.88	7,755.44	1,457.65	143.66	16,401.49	8,442.82	7,749.25	1,357.31	143.18	1,034.45	909.58	-5.56	8.284	
17,700.00	9,472.18	7,855.43	1,458.60	145.44	16,501.49	8,442.13	7,849.25	1,358.28	144.97	1,034.44	908.09	-5.56	8.187	
17,800.00	9,471.48	7,955.43	1,459.56	147.22	16,601.49	8,441.43	7,949.24	1,359.24	146.77	1,034.44	906.60	-5.56	8.092	
17,900.00	9,470.78	8,055.42	1,460.51	149.01	16,701.49	8,440.74	8,049.23	1,360.21	148.56	1,034.43	905.12	-5.56	7.999	
18,000.00	9,470.08	8,155.41	1,461.47	150.79	16,801.49	8,440.04	8,149.23	1,361.18	150.35	1,034.43	903.63	-5.56	7.909	
18,100.00	9,469.38	8,255.41	1,462.42	152.57	16,901.49	8,439.35	8,249.22	1,362.15	152.15	1,034.42	902.14	-5.56	7.820	
18,200.00	9,468.68	8,355.40	1,463.38	154.36	17,001.49	8,438.65	8,349.21	1,363.11	153.94	1,034.42	900.65	-5.56	7.733	
18,300.00	9,467.98	8,455.39	1,464.33	156.15	17,101.49	8,437.96	8,449.21	1,364.08	155.74	1,034.41	899.16	-5.56	7.648	
18,400.00	9,467.28	8,555.39	1,465.29	157.94	17,201.49	8,437.26	8,549.20	1,365.05	157.53	1,034.41	897.67	-5.56	7.565	
18,500.00	9,466.59	8,655.38	1,466.24	159.73	17,301.49	8,436.57	8,649.19	1,366.01	159.33	1,034.40	896.19	-5.56	7.484	
18,600.00	9,465.89	8,755.37	1,467.20	161.52	17,401.49	8,435.87	8,749.18	1,366.98	161.13	1,034.40	894.70	-5.56	7.404	
18,700.00	9,465.19	8,855.36	1,468.15	163.31	17,501.49	8,435.18	8,849.18	1,367.95	162.93	1,034.39	893.21	-5.56	7.326	
18,800.00	9,464,49	8,955.36	1,469.11	165:10	17,601.49	8,434.48	8,949.17	1,368.91	164.72	1,034.39	891.71	-5.55	7.250	
18,900.00	9,463.79	9,055.35	1,470.06	166.89	17,701.49	8,433.79	9,049.16	1,369.88	166.52	1,034.38	890.22	-5.55	7.175	
19,000.00	9,463.09	9,155.34	1,471.02	168.69	17,801.49	8,433.09	9,149.16	1,370.85	168.33	1,034.38	888.73	-5.55	7.102	
19,100.00	9,462.39	9,255.34	1,471.97	170.48	17,901.49	8,432.40	9,249.15	1,371.82	170.13	1,034.37	887.24	-5.55	7.030	
19,200.00	9,461.69	9,355.33	1,472.93	172.27	18,001.49	8,431.70	9,349.14	1,372.78	171.93	1,034.37	885.75	-5.55	6.960	
19,300.00	9,460.99	9,455.32	1,473.88	174.07	18,101.49	8,43 1 .01	9,449.13	1,373.75	173.73	1,034.36	884.26	-5.55	6.891	
19,400.00	9,460.30	9,555.32	1,474.84	175.87	18,201.49	8,430.31	9,549.13	1,374.72	175.53	1,034.36	882.77	-5.55	6.823	
19,500.00	9,459.60	9,655.31	1,475.79	177.66	18,301.49	8,429.62	9,649.12	1,375.68	177.34	1,034.35	881.27	-5.55	6.757	
19,600.00	9,458.90	9,755.30	1,476.75	179.46	18,401.49	8,428.92	9,749.11	1,376.65	179.14	1,034.35	879.78	-5.55	6.692	
19,700.00	9,458.20	9,855.29	1,477.70	181.26	18,501.49	8,428.23	9,849.11	1,377.62	180.94	1,034.34	878.29	-5.55	6.628	
19,800.00	9,457.50	9,955.29	1,478.66	183.06	18,601.49	8,427.53	9,949.10	1,378.58	182.75	1,034.34	876.79	-5.55	6.565	
19,900.00	9,456.80	10,055.28	1,479.61	184.86	18,701.49	8,426.84	10,049.09	1,379.55	184.55	1,034.33	875.30	-5.55	6.504	
20,000.00	9,456.10	10,155.27	1,480.57	186.66	18,801.49	8,426.14	10,149.08	1,380.52	186.36	1,034.33	873.81	-5.55	6.444	
20,086.11	9,455.50	10,241.38	1,481.39	188.21	18,887.60	8,425.54	10,235.19	1,381.35	187.91	1,034.33	872.52	-5.55	6.392	

Reference Well Survey tool program

From (usft) To (usft) Survey/Plan

Survey Tool

0.00

20,086.11

.11 Plan 1

MWD

Anticollision Info

Error Model: Scan Method: **ISCWSA**

Closest Approach 3D

Output errors are at

2.00 sigma

Ellipse error terms are correlated across survey tool tie-on points.

Calculated ellipses incorporate surface errors.

Separation is the actual distance between ellipsoids.

Distance Between centres is the straight line distance between wellbore centres.

Clearance Factor = Distance Between Profiles / (Distance Between Profiles - Ellipse Separation).

All station coordinates were calculated using the Minimum Curvature method.

Anticollision Report for WCB 6H - Plan 1


Direction and Coordinates are relative to Grid North Reference.

Vertical Depths are relative to GE 3364.50 + 26 @ 3390.50usft (Latshaw 17). Northing and Easting are relative to Bodacious 5-32 Fed Com.


Coordinate System is US State Plane 1983, New Mexico Eastern Zone.

Central Meridian is -104.00°, Grid Convergence at Surface is: 0.01°.

Summary is based on Minimum Centre Distance

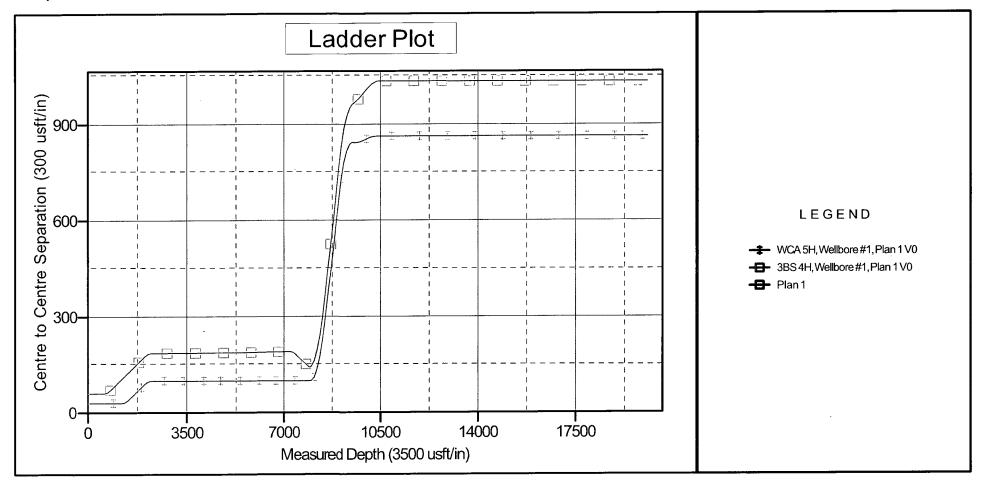

Clearance Factor Plot: Measured Depth versus Separation(Clearance) Factor

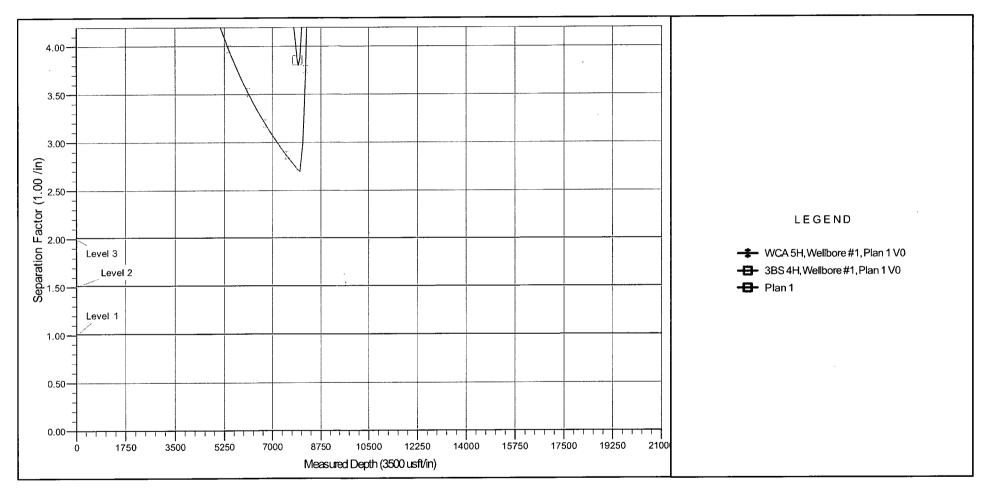



Chi

GE 336

(

Latshaw 17

Chisholm Energy Holdings

Eddy County, NM (NAD 83) Bodacious 5-32 Fed Com API#
WCB 6H

Wellbore #1

Plan: Plan 1

Please review plan for Magnetic Toolface Switchover. Highlighted inclination-tangent sections are between 4 and 6°.

Sperry Drilling ServicesCombo Report

25 June, 2018

Well Coordinates:

32° 19' 37.07" N 104° 18' 46.85" W North American Datum 1983 New Mexico Eastern Zone 482,682.59 N 547,613.81 E

Ground Level: 3,364.50 usft

Local Coordinate Origin:

Viewing Datum:

TVDs to System:

North Reference:

Unit System:

Centered on Site Bodacious 5-32 Fed Com

GE 3364.50 + 26 @ 3390.50usft (Latshaw 17)

Ν

Grid

API US Survey Feet

Version: 5000.1 Build: 81E

Report Version: Midcon Combo v1.12

HALLIBURTON

Measured		Grid	Vertical	Local Coo	rdinates	Map Coor	dinates	Dogleg	Vertical	Toolface	
	Inclination (°)		Depth (usft)	Northing (usft)	Easting (usft)	Northing (usft)	Easting (usft)	Rate (°/100usft)	Section (usft)	Angle (°)	Comments
0.00		0.00	0.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
100.00	0.00	0.00	100.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
200.00	0.00	0.00	200.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
300.00	0.00	0.00	300.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
400.00	0.00	0.00	400.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
500.00	0.00	0.00	500.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
600.00	0.00	0.00	600.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
700.00	0.00	0.00	700.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
800.00	0.00	0.00	800.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
900.00	0.00	0.00	900.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,000.00	0.00	0.00	1,000.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,100.00		0.00	1,100.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,200.00		0.00	1,200.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,300.00		0.00	1,300.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,400.00		0.00	1,400.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1.500.00		0.00	1,500.00	0.09 S	59.95 W	482.682.59	547,613.81	0.00	0.00	0.00	
1,600.00		0.00	1,600.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,700.00		0.00	1,700.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,800.00		0.00	1,800.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
1,900.00		0.00	1,900.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	
2,000.00		0.00	2,000.00	0.09 S	59.95 W	482,682.59	547,613.81	0.00	0.00	0.00	Begin Build
2,100.00		90.00	2,099.98	0.09 S	58.20 W	482,682.59	547,615.56	2.00		90.00	
2,200.00		90.00	2,199.84	0.09 S	52.97 W	482,682.59	547,620.79	2.00	0.00	0.00	
2,250.00		90.00	2,249.68	0.09 S	49.05 W	482,682.59	547,624.71	2.00	0.00	0.00	Hold
2,300.00		90.00	2,299.49	0.09 S	44.69 W	482,682.59	547,629.07	0.00	0.00	0.00	
2,400.00		90.00	2,399.11	0.09 S	35.98 W	482.682.59	547,637.78	0.00	0.00	0.00	
2,500.00		90.00	2,498.73	0.09 S	27.26 W	482,682.59	547,646.50			0.00	
2,600.00		90.00	2,598.35	0.09 S	18.54 W	482,682.59	547,655.22			0.00	
2,700.00		90.00	2,697.97	0.09 S	9.83 W	482,682.59	547,663.93	0.00	0.00	0.00	r
2,800.00		90.00	2,797.59	0.09 S	1.11 W	482,682.59	547,672.65	0.00	0.00	0.00	
2,900.00		90.00	2,897.21	0.09 S	7.60 E	482,682.59	547,681.36		0.00	0.00	
3,000.00	•	90.00	2,996.83		16.32 E	482,682,59	547,690.08			0.00	
3,100.00		90.00	3,096.45		25.03 E	482,682.59	547,698.79			0.00	
3,200.00		90.00	3,196.07	0.09 S	33.75 E	482,682.59	547,707.51	0.00		0.00	
3,300.00		90.00	3,295.69		42.46 E	482,682.59	547,716.22			0.00	
		90.00	3,395.31	0.09 S	51.18 E	482,682.59	547,724.94	0.00		0.00	
3,400.00	5.00	90.00	১,১৯১.১।	0.03 3	31.10 L	402,002.00	541,124.54	0.00	3.00	5.00	

Measured		Grid	Vertical	Local Cod	rdinates	Map Coor	dinates	Dogleg	Vertical	Toolface	
	Inclination (°)		Depth (usft)	Northing (usft)	Easting (usft)	Northing (usft)	Easting (usft)	Rate (°/100usft)	Section (usft)	Angle (°)	Comments
3,500.00		90.00	3,494.93	0.09 S	59.90 E	482,682.59	547,733.66	0.00	0.00	0.00	·
3,600.00		90.00	3,594.55	0.09 S	68.61 E	482,682.59	547,742.37	0.00	0.00	0.00	
3,700.00		90.00	3,694.17	0.09 S	77.33 E	482,682.59	547,751.09	0.00	0.00	0.00	•
3,800.00	5.00	90.00	3,793.78	0.09 S	86.04 E	482,682.59	547,759.80	0.00	0.00	0.00	
3,900.00	5.00	90.00	3,893.40	0.09 S	94.76 E	482,682.59	547,768.52	0.00	0.00	0.00	
4,000.00	5.00	90.00	3,993.02	0.09 S	103.47 E	482,682.59	547,777.23	0.00	0.00	0.00	
4,100.00	5.00	90.00	4,092.64	0.09 S	112.19 E	482,682.59	547,785.95	0.00		0.00	
4,200.00	5.00	90.00	4,192.26	0.09 S	120.91 E	482,682.59	547,794.67	0.00		0.00	
4,300.00	5.00	90.00	4,291.88	0.09 S	129.62 E	482,682.59	547,803.38	0.00	0.00	0.00	
4,400.00	5.00	90.00	4,391.50	0.09 S	138.34 E	482,682.59	547,812.10	0.00	0.00	0.00	
4,500.00		90.00	4,491.12	0.09 S	147.05 E	482,682.59	547,820.81	0.00	0.00	0.00	
4,600.00		90.00	4,590.74	0.09 S	155.77 E	482,682.59	547,829.53	0.00	0.00	0.00	
4,700.00	5.00	90.00	4,690.36	0.09 S	164.48 E	482,682.59	547,838.24	0.00	0.00	0.00	
4,800.00	5.00	90.00	4,789.98	0.09 S	173.20 E	482,682.59	547,846.96	0.00	0.00	0.00	
4,900.00	5.00	90.00	4,889.60	0.09 S	181.91 E	482,682.59	547,855.67	0.00	0.00	0.00	
5,000.00		90.00	4,989.22	0.09 S	190.63 E	482,682.59	547,864.39	0.00	0.00	0.00	
5,100.00		90.00	5,088.84	0.09 S	199.35 E	482,682.59	547,873.11	0.00	0.00	0.00	
5,200.00		90.00	5,188.46	0.09 S	208.06 E	482,682.59	547,881.82	0.00	0.00	0.00	
5,300.00		90.00	5,288.08	0.09 S	216.78 E	482,682.59	547,890.54	0.00	0.00	0.00	
5,400.00		90.00	5,387.70	0.09 S	225.49 E	482,682.59	547,899.25	0.00	0.00	0.00	
5,500.00		90.00	5,487.32		234.21 E	482,682.59	547,907.97	0.00	0.00	0.00	
5,600.00		90.00	5,586.94	0.09 S	242.92 E	482,682.59	547,916.68	0.00	0.00	0.00	
5,700.00		90.00	5,686.55	0.09 S	251.64 E	482,682.59	547,925.40	0.00	0.00	0.00	P
5,800.00		90.00	5,786.17	0.09 S	260.35 E	482,682.59	547,934.11	0.00	0.00	0.00	·
5,900.00		90.00	5,885.79	0.09 S	269.07 E	482,682.59	547,942.83	0.00	0.00	0.00	
6,000.00			5,985.41	0.09 S	277.79 E	482,682.59	547,951.55	0.00	0.00	0.00	
6,100.00		90.00	6,085.03	0.09 S	286.50 E	482,682.59	547,960.26	0.00	0.00	0.00	
6,200.00		90.00	6,184.65	0.09 S	295.22 E	482,682.59	547,968.98	0.00	.0.00	0.00	
6,300.00		90.00	6,284.27		303.93 E	482,682.59	547,977.69	0.00	0.00	0.00	
6,400.00	5.00	90.00	6,383.89	0.09 S	312.65 E	482,682.59	547,986.41	0.00	0.00	0.00	
6,500.00		90.00	6,483.51	0.09 S	321.36 E	482,682.59	547,995.12	0.00	0.00	0.00	
6,600.00		90.00	6,583.13		330.08 E	482,682.59	548,003.84	0.00	0.00	0.00	
6,700.00		90.00	6,682.75		338.79 E	482,682.59	548,012.55	0.00	0.00	0.00	·
6,800.00		90.00	6,782.37	0.09 S	347.51 E	482,682.59	548,021.27	0.00	0.00	0.00	
6,900.00			6,881.99	0.09 S	356.23 E	482,682.59	548,029.99	0.00	0.00	0.00	
7,000.00		90.00	6,981.61	0.09 S	364.94 E	482,682.59	548,038.70	0.00		0.00	
7,100.00					373.66 E	482,682.59	548,047.42	0.00		0.00	

Measured		Grid	Vertical	Local Cod	ordinates	Map Coor	dinates	Dogleg	Vertical	Toolface	
Depth (usft)	Inclination (°)		Depth (usft)	Northing (usft)	Easting (usft)	Northing (usft)	Easting (usft)	Rate (°/100usft)	Section (usft)	Angle (°)	Comments
7,200.00	5.00	90.00	7,180.85	0.09 S	382,37 E	482,682.59	548,056.13	0.00	0.00	0.00	
7,300.00	5.00	90.00	7,280.47	0.09 S	391.09 E	482,682.59	548,064.85	0.00	0.00	0.00	
7,400.00	5.00	90.00	7,380.09	0.09 S	399.80 E	482,682.59	548,073.56	0.00	0.00	0.00	•
7,500.00			7,479.70	0.09 S	408.52 E	482,682.59	548,082.28	0.00	0.00	0.00	
7,600.00			7,579.32		417.23 E	482,682.59	548,090.99	0.00	0.00	0.00	
7,700.00		90.00	7,678.94	0.09 S	425.95 E	482,682.59	548,099.71	0.00	0.00	0.00	
7,800.00	5.00	90.00	7,778.56	0.09 S	434.67 E	482,682.59	548,108.43	0.00	0.00	0.00	
7,900.00	5.00	90.00	7,878.18	0.09 S	443.38 E	482,682.59	548,117.14	0.00	0.00	0.00	
8,000.00			7,977.80		452.10 E	482,682.59	548,125.86	0.00	0.00	0.00	
8,100.00			8,077.42		460.81 E	482,682.59	548,134.57	0.00	0.00	0.00	Begin Drop
8,200.00			8,177.17	0.09 S	467.79 E	482,682.59	548,141.55	2.00	0.00	180.00	
8,300.00		90.00	8,277.11	0.09 S	471.28 E	482,682.59	548,145.04	2.00	0.00	180.00	
8,350.00		0.00	8,327.10	0.09 S	471.71 E	482,682.59	548,145.47	2.00	0.00	-180.00	Hold Vertical
8,400.00			8,377.10		471.71 E	482,682.59	548,145.47	0.00	0.00	0.00	
8,500.00			8,477.10		471.71 E	482,682.59	548,145.47	0.00	0.00	0.00	
8,600.00		0.00	8,577.10	0.09 S	471.71 E	482,682.59	548,145.47	0.00	0.00	0.00	
8,700.00	0.00	0.00	8,677.10	0.09 S	471.71 E	482,682.59	548,145.47	0.00	0.00	0.00	
8,800.00	0.00	0.00	8,777.10	0.09 S	471.71 E	482,682.59	548,145.47	0.00	0.00	0.00	
8,816.90		0.00	8,794.00	0.09 S	471.71 E	482,682.59	548,145.47	0.00	0.00	0.00	KOP, Begin Build
8,850.00		90.00	8,827.09	0.09 S	472.67 E	482,682.59	548,146.43	10.00	0.00	90.00	
8,900.00		90.00	8,876.81	0.09 S	477.73 E	482,682.59	548,151.49	. 10.00	0.00	0.00	
8,950.00	13.31	90.00	8,925.91	0.09 S	487.11 E	482,682.59	548,160.87	10.00	0.00	0.00	
9,000.00	18.31	90.00	8,974.00	0.09 S	500.72 E	482,682.59	548,174.48	10.00	0.00	0.00	
9,050.00	23.31	90.00	9,020.73	0.09 S	518.48 E	482,682.59	548,192.24	10.00	0.00	0.00	
9,100.00	28.31	90.00	9,065.72	0.09 S	540.24 E	482,682.59	548,214.00	10.00	0.00	0.00	
9,150.00	33.31	90.00	9,108.65	0.09 S	565.85 E	482,682.59	548,239.61	10.00	0.00	0.00	
9,200.00	38.31	90.00	9,149.19	0.09 S	595.09 E	482,682.59	548,268.85	10.00	0.00	0.00	
9,250.00	43.31	90.00	9,187.02	0.09 S	627.76 E	482,682.59	548,301.52	10.00	0.00	0.00	
9,300.00	48.31	90.00	9,221.86	0.09 S	663.60 E	482,682.59	548,337.36	10.00	0.00	0.00	
9,350.00	53.31	90.00	9,253.45	0.09 S	702.34 E	482,682.59	548,376.10	10.00	0.00	0.00	
9,400.00	58.31	90.00	9,281.53	0.09 S	743.69 E	482,682.59	548,417.45	10.00	0.00	0.00	
9,450.00	63.31	90.00	9,305.91	0.09 S	787.32 E	482,682.59	548,461.08	10.00	0.00	0.00	
9,500.00	68.31	90.00	9,326.39	0.09 S	832.92 E	482,682.59	548,506.68	10.00	0.00	0.00	
9,516.90	70.00	90.00	9,332.40	0.09 S	848.71 E	482,682.59	548,522.47	10.00	0.00	0.00	Begin Build & Turn
9,550.00	70.07	86.48	9,343.71	0.87 N	879.80 E	482,683.55	548,553.56	10.00	0.96	-89.44	•
9,600.00	70.30	81.17	9,360.67	5.93 N	926.55 E	482,688.61	548,600.31	10.00	6.02	-88.23	
9,650.00	70.69	75.88	9,377.38	15.30 N	972.72 E	482,697.98	548,646.48	10.00	15.39	-86.43	

Measured		Grid	Vertical	Local Cod	ordinates	Map Coor	dinates	Dogleg	Vertical	Toolface	
	Inclination (°)		Depth (usft)	Northing (usft)	Easting (usft)	Northing (usft)	Easting (usft)	Rate (°/100usft)	Section (usft)	Angle (°)	Comments
9,700.00	71.23	70.62	9,393.70	28.92 N	1,017.95 E	482,711.60	548,691.71	10.00	29.01	-84.67	
9,750.00		65.40	9,409.52	46.68 N	1,061.92 E	482,729.36	548,735.68	10.00	46.77	-82.95	
9,800.00	72.74	60.23	9,424.71	68.44 N	1,104.28 E	482,751.12	548,778.04	10.00	68.53	-81.30	
9,850.00	73.69	55.10	9,439.15	94.04 N	1,144.70 E	482,776.72	548,818.46	10.00	94.13	-79.73	
9,900.00	74.77	50.03	9,452.75	123.28 N	1,182.89 E	482,805.96	548,856.65	10.00	123.37	-78.24	
9,950.00	75.96	45.01	9,465.38	155.95 N	1,218.55 E	482,838.63	548,892.31	10.00	156.04	-76.86	
10,000.00		40.04	9,476.97	191.79 N	1,251.41 E	482,874.47	548,925.17	10.00	191.88	-75.60	
10,050.00		35.13	9,487.41	230.53 N	1,281.22 E	482,913.21	548,954.98	10.00	230.62	-74.45	
10,100.00		30.26	9,496.64	271.87 N	1,307.76 E	482,954.55	548,981.52	10.00	271.96	-73.42	
10,150.00	81.64	25.44	9,504.57	315.51 N	1,330.81 E	482,998.19	549,004.57	10.00	315.60	-72.52	
10,200.00	83.23	20.66	9,511.16	361.10 N	1,350.21 E	483,043.78	549,023.97	10.00	361.19	-71.76	
10,250.00		15.91	9,516.34		1,365.81 E	483,090.98	549,039.57	10.00	408.39	-71.13	
10,300.00		11.19	9,520.08	456.76 N	1,377.48 E	483,139.44	549,051.24	10.00	456.85	-70.63	
10,350.00		6.48	9,522.36	506.10 N	1,385.15 E	483,188.78	549,058.91	10.00	506.19	-70.28	
10,400.00	89.95	1.78	9,523.14	555.95 N	1,388.75 E	483,238.63	549,062.51	10.00	556.04	-70.07	
10,413.12		0.55	9,523.10	569.07 N	1,389.02 E	483,251.75	549,062.78	10.00	569.16	-69.99	Landing Point
10,500.00		0.55	9,522.50	655.94 N	1,389.85 E	483,338.62	549,063.61	0.00	656.03	0.00	
10,600.00	90.40	0.55	9,521.80	755.93 N	1,390.80 E	483,438.61	549,064.56	0.00	756.02	0.00	
10,700.00	90.40	0.55	9,521.10	855.92 N	1,391.76 E	483,538.60	549,065.52	0.00	856.01	0.00	
10,800.00	90.40	0.55	9,520.40	955.92 N	1,392.71 E	483,638.60	549,066.47	0.00	956.01	0.00	
10,900.00	90.40	0.55	9,519.70	1,055.91 N	1,393.67 E	483,738.59	549,067.43	0.00	1,056.00	0.00	
11,000.00		0.55		1,155.90 N		483,838.58	549,068.38	0.00	1,155.99	0.00	
11,100.00		0.55	9,518.30	1,255.90 N	1,395.57 E	483,938.58	549,069.33	0.00	1,255.99	0.00	
11,200.00		0.55	9,517.60	1,355.89 N	1,396.53 E	484,038.57	549,070.29	0.00	1,355.98	0.00	
11,300.00	90.40	0.55	9,516.91	1,455.88 N	1,397.48 E	484,138.56	549,071.24	0.00	1,455.97	0.00	
11,400.00	90.40	0.55	9,516.21	1,555.88 N	1,398.44 E	484,238.56	549,072.20	0.00	1,555.97	0.00	
11,500.00				1,655.87 N		484,338.55	549,073.15	0.00	1,655.96	0.00	
11,600.00		0.55	9,514.81	1,755.86 N	1,400.35 E	484,438.54	549,074.11	0.00	1,755.95	0.00	
11,700.00	90.40	0.55	9,514.11	1,855.85 N	1,401.30 E	484,538.53	549,075.06	0.00	1,855.94	0.00	
11,800.00	90.40	0.55	9,513.41	1,955.85 N	1,402.26 E	484,638.53	549,076.02	0.00	1,955.94	0.00	
11,900.00	90.40	0.55	9,512.71	2,055.84 N	1,403.21 E	484,738.52	549,076.97	0.00	2,055.93	0.00	
12,000.00				2,155.83 N		484,838.51	549,077.93	0.00	2,155.92	0.00	
12,100.00		0.55		2,255.83 N		484,938.51	549,078.88	0.00	2,255.92	0.00	
12,200.00	90.40	0.55	9,510.62	2,355.82 N	1,406.08 E	485,038.50	549,079.84	0.00	2,355.91	0.00	
12,300.00		0.55	9,509.92	2,455.81 N	1,407.03 E	485,138.49	549,080.79	0.00	2,455.90	0.00	
12,400.00	90.40	0.55	9,509.22	2,555.81 N	1,407.99 E	485,238.49	549,081.75	0.00	2,555.90	0.00	

Measured		Grid	Vertical	Local Cod	ordinates	Map Coor	dinates	Dogleg	Vertical	Toolface	
Depth (usft)	Inclination (°)		Depth (usft)	Northing (usft)	Easting (usft)	Northing (usft)	Easting (usft)	Rate (°/100usft)	Section (usft)	Angle (°)	Comments
12,500.00		0.55	9,508.52	2,655.80 N		485,338.48	549,082.70	0.00	2,655.89	0.00	
12,600.00		0.55	9,507.82	2,755.79 N	1,409.90 E	485,438.47	549,083.66	0.00	2,755.88	0.00	
12,700.00	90.40	0.55	9,507.12	2,855.78 N	1,410.85 E	485,538.46	549,084.61	0.00	2,855.87	0.00	
12,800.00	90.40	0.55	9,506.42	2,955.78 N	1,411.81 E	485,638.46	549,085.57	0.00	2,955.87	0.00	
12,900.00	90.40	0.55	9,505.72	3,055.77 N	1,412.76 E	485,738.45	549,086.52	0.00	3,055.86	0.00	
13,000.00	90.40	0.55	9,505.02	3,155.76 N	1,413.72 E	485,838.44	549,087.48	0.00	3,155.85	0.00	
13,100.00		0.55	9,504.33	3,255.76 N	1,414.67 E	485,938.44	549,088.43	0.00	3,255.85	0.00	
13,200.00	90.40	0.55	9,503.63	3,355.75 N	1,415.63 E	486,038.43	549,089.39	0.00	3,355.84	0.00	
13,300.00		0.55	9,502.93	3,455.74 N	1,416.58 E	486,138.42	549,090.34	0.00	3,455.83	0.00	
13,400.00	90.40	0.55	9,502.23	3,555.74 N	1,417.54 E	486,238.42	549,091.30	0.00	3,555.83	0.00	
13,500.00	90.40	0.55	9,501.53	3,655.73 N	1,418.49 E	486,338.41	549,092.25	0.00	3,655.82	0.00	
13,600.00		0.55	9,500.83	3,755.72 N	1,419.45 E	486,438.40	549,093.21	0.00	3,755.81	0.00	
13,700.00		0.55	9,500.13	3,855.71 N	1,420.40 E	486,538.39	549,094.16	0.00	3,855.80	0.00	
13,800.00		0.55	9,499.43	3,955.71 N	1,421.36 E	486,638.39	549,095.12	0.00	3,955.80	0.00	•
13,900.00		0.55	9,498.73	4,055.70 N	1,422.31 E	486,738.38	549,096.07	0.00	4,055.79	0.00	
14,000.00		0.55	9,498.04	4,155.69 N	1,423.27 E	486,838.37	549,097.03	0.00	4,155.78	0.00	
14,100.00		0.55		4,255.69 N		486,938.37	549,097.98	0.00	4,255.78	0.00	
14,200.00		0.55	9,496.64	4,355.68 N	1,425.18 E	487,038.36	549,098.94	0.00	4,355.77	0.00	
14,300.00		0.55	9,495.94	4,455.67 N	1,426.13 E	487,138.35	549,099.89	0.00	4,455.76	0.00	
14,400.00		0.55	9,495.24	4,555.67 N	1,427.09 E	487,238.35	549,100.85	0.00	4,555.76	0.00	
14,500.00		0.55	9,494.54	4,655.66 N	1,428.04 E	487,338.34	549,101.80	0.00	4,655.75	0.00	
14,600.00		0.55	9,493.84	4,755.65 N	1,429.00 E	487,438.33	549,102.76	0.00	4,755.74	0.00	
14,700.00		0.55	9,493.14	4,855.64 N	1,429.95 E	487,538.32	549,103.71	0.00	4,855.73	0.00	
14,800.00		0.55	9,492.44	4,955.64 N	1,430.91 E	487,638.32	549,104.67	0.00	4,955.73	0.00	
14,900.00	90.40	0.55	9,491.75	5,055.63 N	1,431.86 E	487,738.31	549,105.62	0.00	5,055.72	0.00	
15,000.00		0.55	9,491.05	5,155.62 N	1,432.82 E	487,838.30	549,106.58	0.00	5,155.71	0.00	
15,100.00		0.55	9,490.35	5,255.62 N	1,433.77 E	487,938.30	549,107.53	0.00	5,255.71	0.00	
15,200.00		0.55		5,355.61 N	_	488,038.29	549,108.49	0.00	5,355.70	0.00	·
15,300.00		0.55	9,488.95	5,455.60 N	1,435.68 E	488,138.28	549,109.44	0.00	5,455.69	0.00	
15,400.00		0.55	9,488.25	5,555.60 N	1,436.64 E	488,238.28	549,110.40	0.00	5,555.69	0.00	
15,500.00		0.55	9,487.55	5,655.59 N	1,437.59 E	488,338.27	549,111.35	0.00	5,655.68	0.00).
15,600.00		0.55		5,755.58 N		488,438.26	549,112.31	0.00	5,755.67	0.00	
15,700.00		0.55		5,855.57 N		488,538.25	549,113.26	0.00	5,855.66	0.00	
15,800.00		0.55		5,955.57 N		488,638.25	549,114.22	0.00	5,955.66	0.00	
15,900.00		0.55	9,484.76	6,055.56 N	1,441.41 E	488,738.24	549,115.17	0.00	6,055.65	0.00	
16,000.00		0.55	,	6,155.55 N		488,838.23	549,116.13	0.00	6,155.64	0.00	
16,100.00		0.55		6,255.55 N		488,938.23	549,117.08	0.00	6,255.64	0.00	·

HALLIBURTON

Plan Report for WCB 6H - Plan 1

	-	Grid	Vertical	Local Cod	ordinates	Map Coord	dinates	Dogleg	Vertical	Toolface	
Measured Depth (usft)	Inclination (°)		Depth (usft)	Northing (usft)	Easting (usft)	Northing (usft)	Easting (usft)	Rate (°/100usft)	Section (usft)	Angle (°)	Comments
16,200.00		0.55		6,355.54 N		489,038.22	549,118.04	0.00	6,355.63	0.00	
16,300.00		0.55		6,455.53 N		489,138.21	549,118.99	0.00	6,455.62	0.00	
				6,555.53 N		489,238.21	549,119.95	0.00	6.555.62	0.00	
16,400.00		0.55		6,655.52 N		489,338.20	549,120.90	0.00	- * *	0.00	
16,500.00		0.55				489,438.19	549,121.86			0.00	
16,600.00		0.55		6,755.51 N		489,538.18	549,122.81	0.00	•	0.00	
16,700.00		0.55		6,855.50 N		489,638.18	549,123.77	0.00		0.00	
16,800.00	90.40	0.55		6,955.50 N							
16,900.00	90.40	0.55	,	7,055.49 N		489,738.17	549,124.72		7,055.58	0.00	
17,000.00	90.40	0.55		7,155.48 N		489,838.16	549,125.68		7,155.57	0.00	
17,100.00	90.40	0.55	9,476.37	7,255.48 N	1,452.87 E	489,938.16	549,126.63		7,255.57	0.00	
17,200.00	90.40	0.55	9,475.67	7,355.47 N	1,453.83 E	490,038.15	549,127.59			0.00	
17,300.00	90.40	0.55	9,474.97	7,455.46 N	1,454.78 E	490,138.14	549,128.54	0.00	7,455.55	0.00	
17,400.00	90.40	0.55	9,474.27	7,555.46 N	1,455.74 E	490,238.14	549,129.50	0.00	7,555.55	0.00	
17,500.00		0.55	9,473.57	7,655.45 N	1,456.69 E	490,338.13	549,130.45	0.00	7,655.54	0.00	
17,600.00				7,755.44 N	1,457.65 E	490,438.12	549,131.41	0.00	7,755.53	0.00	
17,700.00		0.55	9,472.18	7,855.43 N	1,458.60 E	490,538.11	549,132.36	0.00	7,855.52	0.00	
17,800.00			9,471.48	7,955.43 N	1,459.56 E	490,638.11	549,133.32	0.00	7,955.52	0.00	
17,900.00				8,055.42 N		490,738.10	549,134.27	0.00	8,055.51	0.00	
18,000.00			•	8,155.41 N		490,838.09	549,135.23	0.00	8,155.50	0.00	
18,100.00				8,255.41 N		490,938.09	549,136.18	0.00	8,255.50	0.00	
18,200.00				8,355.40 N		491,038.08	549,137.14		8,355.49	0.00	
18,300.00				8,455.39 N		491,138.07	549,138.09		8,455.48	0.00	
18,400.00				8,555.39 N		491,238.07	549,139.05	0.00	8,555.48	0.00	
18,500.00				8,655.38 N		491,338.06	549,140.00		8,655.47	0.00	
18,600.00				8,755.37 N		491,438.05	549,140.96	0.00	8,755.46	0.00	
18,700.00				8,855.36 N		491,538.04	549,141.91	0.00	8,855.45	0.00	
18,800.00				8,955.36 N		491,638.04	549,142.87	0.00	8,955.45	0.00	
				9.055.35 N		491,738.03	549,143.82		9,055.44	0.00	
18,900.00			. ,	9,055.35 N 9,155.34 N		491,838.02	549,144.78			0.00	
19,000.00				9,155.34 N 9,255.34 N		491,938.02	549,145.73			0.00	
19,100.00			•	9,255.34 N 9,355.33 N		492,038.01	549,146.69			0.00	
19,200.0						492,138.00	549,147.64			0.00	
19,300.0				9,455.32 N						0.00	
19,400.0				9,555.32 N		492,238.00	549,148.60		•	0.00	
19,500.0				9,655.31 N		492,337.99	549,149.55			0.00	
19,600.0				9,755.30 N		492,437.98	549,150.51				
19,700.0			. ,	9,855.29 N		492,537.97	549,151.46			0.00	
19,800.0	90.40	0.55	9,457.50	9,955.29 N	1,478.66 E	492,637.97	549,152.42	0.00	9,955.38	0.00	

HALLIBURTON

Plan Report for WCB 6H - Plan 1

Measured Depth (usft)	Inclination (°)	Grid Azimuth (°)	Vertical Depth (usft)	Local Coc Northing (usft)	ordinates Easting (usft)	Map Coord Northing (usft)	linates Easting (usft)	Dogleg Rate (°/100usft)	Vertical Section (usft)	Toolface Angle (°)	Comments
19,900.00	90.40	0.55	9,456.80	010,055.28 N	1,479.61 E	492,737.96	549,153.37	0.00	10,055.37	0.00	•
20,000.00	90.40	0.55	9,456.10)10,155.27 N	1,480.57 E	492,837.95	549,154.33	0.00	10,155.36	0.00	
20,086.11	90.40	0.55	9,455.50	010,241.38 N	1,481.39 E	492,924.06	549,155.15	0.00	10,241.47	0.00	TD at 20086.11' MD

Plan Annotations

Measured	Vertical	Local Coor	dinates	
Depth (usft)	Depth (usft)	+N/-S (usft)	+E/-W (usft)	Comment
2,000.00	2,000.00	-0.09	-59.95	Begin Build
2,250.00	2,249.68	-0.09	-49.05	Hold
8,100.00	8,077.42	-0.09	460.81	Begin Drop
8,350.00	8,327.10	-0.09	471.71	Hold Vertical
8,816.90	8,794.00	-0.09	471.71	KOP, Begin Build
9,516.90	9,332.40	-0.09	848.71	Begin Build & Turn
10,413.12	9,523.10	569.07	1,389.02	Landing Point
20,086.11	9,455.50	10,241.38	1,481.39	TD at 20086.11' MD

Vertical Section Information

Angle			Origin	Orig	gin	Start
Туре	Target	Azimuth (°)	Туре	+N/_S (usft)	+E/-W (usft)	TVD (usft)
User	No Target (Freehand)	0.00	Slot	-0.09	-59.95	0.00

Survey tool program

From	To		Survey/Plan	Survey Tool
(usft)	(usft)			
0.00	20.086.11	Plan 1		MWD

Casing Details

Measured Depth (usft)	Vertical Depth (usft)		Name	Casing Diameter (")	Hole Diameter (")
2,501.27	2,500.00	13 3/8"		13-3/8	17-1/2

Plan Report for WCB 6H - Plan 1

Formation I	Details
-------------	---------

Measured Depth (usft)	Vertical Depth (usft)	TVDSS (usft)	Name	Lithology	Dip (°)	Dip Direction (°)
1,840.50	1,840.50	-1,550.00	Delaware Mtn Gr		-0.40	0.55
4,983.20	4,972.50	1,582.00	Bone Spring		-0.40	0.55
5,946.86	5,932.50	2,542.00	1st Bone Spring SS		-0.40	0.55
6,382.52	6,366.50	2,976.00	2nd Bone Spring SS		-0.40	0.55
8,188.27	8,165.50	4,775.00	3rd Bone Spring SS		-0.40	0.55
8,579.36	8,556.50	5,166.00	Wolfcamp		-0.40	0.55
8,691.36	8,668.50	5,278.00	Wolfcamp A		-0.40	0.55
8,986.84	8,961.50	5,571.00	Wolfcamp B		-0.40	0.55
9,438.07	9,300.50	5,910.00	Wolfcamp B1		-0.40	0.55

Design Targets

Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (usft)	+N/-S (usft)	+E/-W (usft)	Northing (usft)	Easting (usft)	Latitude	Longitude
Bodacious 5-32 Fe	d Com W	СВ 6Н РВ	HL ()						
	0.00	0.00	0.00	10,241.38	1,481.39	492,924.06	549,155.15	32° 21' 18.419 N	104° 18' 28.858 W
- plan misses tar - Point	get center	by 9455.5	50usft at 2008	6.11usft MD (9455.50 TVD,	10241.38 N, 1481.39 E			
Bodacious 5-32 Fe	d Com Wo	CB 6H LP	(Plat) ()						
	0.00	0.00	0.00	100.95	1,383.35	482,783.63	549,057.11	32° 19' 38.070 N	104° 18' 30.028 W
- plan misses tar - Point	get center	by 1446.8	33usft at 0.00u	usft MD (0.00	TVD, -0.09 N,	-59.95 E)			

Directional Difficulty Index

Average Dogleg over Survey:

0.84 °/100usft

Maximum Dogleg over Survey:

10.00 °/100usft at 10,413.12 usft

Net Tortousity applicable to Plans:

0.84 °/100usft

Directional Difficulty Index:

6.797

Audit Info

HALLIBURTON

North Reference Sheet for Bodacious 5-32 Fed Com - WCB 6H - Wellbore #1

All data is in US Feet unless otherwise stated. Directions and Coordinates are relative to Grid North Reference.

Vertical Depths are relative to GE 3364.50 + 26 @ 3390.50usft (Latshaw 17). Northing and Easting are relative to Bodacious 5-32 Fed Com

Coordinate System is US State Plane 1983, New Mexico Eastern Zone using datum North American Datum 1983, ellipsoid GRS 1980

Projection method is Transverse Mercator (Gauss-Kruger)

Central Meridian is 104° 20' 0.000 W°, Longitude Origin:0° 0' 0.000 E°, Latitude Origin:0° 0' 0.000 N°

False Easting: 541,337.50usft, False Northing: 0.00usft, Scale Reduction: 0.99990914

Grid Coordinates of Well: 482,682.59 usft N, 547,613.81 usft E


Geographical Coordinates of Well: 32° 19' 37.07" N, 104° 18' 46.85" W

Grid Convergence at Surface is: 0.01°

Based upon Minimum Curvature type calculations, at a Measured Depth of 20,086.11usft

the Bottom Hole Displacement is 10,356.81usft in the Direction of 8.56° (Grid).

Magnetic Convergence at surface is: -7.24° (26 July 2018, , BGGM2018)



Magnetic Model: BGGM2018

Date: 26-Jul-18
Declination: 7.25°

Inclination/Dip: 59.97° Field Strength: 47868

Grid North is 0.01° East of True North (Grid Convergence) Magnetic North is 7.25° East of True North (Magnetic Declination) Magnetic North is 7.24° East of Grid North (Magnetic Convergence)

To convert a True Direction to a Grid Direction, Subtract 0.01°
To convert a Magnetic Direction to a True Direction, Add 7.25° East
To convert a Magnetic Direction to a Grid Direction, Add 7.24°



Installation Procedure Prepared For:

Chisholm Energy 13-3/8" x 9-5/8" x 5-1/2" 5/10M MBU-3T Wellhead System With CTH-HPS-F MOD Tubing Head

Publication # IP0571


May, 2017

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC .


Table of Contents

	System Drawing	1
	Bill of Materials	2
Stage 1 —	Install the MBU-3T Housing	5
Stage 2 —	Nipple Up The BOP Stack	
Stage 3 —	Test the BOP Stack	
Stage 4 —	Run the Lower Wear Bushing	8
	Retrieve the Wear Bushing After Drilling	
Stage 5 —	Hang Off the 9-5/8" Casing Running the 13-5/8" Wash Tool	 9 15
Stage 5A —	Hang Off the 9-5/8" Casing (Emergency)	16
Stage 6 —	Install the MBU-3T Mandrel Hanger Packoff	18
_	Landing the Packoff	20
	Seal Test ————————————————————————————————————	
	Engaging the Lockring————————————————————————————————————	21
Ctomo CA	In a full the MADIL 2T Engage and Declar	22
Stage 6A —	Install the MBU-3T Emergency Packoff	∠J 25
1	Seal Test	25 26
	Engaging the Lockring————————————————————————————————————	
Stage 7 —	Test the BOP Stack	27
Stage 8 —	Run the Upper Wear Bushing	28
	Run the Wear Bushing Before Drilling	28
	Retrieve the Wear Bushing After Drilling	
Stage 9 —	Hang Off the 5-1/2" Casing	29
Stage 10 —	Install the 'Quick Connect' TA Cap Assembly Connection Test	31
Stage 11 —	Remove the TA Cap Assembly	33
Stage 12 —	Install the Tubing Head	
	Seal Test	36
	Flange Test	37
	Recommended Procedure for Field Welding Pipe to	
	Wellhead Parts for Pressure Seal	38

System Drawing

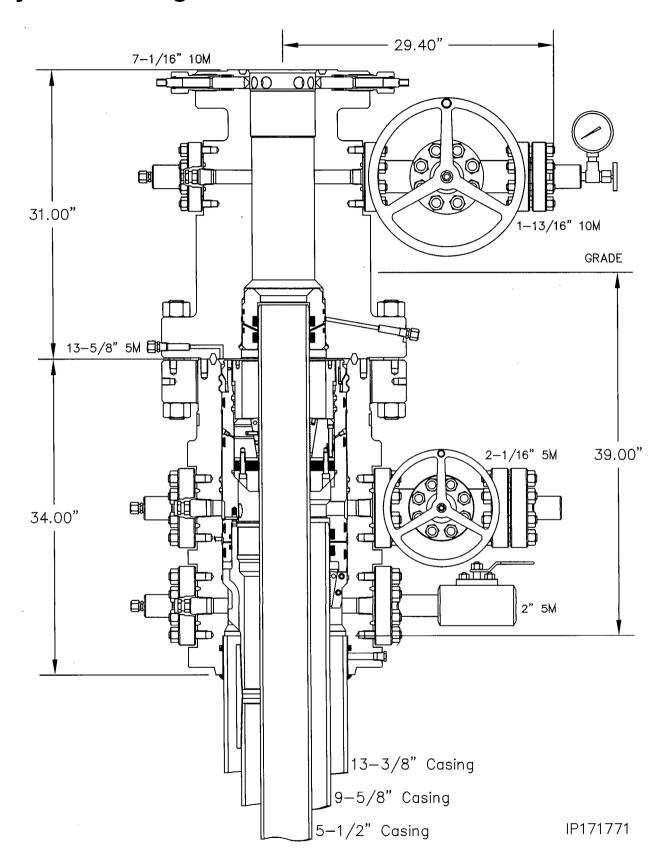

Bill of Materials

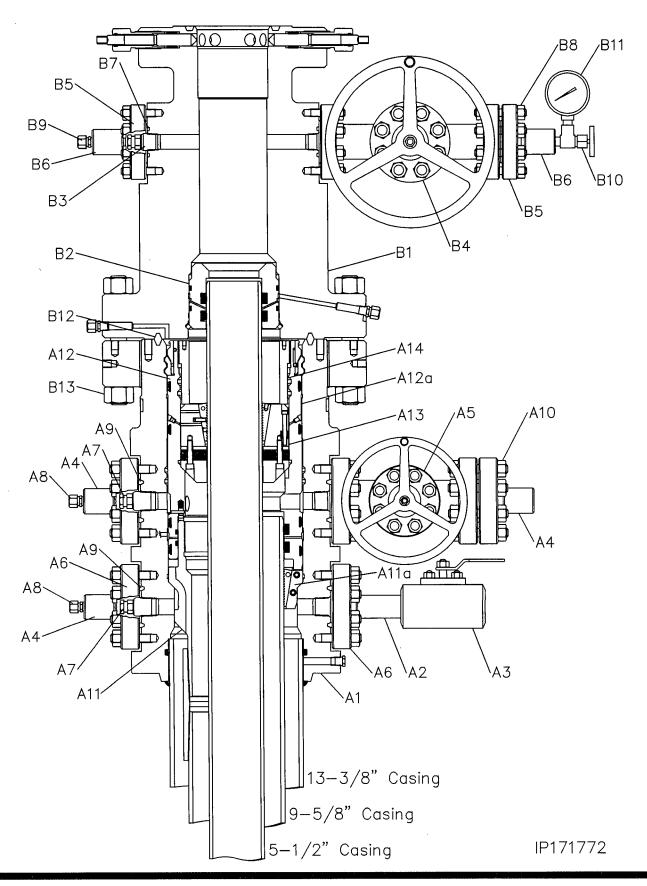



V	BU-	MBU-3T HOUSING ASSEMBLY							
tem	Qty	Description							
A1	1	Housing, CW, MBU-3T, 13.5/8" 5M x 13-3/8" SOW, with two 2-1/16" 5M studded upper and lower outlets with o-ring, 6A-PU-AA-1-2 Part # 117620							
A2	1	Nipple, 2" line pipe x 6" long Part # NP6A							
А3	1	Ball Valve, TV, 2" RP, 5M x 2" LP, WCB body SS trim, Delrin seats, HNBR seals, nace with locking handle Part # 115184							
A4	3	Bull Plug, 2" line pipe x 1/2" line pipe, 4130 60K Part # BP2T							
A5	1	Gate valve, CW1, 2-1/16' 3/5M, flanged end, handwheel operated, AA/DD-NL trim, (6A-LU-AA/DD-NL-1-2) Part # 610003							
A 6	4	Companion Flange, 2-1/16" 5M x 2" line pipe, 4130 CMS-102 CMS-002 Part # 200002							
A7	2	VR Plug, 1-1/2" Sharp Vee x 1-1/4" hex Part # VR2							
A8	2	Fitting, grease, vented cap, 1/2' NPT alloy non-nace Part # FTG1							
A9	5	Ring Gasket, R-24, 2-1/16 3/5M Part # R24							
A10	8	Studs, all thread with two nuts black, 7/8" x 6-1/2" long, B7/2H Part # 780067							
		1							
		:							
		· ·							
		•							

MBU-	3T HOUSING ASSEMBLY
Item Qty	Description
A11 1	Casing Hanger, CW, MBU3T-LWR-TP, fluted, 13-5/8" x 9-5/8" (40#) LC bottom x 10.250" 4 Stub Acme 2G RH box top, with 11-1/2" OD neck, 6A-U-AA-1-2 Part # 120251
A12 1	Packoff, CW, MBU-3T, Mandrel, 13-5/8" nested x 11" with 11.250" 4 Stub Acme 2G LH box top, 1/8" NPT test ports, 6A-U-AA-1-1 Part # 117152
A13 1	Casing Hanger, C2, 11" x 5-1/2" Part # 108067
A14 1	Hold Down Ring, for C2 hanger, 11" x 7 through 4-1/2", arranged for packoff MBU-3T, 13-5/8" with 11.250" 4 Stub Acme 2G LH pin x 9.06" ID x 6.25" long, with 2.12" thread length, 4140 110K Part # 117418

TUBING HEAD ASSEMBLY				
Item	Qty	Description		
B1	1	Tubing Head, CW, CTH-HPS-F, 9" (MOD), 13-5/8" 5M x 7-1/16" 10M, with two 1-13/16" 10M studded outlets, round bar, 17-4PH lockscrews, 6A-PU-EE-0,5-2-1 Part #		
B2	1	Secondary Seal, CW, HPS-F, 9 MOD x 5-1/2", 6A-PU-DD-NL-1-2 Part # 110503		
В3	1	VR Plug, 1-1/4" Sharp Vee x 1-1/4" hex Part # VR1		
B4	1	Gate valve, AOZE, 1-13/16" 10M, flanged end, handwheel operated, EE-0,5 trim, (6A-LU-EE-0,5-3-1) Part # 103188		
B5	2	Companion Flange, 1-13/16" 10M x 2" LP, 5000 psi max WP, 6A-KU-EE-NL-1 Part # 200010		
В6	2	Bull Plug, 2" line pipe x 1/2" line pipe, 4130 60K Part # BP2T		
B7	3	Ring Gasket, BX151, 1-13/16* 10M Part#BX-151		
B8	8	Studs, all thread with two nuts, black, 3/4" x 5-1/2" long, B7/2H Part # 780080		
B9	1	Fitting, grease, vented cap, 1/2* NPT alloy non-nace Part # FTG1		
B10	1	Needle Valve, MFA, 1/2" NPT 10M service Part # NVA		
B11	1	Pressure Gauge, 5M, 4-1/2° face, liquid filled, 1/2° NPT PG5M		
B12	1	Ring Gasket, BX-160, 13-5/8" 15M Part # BX-160		
B13	116	Studs, all thread with two nuts, black, 1-5/8" x 12-3/4" long, B7//2H Part # 780087		



REC	СОМ	MENDED SERVICE TOOLS
Item		Description
ST1	1	Test Plug/Retrieving Tool, CW, 13-5/8" x 4-1/2" IF (NC-50), 1-1/4" LP bypass and spring loaded lift dogs Part # 104467
ST2	1	Wear Bushing, CW, MBU-3T-LWR, 13-5/8" x 12.31" ID x 27.0" long with 3/8" o-ring Part # 116974
ST3	1	Casing Hanger Running Tool, CW, MBU-3T-LR-TP, 13-5/8" x 9-5/8" LC box top x 10.250" 4 Stub Acme 2G RH pin bottom, max load capacity 1000K, max torque 18000 ft-lbs. spec for rotating casing Part # 105845
ST4	1	Torque Collar, CW, for use with running tool, TP, 10.250 4 stub Acme 2G RH pin bottom and arranged for 11.50" OD x 5.00" long box hanger neck, maximum torque 18,000 ft-lbs Part # 118906
ST5	1	Wash Tool, CW, Casing Hanger, MBU-LR/MBS2, fluted, 13-5/8" x 4-1/2" IF (NC-50) box top threads, with brushes Part # 106277
ST6	1	Packoff Running Tool, CW, MBU-3T UPR, 13-5/8" nested, with 11.250" 4 Stub Acme 2G LH pin bottom x 4-1/2" IF (NC-50) box top with seal sleeve Part # 117310
ST7	1	Test Plug, CW, MBU-2LR Inner, 11" x 4-1/2" IF, 1-1/4" LP bypass Part # 108848
ST8	1	Wear Bushing, MBU-3T-UPR, nested, 13-5/8" x 11" x 9.00" I.D. x 20.0" long, arranged for 13-5/8" tool Part # 117158

RENTAL EQUIPMENT				
tem C	lty	Description		
R1	1	Threaded Hub, CW, MBU-3T, 13-5/8" 5M With 19.000" 2 Stub Acme-2G Left Hand Box Thread Part # 117268		
R2	1	Drilling Adapter, CW, MBU-3T, 13-5/8" 5M Quick Connect Bottom x 13-5/8" 5M Studded Top, Temp Rating PU Part # 117278		
R3	1	TA Cap, CW, MBU-3T-HPS, 13-5/8" 5M quick connect, with one 2" LPO & 1/2" NPT port, with 1/2" NPT needle valve and 2" LP nipple and valve, 6A-U-AA-1-1 Part # 117317		
	1	Secondary Seal Bushing, CW, HPS, 9" x 5-1/2 Part # 109026		
R4	4	Lift Eyes, 3/4", side pull hoist ring Part # 115542		

EMERGENCY EQUIPMENT				
Item Qty	Description			
A11a 1	Casing Hanger, CW, MBU-3T, 13-5/8" x 9-5/8" 6A-PU-DD-3-1 Part # 116998			
A12a 1	Packoff, CW, MBU-3T, Emergency, 13-5/8" nested x 11" with 11.250" 4 Stub Acme 2G LH box top, 1/8" NPT test ports, 6A-U-AA-1-1 Part # 117184			

Stage 1 — Install the MBU-3T Housing


- Run the conductor and 13-3/8" surface casing to the required depth and cement as required.
- Cut the conductor pipe off level with the cellar floor.
- 3. Final cut the 13-3/8" surface casing at 39.00" below ground level (grade). Ensure the cut is level and square with the horizon.
- 4. Place an 3/16" x 3/8" bevel on the OD of the stub.

Note: The slip on and weld preparation is 4.25" in depth.

- 5. Examine the 13-5/8" 5M x 13-3/8" SOW x 19.00" 2 Stub Acme LH (Left Hand Thread) | MBU-3T Wellhead Housing (Item A1). Verify the following:
 - internal bore is clean and in good condition
 - external Acme thread is clean and in good condition
 - thread flange is in place and rotates freely

valves are intact and in good condition

- weld socket is clean and free of grease and debris and o-ring is in place and in good condition
- Align and level the Wellhead Assembly over the casing stub, orienting the outlets so they will be compatible with the drilling equipment.
- 7. Remove the pipe plug from the port on the bottom of the Head.
- Slowly and carefully lower the assembly over the casing stub, weld and test the MBU-3T wellhead to the surface casing.
- Replace the pipe plug in the port on the bottom of the wellhead.

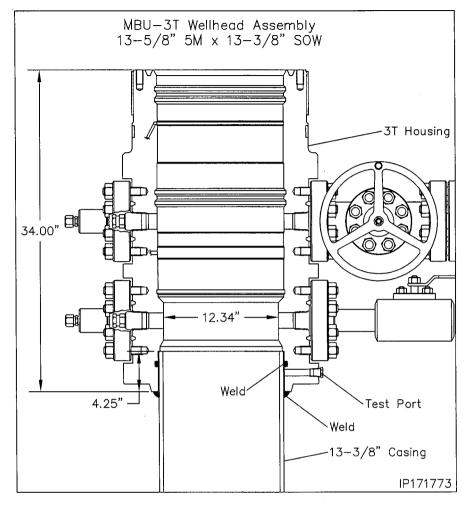

Note: The weld should be a fillet-type weld with legs no less than the wall thickness of the casing. Legs of 1/2" to 5/8" are adequate for most jobs.

Refer to the back of this publication for the Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal and for field testing of the weld connection.





Stage 2 — Nipple Up The BOP Stack

- Examine the 13-5/8" 5M x 19.00"
 4 Stub Acme Threaded Hub (Item R1). Verify the following:
 - Acme thread are clean and in good condition
 - remove the (4) retainer set screws an place them in a safe place
- 2. Thoroughly clean and lightly lubricate the mating threads of the housing and the Thread Hub with Copper Coat or Never Seize.
- Pick up the Hub and carefully thread it onto the top of the housing with counter clockwise rotation until the top of the ring is approximately a 1/4" below the top of the housing.
- 4. Position the hub gage ring on top of the housing with the counter bore down as indicated. Ensure the gage ring is level and straight.
- 5. Rotate the Hub clockwise (UP) until it contacts the gage ring.

WARNING: Do not off seat the gage ring.

- Locate the retainer screw holes in the threaded hub.
- 7. Rotate the Hub up or down to align the holes in the hub with the notches in the housing.
- 8. Install the set screws and tighten securely. Remove gage ring.
- Make up the 13-5/8" 5M Quick Connect x 13-5/8" 5M Studded Adapter (Item R2) to the bottom of the BOP stack using a new BX-160 Ring Gasket.
- Thoroughly clean the MBU-3T hub, ring groove and the mating clamp segments and ring groove of the Adapter attached to the BOP stack.
- 11. Install a new **BX-160 Ring Gasket** into the ring groove of the housing.
- Pick up the BOP stack and carefully lower it over the top of the housing and land it on the ring gasket.

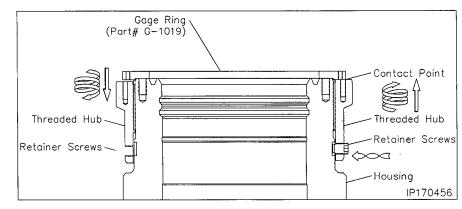

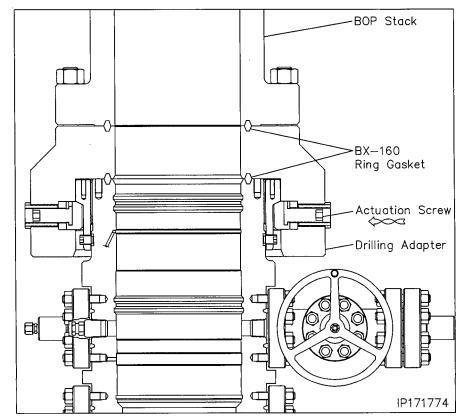

- Ensure the BOP is level and then carefully run in all of the drive screws of the upper adapter to contact point.
- Ensure the assembly remains level, run in one actuation and torque to 100 ft lbs.
- Locate the screw 180° from the first and torque it to 100 ft lbs.
- Locate the screws 90° to the right and left and torque them to 100 ft

- Position the second 4 point sequence 90° from the first and torque each screw to 200 ft lbs.
- Run in all remaining screws to contact and then torque each screw to 400 ft lbs.
- Make one additional round until a stable torque of 400 ft lbs on all (16) screws is achieved.



Stage 3 — Test the BOP Stack

Immediately after making up the BOP stack and periodically during the drilling of the well for the next casing string the BOP stack (connections and rams) must be tested.


- Examine the 13-5/8" Nominal x 4-1/2" IF (NC-50) CW Test Plug/ Retrieving Tool (Item ST1). Verify the following:
 - 1-1/4" VR plug and weep hole plug are in place and tightened securely
 - elastomer seal is in place and in good condition
 - retractable lift lugs are in place, clean, and free to move
 - drill pipe threads are clean and in good condition
- Position the test plug with the elastomer seal down and the lift lugs up and make up the tool to a joint of drill pipe.

WARNING: Ensure that the lift lugs are up and the elastomer seal is down

- 3. Remove the 1/2" NPT pipe plug from the weep hole if pressure is to be supplied through the drill pipe.
- 4. Open the housing lower side outlet valve.
- 5. Lightly lubricate the test plug seal with oil or light grease.
- Carefully lower the test plug through the BOP and land it on the load shoulder in the housing, 29.69" below the top of the drilling adapter.
- 7. Close the BOP rams on the pipe and test the BOP to 5000 psi or as required by site supervisor.

Note: Any leakage past the test plug will be clearly visible at the open side outlet valve.

 After a satisfactory test is achieved, release the pressure and open the rams.

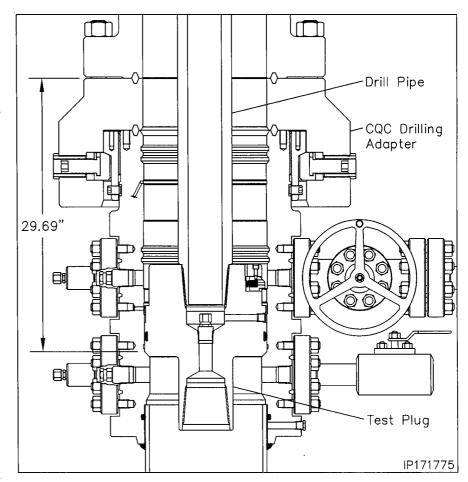

Remove as much fluid as possible from the BOP stack and the retrieve the test plug with a straight vertical lift.

Note: When performing the BOP blind ram test it is highly recommended to suspend a stand of drill pipe below the test plug to ensure the plug stays in place while disconnecting it from the drill nine

Repeat this procedure as required during the drilling of the hole section.



Stage 4 — Run the Lower Wear Bushing

Note: Always use a Wear Bushing while drilling to protect the load shoulders from damage by the drill bit or rotating drill pipe. The Wear Bushing must be retrieved prior to running the casing.

- Examine the 13-5/8" Nominal MBU-3T-LWR Wear Bushing (Item ST2). Verify the following
 - internal bore is clean and in good condition
 - upper trash o-ring is in place and in good condition
 - shear o-ring cord is in place and in good condition
 - paint anti-rotation lugs white and allow paint to dry

Run the Wear Bushing Before Drilling

- 2. Orient the 13-5/8" Nominal x 4-1/2" IF (NC-50) CW Test Plug/Retrieving Tool (Item ST1) with drill pipe connection up.
- Attach the Retrieving Tool to a joint of drill pipe.


WARNING: Ensure that the lift lugs are down and the elastomer seal is up

4. Align the retractable lift lugs of the tool with the retrieval holes of the bushing and carefully lower the tool into the Wear Bushing until the lugs snap into place.

Note: If the lugs did not align with the holes, rotate the tool in either direction until they snap into place.

- Apply a heavy coat of grease, not dope, to the OD of the bushing.
- 6. Ensure the BOP stack is drained and free of any debris from previous test.
- Slowly lower the Tool/Bushing Assembly through the BOP stack and land it on the load shoulder in the housing, 29.69" below the top of the drilling adapter.
- Rotate the drill pipe clockwise (right) to locate the stop lugs in their mating notches in the head. When properly aligned the bushing will drop an additional 1/2".

Note: The Shear O-Ring on bottom of the bushing will locate in a groove above the load shoulder in the head to act as a retaining device for the bushing.

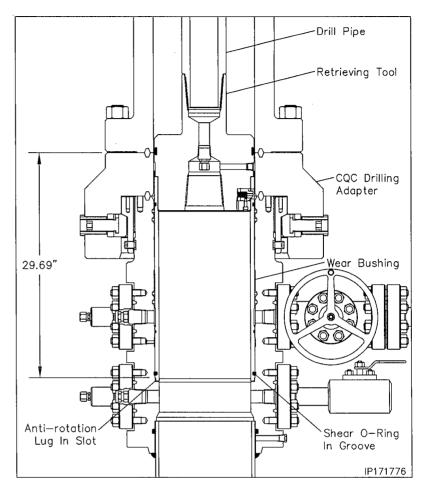

- Remove the tool from the Wear Bushing by rotating the drill pipe counter clockwise (left) 1/4 turn and lifting straight up.
- 10. Drill as required.

Note: It is highly recommended to retrieve, clean, inspect, grease, and reset the wear bushing each time the hole is tripped during the drilling of the hole section.

Retrieve the Wear Bushing After Drilling

- 11. Make up the Retrieving Tool to the drill pipe.
- 12. Drain BOP stack and wash out if necessary.
- 13. Slowly lower the tool into the Wear Bushing.
- Rotate the Retrieving Tool clockwise until a positive stop is felt. This
 indicates the lugs have snapped into the holes in the bushing.
- 15. Using the top drive, slowly pick up on the landing joint in 1000 lbs increments until the busing starts to rise. This action should take a minimum of 3000 lbs pull. Do Not Exceed 60,000 lbs.
- Retrieve the Wear Bushing, and remove it and the Retrieving Tool from the drill string.




Stage 5 — Hang Off the 9-5/8" Casing

- Examine the 13-5/8" x 9-5/8" CW-MBU-3T-TP4 Casing Hanger Running Tool (Item ST3). Verify the following:
 - internal bore and threads are clean and in good condition
 - o-ring seal is clean and in good condition
 - torque dogs are in place, in upper most position and retainer set screws are tightened securely
- Make up a landing joint to the top of the Running Tool and torque connection to thread manufacturer's maximum make up torque.
- 3. Lay down the landing joint on the pipe rack.
- On the pipe rack, examine the 13-5/8" x 9-5/8" CW-MBU-3T-TP4 Mandrel Casing Hanger (Item A11). Verify the following:
 - internal bore and threads are clean and in good condition
 - neck seal area is clean and undamaged
 - torque slots are clean and in good condition
 - pin threads are clean and in good condition. Install thread protector
 - paint indicator groove white as indicated and allow paint to dry
- Liberally lubricate the mating threads, seal areas and o-ring of the hanger and running tool with a oil or light grease.
- Using chain tongs only, thread the Running Tool into the hanger, with right hand rotation, until it shoulders out on the Hanger body.

WARNING: Do Not apply torque to the Hanger/Tool connection.


Note: If steps 1 through 6 were done prior to being shipped to location, the running tool should be backed off 1 turn and made back up to ensure it will back off freely.

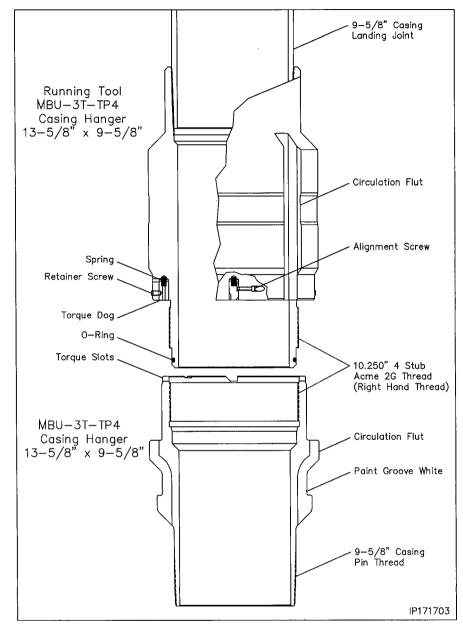

- Calculate the total landing dimension by adding the previously determined RKB dimension and 29.69°, the depth of the wellhead.
- Starting at the top of the 45° angle load shoulder of the casing hanger measure up the landing joint and place a paint mark on the joint. Mark HANGER LANDED.
- 9. Place a second mark 30" below the first and mark STOP ROTATING.
- Run the 9-5/8" casing as required and space out appropriately for the mandrel casing hanger.



Stage 5 — Hang Off the 9-5/8" Casing

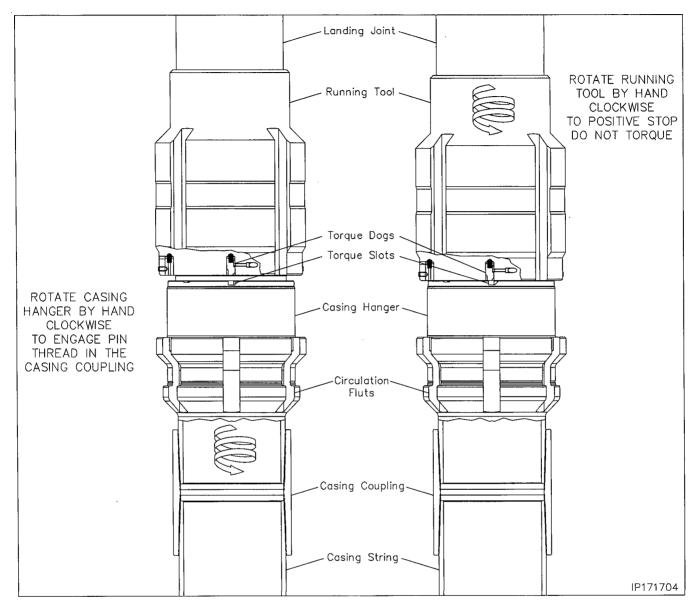

Note: If the 9-5/8" casing becomes stuck and the mandrel casing hanger cannot be landed, Refer to Stage 5A for the emergency slip casing hanger procedure.

- Pick up the casing hanger/running tool joint assembly.
- 12. Remove the casing hanger thread protector and carefully thread the hanger into the last joint of casing ran. Rotate the hanger clockwise, by hand, to a positive stop.
- Rotate the running tool clockwise by hand to a positive stop.



Stage 5 — Hang Off the 9-5/8" Casing


14. Locate the (4) 3/8" socket head set screws in the side of the hanger running tool and remove the screws.


WARNING: Place the screws in a safe place to reinstall in the tool when the job is completed.

Note: This will release the running tool torque dogs allowing them to move downward.

15. Using only chain tongs, rotate the running tool to the left to allow the torque dogs to engage the torque slots in the top of the hanger.

WARNING: Do not rotate the running tool more than 1/4 turn to the left. Doing so will decrease the torque dog engagement

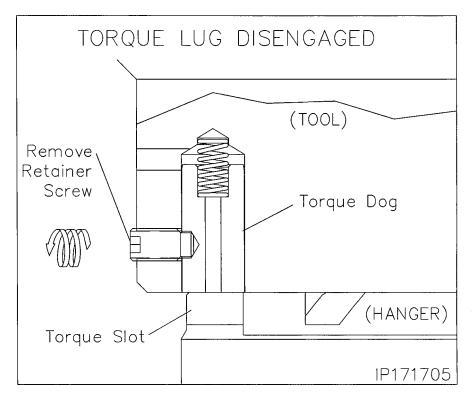


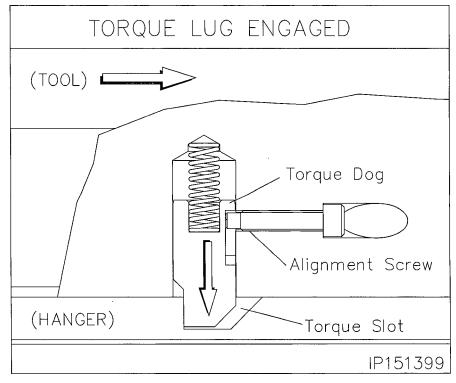



Stage 5 — Hang Off the 9-5/8" Casing

16. Engage the CRT tool on the landing joint and torque the casing hanger in the casing string to thread manufacturer's maximum make up torque.

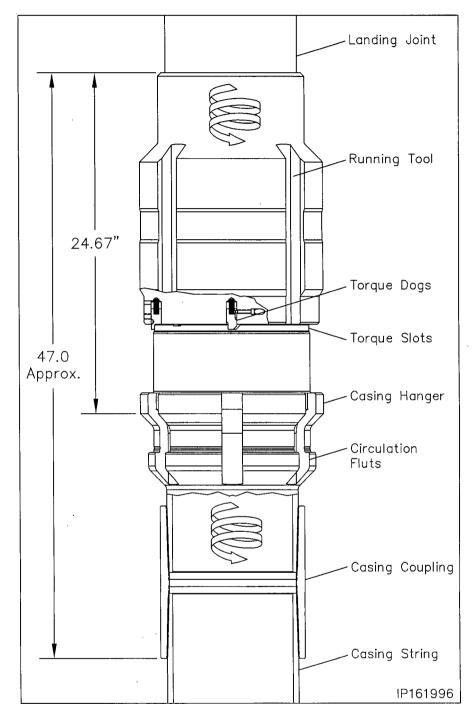




Stage 5 — Hang Off the 9-5/8" Casing

- Pick up the casing string and remove the floor slips and rotary bushings.
- 18. Carefully lower the hanger completely through the BOP annular and then engage the top drive to allow the casing to be rotated clockwise.
- While rotating the casing clockwise, carefully lower the casing string until the STOP ROTATING mark on the landing joint is level with the rig floor.

Note: The torque dogs have a maximum rated capacity of 18,000 ft lbs.

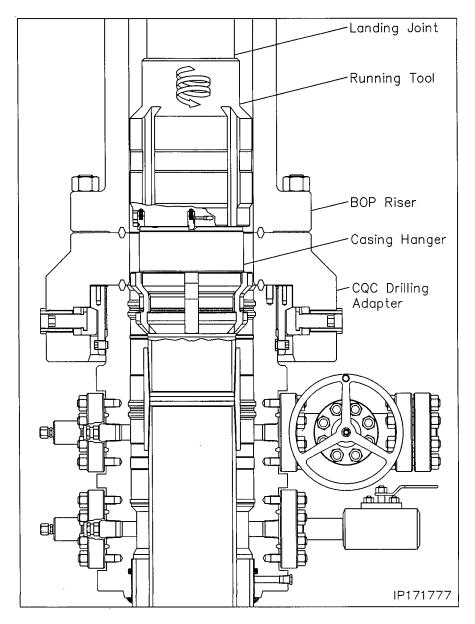

Stage 5 — Hang Off the 9-5/8" Casing


WARNING: Torque wrap can build in the casing string as it is rotated. Ensure the string comes to a neutral position, by allowing it to back off slowly counter clockwise, before the casing hanger is fully landed.

- 20. Cease rotation and continue carefully lowering the hanger through the wellhead and land it on the load shoulder in the MBU-3T housing, 29.69" below the top of the drilling adapter.
- 21. Slack off all weight on the casing and verify that the HANGER LANDED paint mark has aligned with the rig floor.
- Open the MBU-3T housing lower outlet valve and drain the BOP stack.
- 23. Sight through the valve bore to confirm the hanger is properly landed. The white painted indicator groove will be clearly visible in the center of the open outlet valve.
- 24. Close the open valve and place a vertical paint mark on the landing joint to verify if the casing string rotates during the cementing process.
- 25. Cement the casing as required.

Note: Returns may be taken through the circulation slots and out the BOP or out the side outlets on the housing.

- With cement in place, bleed off all pressure and remove the cementing head.
- 27. Using Chain Tongs Only located 180° apart, retrieve the Running Tool and landing joint by rotating the landing joint counter clockwise (left) approximately 13 turns or until the tool comes free of the hanger.

WARNING: The rig floor tong may be used to break the connection but under no circumstances is the top drive to be used to rotate or remove the casing hanger running tool.

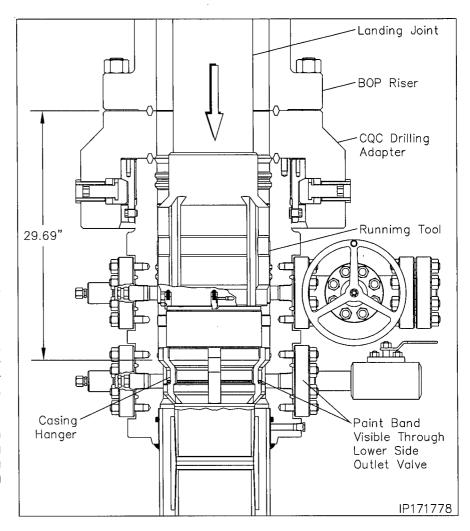




Stage 5 — Hang Off the 9-5/8" Casing

Running the 13-5/8" Wash Tool

- Examine the 13-5/8" x 4-1/2" IF Wash Tool (Item ST5). Verify the following:
 - drill pipe threads and bore are clean and in good condition
 - all ports are open and free of debris
- Orient the Wash Tool with drill pipe box up. Make up a joint of drill pipe to the tool.
- Carefully lower the Wash Tool through the BOP and land it on top of the 9-5/8" casing hanger, 28.20" below the top flange of the wellhead housing.
- Place a paint mark on the drill pipe level with the rig floor.
- 5. Open the housing lower side outlet valve and drain the BOP stack.
- Using chain tongs, rotate the tool clockwise approximately 6 turns to loosen any debris that may be on top of the hanger flutes.
- 7. Pick up on the tool approximately 1" and attach a high pressure water line or the top drive to the end of the drill pipe and pump water (at approximately 200 to 300 PSI on the rig pump) through the tool and up the BOP stack.
- 8. While flushing, raise and lower the tool the full length of the wellhead and BOP stack. The drill pipe should be slowly rotated (approximately 20 RPM) while raising and lowering to wash the inside of the housing and BOP stack to remove all caked on dehris
- Once washing is complete, land the wash tool on the hanger flutes.
- Shut down pumps and allow the BOP stack to drain.

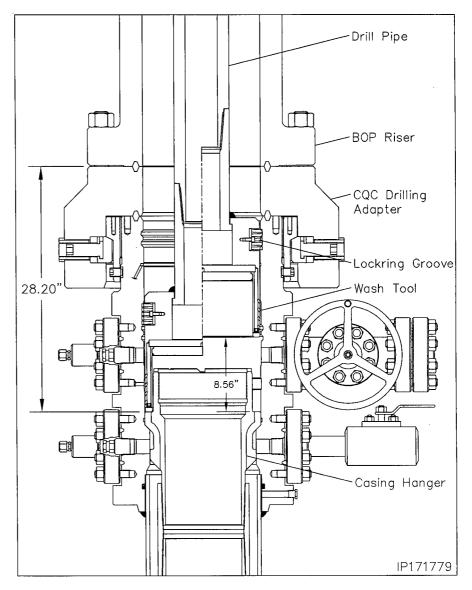

11. Reengage the pump and fully wash the inside of the wellhead and the entire BOP one additional cycle ensuring the stopping point is with the was tool resting on top of the hanger flutes.

Note: Observe the returns at the open outlet valve. If returns are not cleam, continue flushing until they are.


 Once the returns are clean and free of debris, retrieve the tool to the rig floor. 13. Using a bright light, sight through the bore of the BOP stack and observe the top of the hanger neck and flutes. Ensure that there are no dark areas on top of the flutes of the hanger.


WARNING: Continue washing until all debris is removed.



Stage 5A — Hang Off the 9-5/8" Casing (Emergency)

- 1. Cement the hole as required.
- Drain the BOP stack through the housing side outlet valve.
- 3. Locate the actuation screw on the OD of the drilling adapter.
- Using a hex drive, fully retract the actuation screws until they are slightly over flush with the glandnuts.
- Pick up on the BOP stack a minimum of 12" above the housing hub and secure with safety slings.
- Washout as required.
- 7. Examine the 13-5/8" x 9-5/8" MBU-3T Slip Casing Hanger (Item A11a). Verify the following:
 - slips and internal bore are clean and in good condition
 - · all screws are in place
- There are two latch screws located in the top of the casing hanger. Using a 5/16" Allen wrench, remove the two latch screws located 180° apart and separate the hanger into two halves.
- Place two boards on the lower adapter against the casing to support the Hanger.
- Pick up one half of the hanger and place it around the casing and on top of the boards.
- Pick up the second hanger half and place it around the casing adjacent the first half.
- Slide the two hanger halves together ensuring the slip alignment pins properly engage the opposing hanger half.
- 13. Reinstall the latch screws and tighten securely.
- 14. Prepare to lower the hanger into the housing bowl.

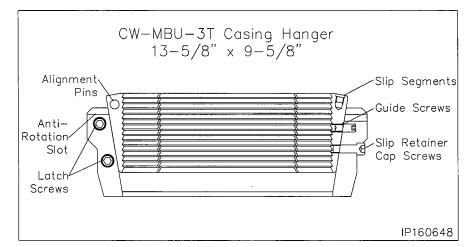

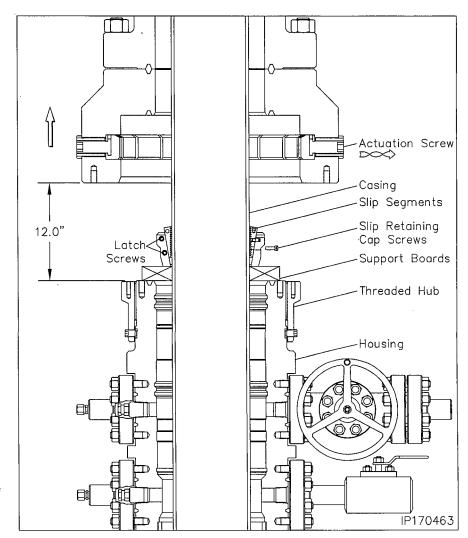



Stage 5A — Hang Off the 9-5/8" Casing (Emergency)


WARNING: Do Not Drop the Casing Hanger!

- Grease the Casing Hanger's body and remove the slip retaining screws.
- 16. Remove the boards and allow the hanger to slide into the housing bowl. When properly positioned the top of the hanger will be approximately 22.56" below the top of the housing.
- Pull tension on the casing to the desired hanging weight and then slack off.

Note: A sharp decrease on the weight indicator will signify that the hanger has taken weight and at what point, If this does not occur, pull tension again and slack off once more.

WARNING: Because of the potential fire hazard and the risk of loss of life and property, It is highly recommended to check the casing annulus and pipe bore for gas with an approved sensing device prior to cutting off the casing. If gas is present, do not use an open flame torch to cut the casing. It will be necessary to use a air driven mechanical cutter which is spark free.

- Rough cut the casing approximately 4" above the top of the housing and move the excess casing out of the way.
- 19. Using the Wach's internal casing cutter, final cut the casing at 17.54" ± 1/8" below the top of the lower adapter or 5.02" ± 1/8" above the hanger body.
- 20. Remove the internal casing cutter assembly and reconfigure the assembly to bevel the casing. Reinstall the cutter assembly and then place a 3/16" x 3/8" bevel on the O.D. and a I.D. chamfer to match the minimum bore of the packoff to be installed.

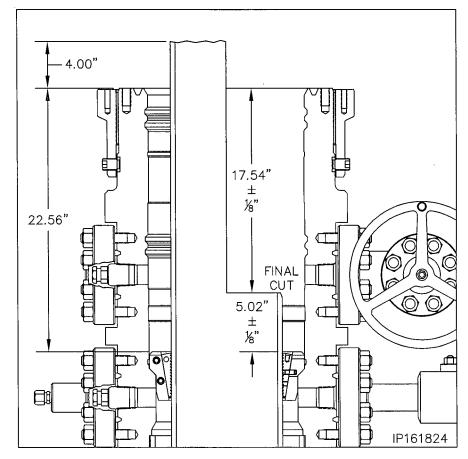

Note: There must not be any rough edges on the casing or the seals of the Packoff will be damaged.


- Thoroughly clean the housing bowl, removing all CEMENT AND CUTTING DEBRIS.
- Locate the two anti-rotation notches in the top of the sip bowl.
- Place a straight edge on top of the slip bowl and in line with the center of one of the notches.
- 24. Ensure the straight edge is vertical and then place a paint mark on top of the housing in line with the notch in the slip bowl.



Stage 6 — Install the MBU-3T Mandrel Hanger Packoff

The following steps detail the installation of the MBU-3T Nested Packoff Assembly for the mandrel hanger. If the casing was landed using the emergency slip hanger, skip this step and proceed with Stage 6A for installing the emergency MBU-3T Nested packoff.

- Examine the 13-5/8" x 11.250" 4 Stub Acme 2G LH box top MBU-3T Mandrel Hanger Nested Packoff Assembly (Item A12). Verify the following:
 - all elastomer seals are in place and undamaged
 - internal bore, and ports, are clean and in good condition
 - · lockring is fully retracted
 - energizer ring is in its upper most position and retained with shear pins and stop screws are loose
 - anti-rotation plungers are in place, free to move
- Inspect the ID and OD seals for any damage and replace as necessary.
- Examine the 13-5/8" Nominal x 11.250" 4 Stub Acme 2G LH, MBU-3T Nested Packoff Running Tool (Item ST6). Verify the following:
 - Acme threads are clean and in good condition
 - retrieval latch is in position and retained with cap screws
 - Remove seal sleeve protector sleeve
 - seal sleeve is in position and rotates freely
 - seal sleeve o-rings are in place and in good condition
 - · reinstall seal sleeve protector
- Remove the retrieval latch and set aside.

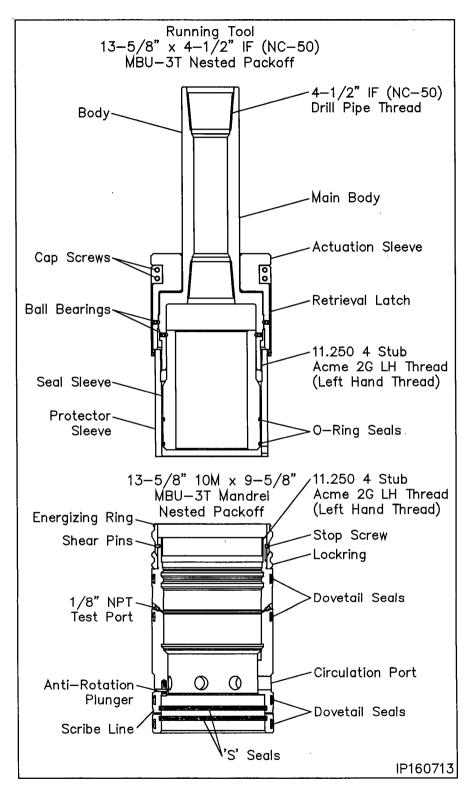




Stage 6 — Install the MBU-3T Mandrel Hanger Packoff

- Make up the running tool to 4-1/2"
 IF (NC-50) drill pipe and torque the connection to optimum make up torque.
- 6. Pick up the Running Tool with landing joint and suspend it above the packoff.
- Remove the tool protector sleeve with counter clockwise rotation and set the sleeve aside.
- Thoroughly clean and lightly lubricate the mating Acme threads of the running tool and packoff with oil or light grease.
- Lightly lubricate the seal sleeve o-rings with oil or a light grease.
- 10. Carefully lower the tool into the packoff and thread them together by first rotating the tool clockwise (RIGHT) to locate the thread start and then counter clockwise (LEFT) until the tool upper body makes contact with the packoff Energizing Ring. Approximately 4 turns.
- 11. Install (1) 1/8" NPT pipe plug in the OD test port of the packoff and tighten securely.
- Attach a test pump to the remaining open port and inject test fluid between the seal sleeve o-rings until a stable test pressure of 5000 psi is achieved.
- If the test fails, remove the tool and replace the leaking o-rings.
- 14. After a satisfactory test is achieved remove the test pump and the 1/8" pipe plug from the opposite test port.

WARNING: All 1/8" pipe plugs must be removed prior to installing the packoff

15. Pick up the assembly and thoroughly clean and lightly lubricate the packoff ID 'S' seals and the OD dovetail seals with oil or light grease.

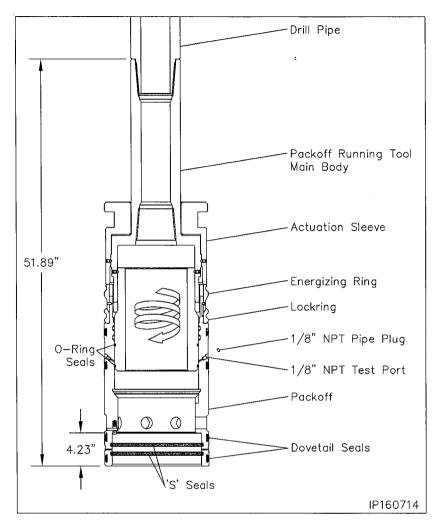




Stage 6 — Install the MBU-3T Mandrel Hanger Packoff

Landing the Packoff

- 16. Remove the hole cover.
- 17. Measure up 5 foot from the paint mark on the OD of the packoff and place a paint mark on the drill pipe.
- 18. Pick up the packoff/running tool assembly and carefully lower the assembly through the BOP marking the landing joint every five feet until the calculated dimension is reached.
- Place a paint mark on the landing joint at that dimension and mark land off. Place an additional mark 1-1/2" above the first one and mark engaged.
- 20. Continue lowering the packoff until it passes over the neck of the hanger and lands on the casing hanger neck, 23.23" below the top of the drilling adapter.
- 21. Locate the upper 1" sight port pipe plug and remove the plug
- 22. Look through the port to verify that the packoff is properly landed. The white paint scribe line will be clearly visible in the center of the open port.
- 23. Reinstall the pipe plug and tighten securely.

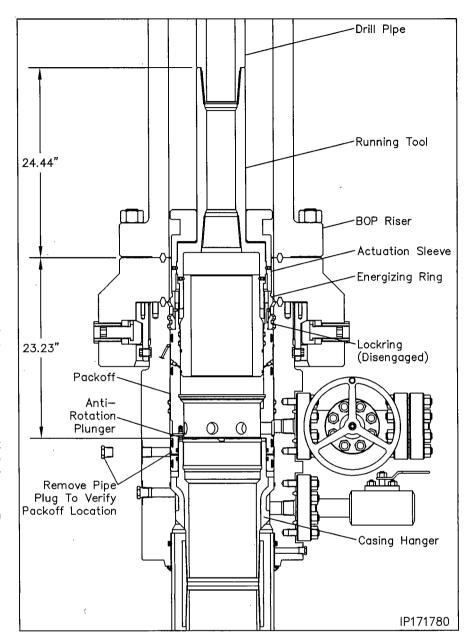



Stage 6 — Install the MBU-3T Mandrel Hanger Packoff


Seal Test

- 24. Locate the upper and lower seal test fittings on the O.D. of the housing and remove the dust cap from the fittings.
- 25. Attach a test pump to the open lower fitting and pump clean test fluid between the seals until a stable test pressure of 5,000 psi is achieved.
- 26. Hold test pressure for 5 minutes.
- If a leak develops, bleed off test pressure, remove the packoff from the wellhead and replace the leaking seals.
- 28. Repeat steps 24 through 27 for the remaining seal test.
- After satisfactory tests are achieved, bleed off the test pressure but leave the test manifolds in place.

Engaging the Lockring

- 30. Using chain tongs only located 180° apart, slowly rotate the drill pipe counter clockwise until the anti-rotation plungers align with the slots in the top of the hanger. Expect torque of approximately 400 ft lbs. to rotate the packoff.
- 31. Using only chain tongs, rotate the landing joint approximately 6 to 6-1/2 turns counter clockwise to engage the packoff lockring in its mating groove in the bore of the MBU-LR housing.

Note: Approximately 800 to 900 ft. lbs. of torque will be required to break over the shear pins in the packoff. The torque will drop off and then increase slightly when the energizing ring pushes the lockring out. A positive stop will be encountered when the lockring is fully engaged.

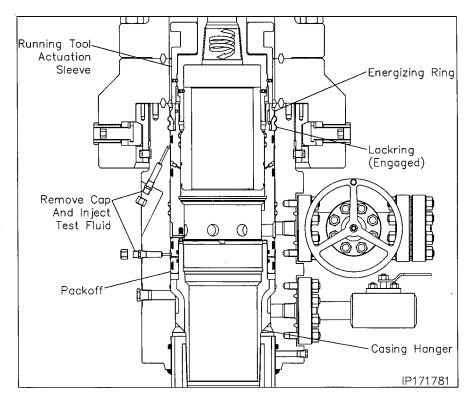

Note: When properly engaged the second paint mark on the landing joint will align with the rig floor. VERIFY PAINT MARKS.

WARNING: It is imperative that the landing joint remain concentric with the well bore when rotating to engage the lockring. This can be accomplished with the use of the air hoist.

WARNING: If the required turns to engage the lockring are not achieved or excessive torque is encountered, remove the packoff and first call local branch and then Houston Engineering.

- Back off the landing joint/running tool approximately three turns. Using the top drive, exert a 40,000 lbs. pull on the landing joint.
- 33. Reattach the test pump to the open test manifolds and retest the packoff seals to 5,000 psi for 15 minutes. This will also verify that the packoff is in place.
- 34. After satisfactory test is achieved, bleed off all test pressure, remove test pump and reinstall the dust cap on the open fittings.
- Using only chain tongs, rotate the landing joint clockwise until the tool comes free of the packoff (approximately 9 to 9-1/2 turns) and then retrieve the tool with a straight vertical lift.



Stage 6 — Install the MBU-3T Mandrel Hanger Packoff

In the event the packoff is required to be removed after the lockring is engaged the following procedure is to be followed.

Retrieving the Packoff


- Position the retrieval latch so the latch finger extend from the bottom of the running tool body.
- 2. Reinstall the cap screws and tighten them securely.
- 3. Ensure the retrieval latch freely rotates on the running tool body.
- Carefully lower the running tool through the BOP stack and into the packoff.
- Rotate the drill pipe clockwise (Right) to locate the thread start and then counter clockwise (Left) (approximately 9 to 9-1/2 turns) to a positive stop.

Note: At this point the retrieval latches will have passed over the energizing ring and snapped into place.

 Rotate the drill pipe clockwise (right) approximately 6 turns to a positive stop. The drill pipe should rise approximately 1-1/2".

Warning: Do not exceed the 6 turns or the packoff may be seriously damaged.

- Carefully pick up on the drill pipe and remove the packoff from the MBU-3T wellhead with a straight vertical lift.
- Rotate the packoff 1 turn clockwise to relax the retrieval latch.
- Remove the (4) 1/2° cap screws and remove the latch assembly.

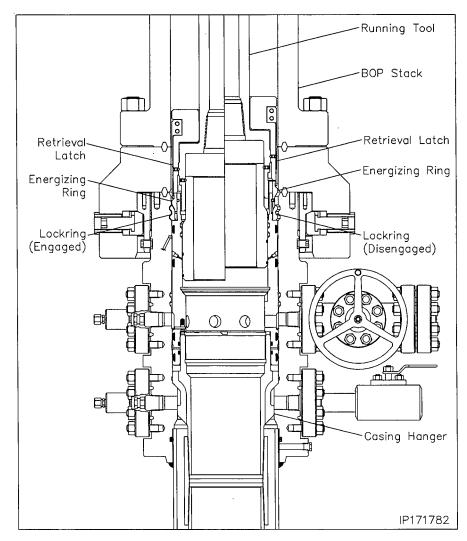


- Redress the Packoff and reset as previously outlined.
- Once the packoff is properly set, reinstall the retrieval latch on the tool.



Stage 6A — Install the MBU-3T Emergency Packoff

- 1. Examine the 13-5/8" 10M x 9-5/8" x 11.250" 4 Stub Acme 2G LH box top MBU-3T Emergency Nested Packoff Assembly (Item A12a). Verify the following:
 - all elastomer seals are in place and undamaged
 - internal bore, and ports, are clean and in good condition
 - · lockring is fully retracted
 - energizer ring is in its upper most position and retained with shear pins
- 2. Inspect the ID and OD seals for any damage and replace as necessary.
- Examine the 13-5/8" Nominal x 11.250" 4 Stub Acme 2G LH, MBU-3T Nested Packoff Running Tool (Item ST6). Verify the following:
 - Acme threads are clean and in good condition
 - retrieval latch is in position and retained with cap screws
 - seal sleeve is in position and rotates freely
 - seal sleeve o-rings are in place and in good condition
 - · reinstall seal sleeve protector
- Make up a joint 4-1/2" IF (NC-50) drill pipe to the top of the Running Tool and tighten connection to thread manufacturer's maximum make up torque.
- Run in the hole with two stands of drill pipe and set in floor slips.

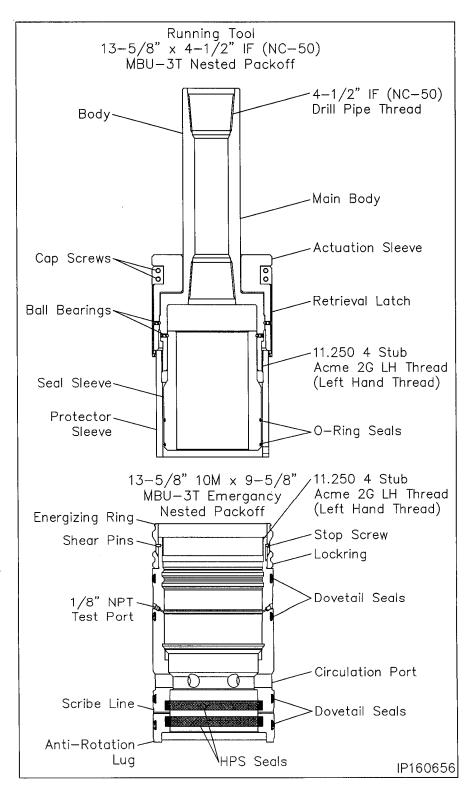




Stage 6A — Install the MBU-2LR Emergency Packoff

- Pick up the packoff and carefully pass it over the drill pipe and set it on top of the floor slips.
- Pick up the running tool with landing joint and remove the tool protector sleeve with counter clockwise rotation and set the sleeve aside.
- 8. Thoroughly clean and lightly lubricate the mating acme threads of the running tool and packoff with oil or light grease.
- 9. Lightly lubricate the seal sleeve o-rings with oil or a light grease.
- Make up the running tool to the drill pipe in the floor slips using the appropriate length pip x pin sub.
- Pick up the packoff and thread it onto the running tool with clockwise (Right) rotation until the Energizing Ring makes contact with the lower body of the tool. (Approximately 4 turns).
- Install (1) 1/8" NPT pipe plug in the OD test port of the packoff and tighten securely
- Attach a test pump to the remaining open port and inject test fluid between the seal sleeve o-rings until a stable test pressure of 5,000 psi is achieved.
- 14. If the test fails, remove the tool and replace the leaking o-rings.
- 15. After a satisfactory test is achieved remove the test pump and the 1/8" pipe plug from the opposite test port.

WARNING: All 1/8" pipe plugs must be removed prior to installing the packoff

 Thoroughly clean and lightly lubricate the packoff ID 'HPS' seals and the OD dovetail seals with oil or light grease.

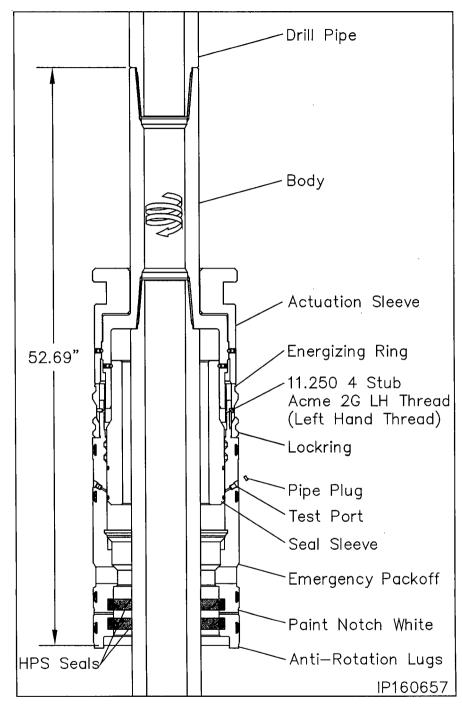

17. Using a straight edge positioned vertically and centered on the anti-rotation lug on the bottom of the packoff, place a white paint mark up the side of the packoff in line with the lug.

Note: The line will be used to guide the packoff anti-rotation lug into its mating notch in the slip bowl.



Stage 6A — Install the MBU-2LR Emergency Packoff


Landing the Packoff

- 18. Pick up the drill string and remove the floor slips.
- 19. Carefully lower the packoff through the rig floor and position it just above the housing.
- 20. Align the white paint line with the existing paint mark on top of the housing.
- 21. While holding the packoff to maintain alignment, carefully lower the packoff into the housing until it lands on top of the slip hanger.

Note: When properly positioned the top of the running tool will be approximately 30.12" above the top of the MBU-3T Housing.

22. Remove the upper 1" LP pipe plug from the sight port to verify the packoff is properly landed. The 5/16" scribe line should be clearly visible in the center of the port.

With landing verified, reinstall the pipe plug and tighten securely.

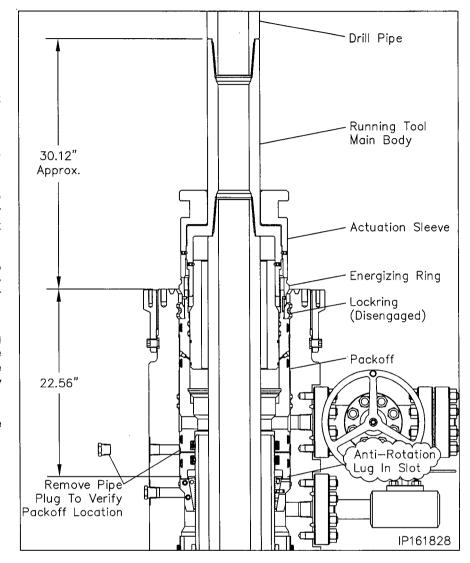

Stage 6A — Install the MBU-2LR Emergency Packoff


Seal Test

- Locate the upper and lower seal test fittings on the O.D. of the housing and remove the dust cap from the fittings.
- Attach a test pump to the open lower fitting and pump clean test fluid between the seals until a stable test pressure of 5,000 psi is achieved.
- 3. Hold test pressure for 5 minutes.
- If a leak develops, bleed off test pressure, remove the packoff from the wellhead and replace the leaking seals.
- After satisfactory test is achieved, bleed off the test pressure but leave the test manifold in place.
- 6. Repeat steps 1 through 5 for the upper seal test port.

Engaging the Lockring

 Using only chain tongs, rotate the landing joint approximately 6 to 6-1/2 turns counter clockwise (Left) to engage the packoff lockring in its mating groove in the bore of the MBU-3T housing.

Note: Approximately 800 to 900 ft. lbs. of torque will be required to break over the shear pins in the packoff. The torque will drop off and then increase slightly when the energizing ring pushes the lockring out. A positive stop will be encountered when the lockring is fully engaged.

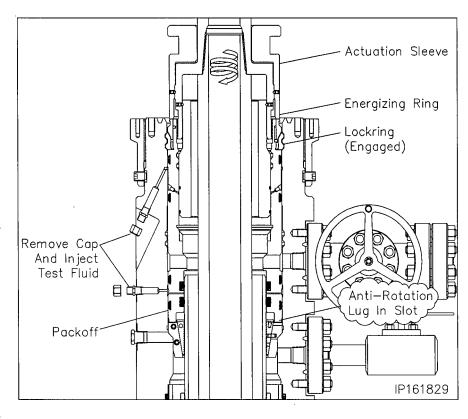

WARNING: It is imperative that the drill pipe landing joint remain concentric with the well bore when rotating to engage the lockring. This can be accomplished with the use of the air hoist.

WARNING: If the required turns to engage the lockring are not achieved or excessive torque is encountered, remove the packoff and first call local branch and then Houston Engineering.

 Back off the landing joint/running tool approximately three turns.
 Using the top drive, exert a 40,000 lbs. pull on the landing joint.

- Reattach the test pump to the open test manifolds and retest the packoff seals to 5,000 psi for 15 minutes. This will also verify that the packoff is in place.
- After satisfactory test is achieved, bleed off all test pressure, remove test pump and reinstall the dust cap on the open fittings.
- Using only chain tongs, rotate the landing joint clockwise until the tool comes free of the packoff (approximately 9 to 9-1/2 turns) and then retrieve the tool with a straight vertical lift.
- Reinstall and nipple up the BOP stack.




Stage 7 — Test the BOP Stack

Immediately after making up the BOP stack and periodically during the drilling of the well for the next casing string the BOP stack (connections and rams) must be tested.

- Examine the 11" Nominal x 4-1/2" IF (NC-50) CW Test Plug/ Retrieving Tool (Item ST7). Verify the following:
 - 1-1/4" VR plug and weep hole plug are in place and tightened securely
 - elastomer seal is in place and in good condition
 - retractable lift lugs are in place, clean, and free to move
 - drill pipe threads are clean and in good condition
- Position the test plug with the elastomer seal down and the lift lugs up and make up the tool to a joint of drill pipe.

WARNING: Ensure that the lift lugs are up and the elastomer seal is down

- Remove the 1/2" NPT pipe plug from the weep hole if pressure is to be supplied through the drill pipe.
- Open the housing upper side outlet valve.
- 5. Lightly lubricate the test plug seal with oil or light grease.
- Carefully lower the test plug through the BOP and land it on the load shoulder in the packoff, 18.26" below the top of the drilling adapter.
- 7. Close the BOP rams on the pipe and test the BOP to 5,000 psi.

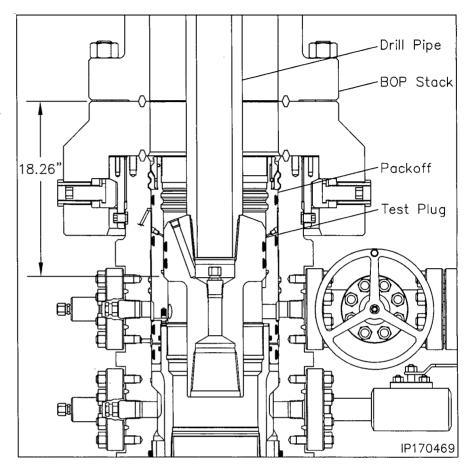

Note: Any leakage past the test plug will be clearly visible at the open side outlet valve.

- After a satisfactory test is achieved, release the pressure and open the rams.
- Remove as much fluid as possible from the BOP stack and the retrieve the test plug with a straight vertical lift.

Note: When performing the BOP blind ram test it is highly recommended to suspend a stand of drill pipe below the test plug to ensure the plug stays in place while disconnecting from it with the drill pipe.

Repeat this procedure as required during the drilling of the hole section.



Stage 8 — Run the Upper Wear Bushing

Note: Always use a Wear Bushing while drilling to protect the load shoulders from damage by the drill bit or rotating drill pipe. The Wear Bushing must be retrieved prior to running the casing.

- 1. Examine the 13-5/8" x 11" x 9.00" ID MBU-3T-UPR Wear Bushing (Item ST8). Verify the following
 - internal bore is clean and in good condition
 - o-ring is in place and in good condition
 - shear o-ring cord is in place and in good condition
 - paint anti-rotation lugs white and allow paint to dry

Run the Wear Bushing Before Drilling


- Orient the 13-5/8" Nominal x 4-1/2" IF (NC-50) CW Test Plug/ Retrieving Tool (Item ST1) with drill pipe connection up.
- 3. Attach the Retrieving Tool to a joint of drill pipe.

WARNING: Ensure that the lift lugs are down and the elastomer seal is up

 Align the retractable lift lugs of the tool with the retrieval holes of the bushing and carefully lower the tool into the Wear Bushing until the lugs snap into place.

Note: If the lugs did not align with the holes, rotate the tool in either direction until they snap into place.

- 5. Apply a heavy coat of grease, not dope, to the OD of the bushing.
- Ensure the BOP stack is drained and free of any debris from previous test.
- Slowly lower the Tool/Bushing Assembly through the BOP stack and land it on the load shoulder in the housing, 18.26" below the top of the drilling adapter.
- Rotate the drill pipe clockwise (right) to locate the stop lugs in their mating notches in the head. When properly aligned the bushing will drop an additional 1/2".

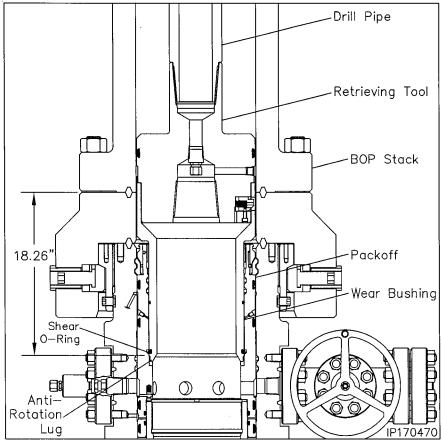

Note: The Shear O-Ring on bottom of the bushing will locate in a groove above the load shoulder in the head to act as a retaining device for the bushing.

- Remove the tool from the Wear Bushing by rotating the drill pipe counter clockwise (left) 1/4 turn and lifting straight up.
- 10. Drill as required.

Note: It is highly recommended to retrieve, clean, inspect, grease, and reset the wear bushing each time the hole is tripped during the drilling of the hole section.

Retrieve the Wear Bushing After Drilling

- Make up the Retrieving Tool to the drill pipe.
- 12. Drain BOP stack and wash out if necessary.
- 13. Slowly lower the tool into the Wear Bushing.
- 14. Rotate the Retrieving Tool clockwise until a positive stop is felt. This indicates the lugs have snapped into the holes in the bushing.
- 15. Using the top drive, slowly pick up on the landing joint in 1000 lbs increments until the busing starts to rise. This action should take a minimum of 3000 lbs pull. Do Not Exceed 60,000 lbs.
- 16. Retrieve the Wear Bushing, and remove it and the Retrieving Tool from the drill string.



Stage 9 — Hang Off the 5-1/2" Casing


- 1. Run and cement the 5-1/2" casing string as required.
- Open the housing upper side outlet valve to drain the BOP stack.
- Clean the ID of the BOP stack and OD
 of the casing with a high pressure water
 hose until returns through the open side
 outlet valve are clean and free of debris.
- 4. Thoroughly inspect the BOP stack to ensure all rams are fully retracted into their respective ram bores, the annular rubber is fully relaxed, all drilling adapters/spools are full opening and there are no casing collars between the rig floor and the wellhead.


Note: Side outlet valve to remain open while setting the casing hanger.

- Examine the 11" x 5-1/2" C2 Slip Casing Hanger (Item A13). Verify the following:
 - slips and internal bore are clean and in good condition
 - · all screws are in place
 - packoff rubber is in good condition

Note: Ensure that the packoff rubber does not protrude beyond the O.D. of the casing hanger body. If it does, loosen the cap screws in the bottom of the hanger.

- Measure the distance from the rig floor to the top of the wellhead flange and record this measurement.
- 7. Pour a light oil through the BOP stack to thoroughly coat the OD of the casing.
- 8. Using a 5/16" Allen wrench, remove the two latch screws located 180° apart on top of the hanger and separate the hanger into two halves.
- Place two boards on the housing flange against the casing to support the hanger.
- Pick up one half of the hanger and place it around the casing and on top of the boards.
- Pick up the second hanger half and place it around the casing adjacent the first half.

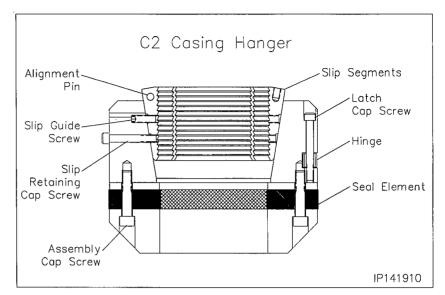

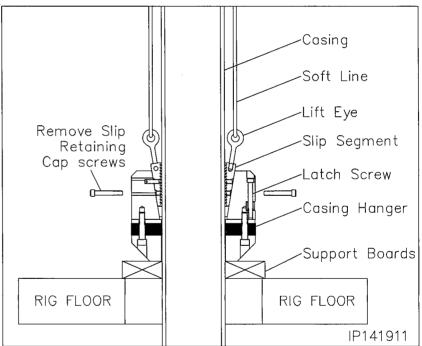

- 12. Slide the two hanger halves together ensuring the slip guide pins properly engage the opposing hanger half.
- 13. Reinstall the latch screws and tighten securely.
- Using a 5/16" allen wrench, remove the slip retainer cap screws and discard them.
- 15. Lubricate the OD of the Casing Hanger liberally with a light grease or oil.
- 16. Prepare to lower the hanger through the BOP stack.



Stage 9 — Hang Off the 5-1/2" Casing

WARNING: Do not drop or allow the hanger to fall through the BOP stack.


One method commonly used is to loop or tie four lengths of soft line through the hanger eye bolts as shown. Tie a knot in the soft line at the measurement noted in step six (6).


Note: The soft line may stretch and give an imprecise indication of the Casing Hanger's location.

- Remove the boards and allow the Casing Hanger to slide through the BOP and into the MBU-3T packoff bowl using the cat line to center that casing if necessary.
- 18. When the Casing Hanger is down as indicated by the knots in the soft line, pull tension to the desired hanging weight and slack off.

Note: A sharp decrease on the weight indicator will signify that the Hanger has taken weight and at what point.

- Untie the soft lines and pull them back through the lift eyes or drop them inside the BOP stack.
- 20. Prior to nippling down the BOP the integrity of the slip hanger seal can be verified by closing the BOP annular on the casing string and applying customer specific pressure through the kill line.
- 21. Once a satisfactory test is achieved, bleed off all test pressure, and drain the BOP stack.
- 22. Locate the actuation screws on the OD of the lower drilling adapter.
- 23. Using a hex drive, fully retract the (16) actuation screws until they are slightly over flush with the glandnuts.
- Pick up on the BOP stack a minimum of 12" above the housing and secure with safety slings.
- 25. Remove the four lift eyes.
- Rough cut the casing approximately 8" above the top of the housing and move the excess casing out of the way.
- 27. Final cut the casing at 5-3/4" ± 1/8" above the top flange of the housing.
- 28. Grind the casing stub level and then place a 3/16" x 3/8" bevel on the O.D. and a I.D. chamfer to match the minimum bore of the tubing head to be installed.

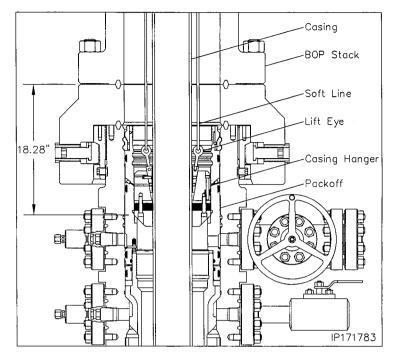

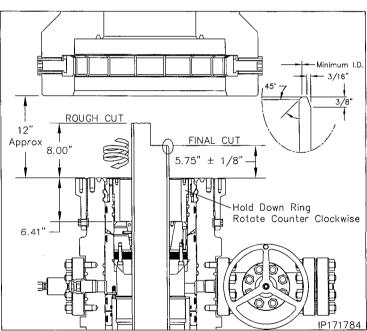



- Thoroughly clean the top of the housing and Casing Hanger. Ensure all cutting debris are removed.
- Thoroughly clean and lightly lubricate the mating acme threads of the MBU-3T packoff and the slip Hold Down Ring (Item A14).
- Thread the ring into the packoff with counter clockwise rotation to a positive stop on top of the slip hanger.
- Re-land the BOP stack and prepare to remove the upper adapter with the BOP stack



Stage 10 — Install the 'Quick Connect' TA Cap Assembly

- Examine the 13-5/8" 5M 'Quick Connect' TA Cap Assembly (Item R3). Verify the following:
 - · bore is clean and free of debris
 - ring groove is clean and undamaged
 - (16) drive screws and clamp segments are properly installed and fully retracted
 - 5-1/2" HPS seal bushing is in place and properly retained with the square snap wire
- Thoroughly clean the top of the MBU-3T housing, thread hub, and the mating seal surfaces of the TA Cap.
- Install a new BX-160 Ring Gasket into the ring groove of the housing.
- Using a suitable lifting devise with weight rated slings, pick up the TA Cap assembly and carefully lower it over the casing stub and land it on the ring gasket.
- Ensure the TA Cap is level and then carefully run in all of the drive screws of the TA Cap to contact point.
- Ensure the assembly remains level, run in one actuation and torque to 100 ft lbs.
- 7. Locate the screw 180° from the first and torque to 100 ft lbs.
- Locate the screws 90° to the right and left and torque to 100 ft lbs.
- Position the second 4 point sequence 90° from the first and torque each screw to 200 ft lbs
- Run in all remaining screws to contact and then torque each screw to 400 ft lbs.
- Make one additional round until a stable torque of 400 ft lbs on all (16) screws is achieved.

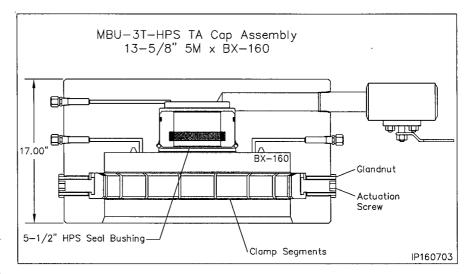

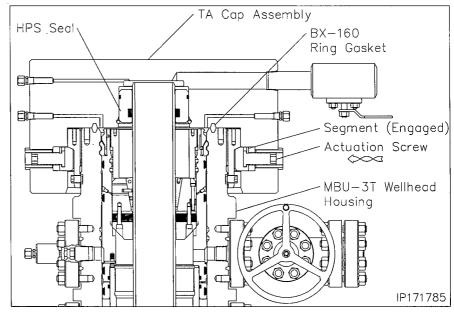




Stage 10 — Install the 'Quick Connect' TA Cap Assembly


Connection Test


- Open the TA Cap ball valve and the housing upper side outlet valve to monitor leakage.
- Locate the two test fittings marked flange test and remove the dust caps from the fittings.
- 3. Attach a bleeder tool to one of the open fitting and open the tool.
- Attach a test pump to the remaining open fitting and pump clean test fluid into the void area until a continuous stream flows from the open bleeder tool.
- Close the tool and continue pumping fluid until a stable test pressure of 5,000 psi or 80% of casing collapse is achieved, whichever is less.
- 6. Hold test pressure for 15 minutes.
- After a satisfactory test is achieved, bleed off the test pressure, drain the fluid, remove the bleeder tool and re install the dust cap on the open fittings.
- 8. Close all open valves.

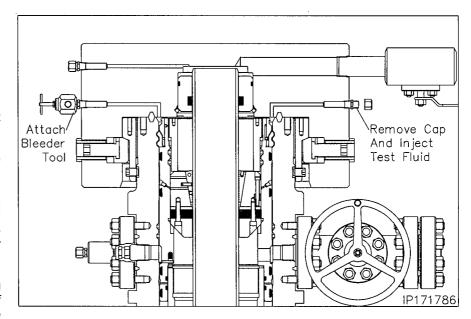

Stage 11 — Remove the TA Cap Assembly


- Open the ball valve on the TA cap to check for trapped pressure above the casing hanger.
- Locate the actuation screws on the OD of the TA Cap Assembly.
- 3. Using a hex drive, fully retract the actuation screws until they are slightly over flush with the glandnuts.
- Install a lift eye with pick up sling to the top of the TA Cap and lift the cap free of the wellhead.
- 5. Remove the thread hub set screws.
- Remove the thread hub from the top of the housing with clockwise rotation.

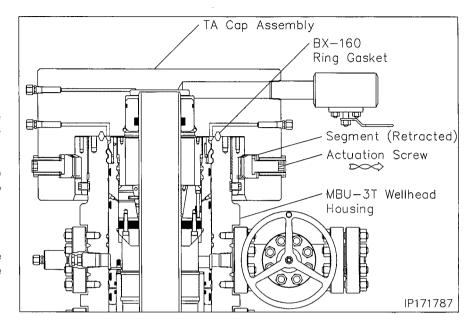

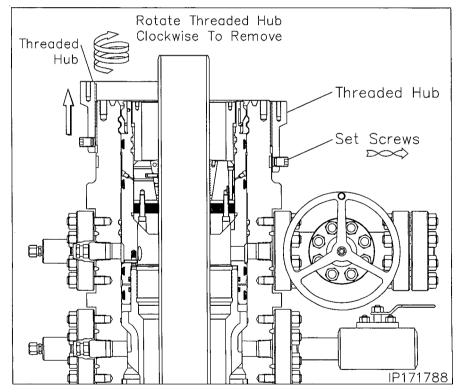

Stage 11 — Remove the TA Cap Assembly


- 7. Examine the 13-5/8" 5M Thread Flange. Verify the following:
 - Acme thread are clean and in good condition
- 8. Thoroughly clean and lightly lubricate the mating threads of the housing and the Thread Flange with Copper Coat or Never Seize.
- Pick up the flange and carefully thread it onto the top of the housing with counter clockwise rotation until the top of the flange is level with the top of the Acme thread of the housing.
- 10. Rotate the flange in either direction to two hole.
- 11. Prepare to install the tubing head.

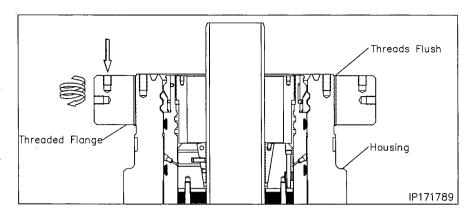


Stage 12 — Install the Tubing Head

Note: The tubing head may be shipped to location with the lower frac valve pre installed and tested.

- 1. Examine the 13-5/8" 5M x 7-1/16" 10M CW, CTH-HPS-F MOD Tubing Head With 5-1/2" DBLHPS Bottom (Item B1) Verify the following:
 - seal area and bore are clean and in good condition
 - HPS-F MOD Secondary Seal Bushing is in place and properly retained with a square snap wire
 - · all peripheral equipment is intact and undamaged
- Clean the mating ring grooves of the MBU-3T Housing and tubing head.
- Lightly lubricate the I.D. of the tubing head 'HPS' seals and the casing stub with a light oil or grease.

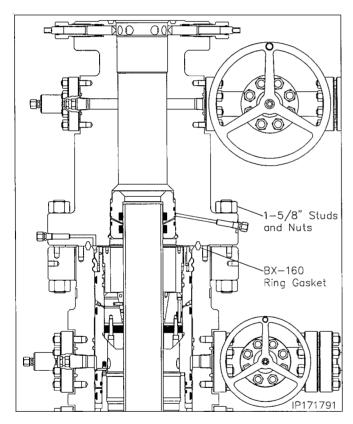

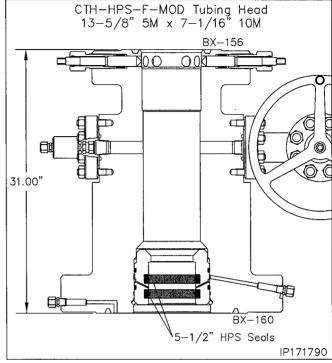

Note: Excessive oil or grease may prevent a good seal from forming!

- Install a new BX-160 Ring Gasket (Item B12) in the ring groove of the housing.
- 5. Pick up the tubing head and suspend it above the housing.
- Orient the head so that the outlets properly align with the housing upper outlets and then carefully lower the head over the casing stub and then land it on the ring gasket.


Warning: Do Not damage the 'HPS' seals or their sealing ability will be impaired!

 Make up the flange connection using the appropriate size studs and nuts (Item B13), tightening them in an alternating cross pattern.

Stage 12 — Install the Tubing Head

Seal Test

- Locate the seal test fitting and one flange test fitting on the Tubing Head lower flange and remove the dust cap from both fittings.
- Attach a Bleeder Tool to one of the open flange test fittings and open the Tool.
- Attach a test pump to the seal test fitting and pump clean test fluid between the HPS Seals until a test pressure of 10,000 psi or 80% of casing collapse - Whichever is less.
- 4. Hold test pressure for 15 minutes.
- If pressure drops, a leak has developed. Bleed off test pressure and take the appropriate action in the adjacent table.
- After a satisfactory test is achieved, remove the Test Pump, drain test fluid and reinstall the dust cap on the open seal test fitting.

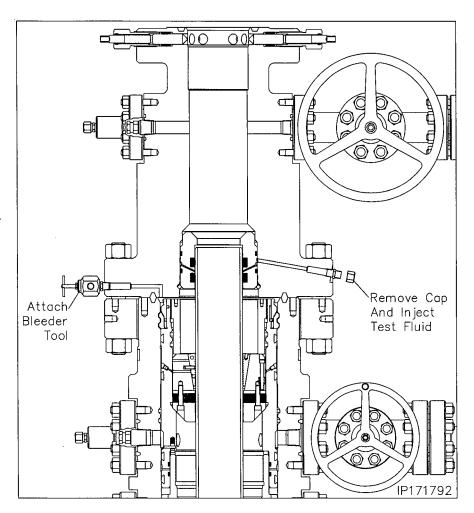


Seal Test			
Leak Location	Appropriate Action		
Open bleeder tool - Lower HPS seal is leaking	Remove Tubing Head and replace leaking seals. Re		
Into the tubing head bore - Upper HPS seal is leaking	land and retest seals		



Stage 12 — Install the Tubing Head

Flange Test

- Locate the remaining flange test fitting on the Tubing Head lower flange and remove the dust cap from the fitting.
- Attach a test pump to the open flange test fitting and inject test fluid into the flange connection until a continuous stream flows from the opposite flange test bleeder tool.
- Close the bleeder tool and continue to pumping test fluid to 5,000 psi or 80% of casing collapse -Whichever is less..
- 4. Hold test pressure for 15 minutes.
- 5. If pressure drops a leak has developed. Take the appropriate action from the adjacent chart.
- 6. Repeat this procedure until a satisfactory test is achieved.
- Once a satisfactory test is achieved, remove the test pump and bleeder tool, drain all test fluid, and reinstall the dust caps.

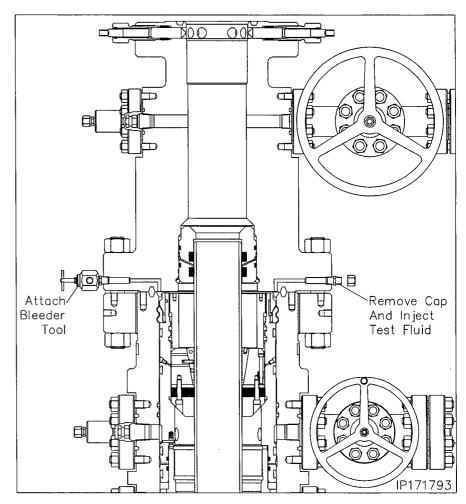

Flange Test			
Leak Location	Appropriate Action		
Between flanges - Ring gasket is leaking	Verify flange bolt torque. If correct, remove tubing head to clean, inspect and possibly replace damaged ring gasket.		

Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal

 Introduction and Scope. The following recommended procedure has been prepared with particular regard to attaining pressure-tight weld when attaching casing heads, flanges, etc., to casing. Although most of the high strength casing used (such as N-80) is not normally considered field weldable, some success may be obtained by using the following or similar procedures.

<u>Caution:</u> In some wellheads, the seal weld is also a structural weld and can be subjected to high tensile stresses. Consideration must therefore be given by competent authority to the mechanical properties of the weld and its heat affected zone.

- a. The steels used in wellhead parts and in casing are high strength steels that are susceptible to cracking when welded. It is imperative that the finished weld and adjacent metal be free from cracks. The heat from welding also affects the mechanical properties. This is especially serious if the weld is subjected to service tension stresses.
- b. This procedure is offered only as a recommendation. The responsibility for welding lies with the user and results are largely governed by the welder's skill. Weldability of the several makes and grades of casing varies widely, thus placing added responsibility on the welder. Transporting a qualified welder to the job, rather than using a less-skilled man who may be at hand, will, in most cases, prove economical. The responsible operating representative should ascertain the welder's qualifications and, if necessary, assure himself by instruction or demonstration, that the welder is able to perform the work satisfactorily.
- 2. Welding Conditions. Unfavorable welding conditions must be avoided or minimized in every way possible, as even the most skilled welder cannot successfully weld steels that are susceptible to cracking under adverse working conditions, or when the work is rushed. Work above the welder on the drilling floor should be avoided. The weld should be protected from dripping mud, water, and oil and from wind, rain, or other adverse weather conditions. The drilling mud, water, or other fluids must be lowered in the casing and kept at a low level until the weld has properly cooled. It is the responsibility of the user to provide supervision that will assure favorable working conditions, adequate time, and the necessary cooperation of the rig personnel.

- Welding. The welding should be done by the shielded metal-arc or other approved process.
- 4. Filler Metal. Filler Metals. For root pass, it's recommended to use E6010, E6011 (AC), E6019 or equivalent electrodes. The E7018 or E7018-A1 electrodes may also be used for root pass operations but has the tendency to trap slag in tight grooves. The E6010, E6011 and E6019 offer good penetration and weld deposit ductility with relatively high intrinsic hydrogen content. Since the E7018 and E7018-A1 are less susceptible to hydrogen induced cracking, it is recommended for use as the filler metal for completion of the weld groove after the root pass is completed. The E6010, E6011 (AC), E6019, E7018 and E7018-A1 are classified under one of the following codes AWS A5.1 (latest edition): Mild Steel covered electrodes or the AWS A5.5 (latest edition): Low Alloy Steel Covered Arc-Welding Electrodes. The low hydrogen electrodes, E7018 and E7018-A1, should not be exposed to the atmosphere until ready for use. It's recommended that hydrogen electrodes remain in their sealed containers. When a job arises, the container shall be opened and all unused remaining electrodes to be stored in heat electrode storage ovens. Low hydrogen electrodes exposed to the atmosphere, except water, for more than two hours should be dried 1 to 2 hours at 600°F to 700 °F (316°C to 371 °C) just before use. It's recommended for any low hydrogen electrode containing water on the surface should be scrapped.
- 5. Preparation of Base Metal. The area to be welded should be dry and free of any paint, grease/oil and dirt. All rust and heat-treat surface scale shall be ground to bright metal before welding.



Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal

- 6. Preheating. Prior to any heating, the wellhead member shall be inspected for the presence of any o-rings or other polymeric seals. If any o-rings or seals are identified then preheating requires close monitoring as noted in paragraph 6a. Before applying preheat, the fluid should be bailed out of the casing to a point several inches (>6" or 150 mm) below the weld joint/location. Preheat both the casing and wellhead member for a minimum distance of three (3) inches on each side of the weld joint using a suitable preheating torch in accordance with the temperatures shown below in a and b. The preheat temperature should be checked by the use of heat sensitive crayons. Special attention must be given to preheating the thick sections of wellhead parts to be welded, to insure uniform heating and expansion with respect to the relatively thin casing.
 - a. Wellhead members containing o-rings and other polymeric seals have tight limits on the preheat and interpass temperatures. Those temperatures must be controlled at 200°F to 325°F or 93 °C to 160°C and closely monitored to prevent damage to the o-ring or seals
 - b. Wellhead members not containing o-rings and other polymeric seals should be maintained at a preheat and interpass temperature of 400°F to 600°F or 200°C to 300°C.
- 7. Welding Technique. Use a 1/8 or 5/32-inch (3.2 or 4.0 mm) E6010 or E7018 electrode and step weld the first bead (root pass); that, weld approximately 2 to 4 inches (50 to 100 mm) and then move diametrically opposite this point and weld 2 to 4 inches (50 to 100 mm) halfway between the first two welds, move diametrically opposite this weld, and so on until the first pass is completed. This second pass should be made with a 5/32-inch (4.0 mm) low hydrogen electrode of the proper strength and may be continuous. The balance of the welding groove may then be filled with continuous passes without back stepping or lacing, using a 3/16-inch (4.8 mm) low hydrogen electrode. All beads should be stringer beads with good penetration. There should be no undercutting and weld shall be workmanlike in appearance.
 - Test ports should be open when welding is performed to prevent pressure buildup within the test cavity.
 - b. During welding the temperature of the base metal on either side of the weld should be maintained at 200 to 300°F (93 to 149°C).
 - c. Care should be taken to insure that the welding cable is properly grounded to the casing, but ground wire should not be welded to the casing or the wellhead. Ground wire should be firmly clamped to the casing, the wellhead, or fixed in position between pipe slips. Bad contact may cause sparking, with resultant hard spots beneath which incipient cracks may develop. The welding cable should not be grounded to the steel derrick, nor to the rotary-table base.


- 8. Cleaning. All slag or flux remaining on any welding bead should be removed before laying the next bead. This also applies to the completed weld.
- Defects. Any cracks or blow holes that appear on any bead should be removed to sound metal by chipping or grinding before depositing the next bead.
- 10. Postheating. Post-heating should be performed at the temperatures shown below and held at that temperature for no less than one hour followed by a slow cooling. The post-heating temperature should be in accordance with the following paragraphs.
 - a. Wellhead members containing o-rings and other polymeric seals have tight limits on the post-heating temperatures. Those temperatures must be controlled at 250°F to 300°F or 120 °C to 150°C and closely monitored to prevent damage to the o-ring or seals.
 - b. Wellhead members not containing o-rings and other polymeric seals should be post-heated at a temperature of 400°F to 600°F or 200°C to 300°C.
- 11. Cooling. Rapid cooling must be avoided. To assure slow cooling, welds should be protected from extreme weather conditions (cold, rain, high winds, etc.) by the use of suitable insulating material. (Specially designed insulating blankets are available at many welding supply stores.) Particular attention should be given to maintaining uniform cooling of the thick sections of the wellhead parts and the relatively thin casing, as the relatively thin casing will pull away from the head or hanger if allowed to cool more rapidly. The welds should cool in air to less than 200°F (93°C) (measured with a heat sensitive crayon) prior to permitting the mud to rise in the casing.
- 12. Test the Weld. After cooling, test the weld. The weld must be cool otherwise the test media will crack the weld. The test pressure should be no more than 80% of the casing collapse pressure.



Cactus Speed Head Pressure Testing Statement

Our procedure is to nipple up BOP's to the surface casing, pressure test the BOP's to 5000 psi high and 250 psi low. We do not anticipate breaking any seals on the BOP from that point until rig release, however if we do break any seal, the entire BOP will be retested to 5000 psi high and 250 psi low.

System Drawing

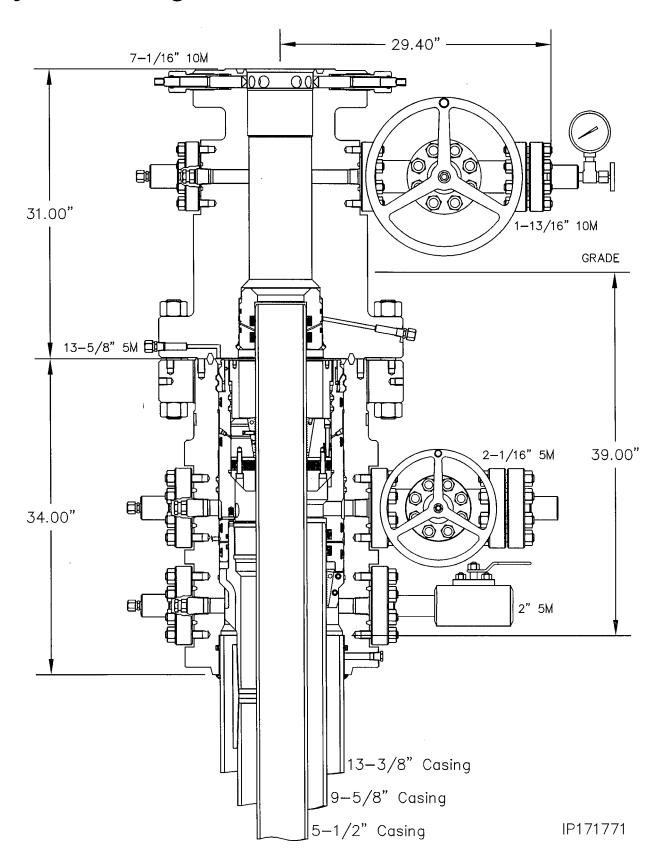



ContiTech

CONTITECH RUBBER Industrial Kft.

No:QC-DB- 247/ 2014

Page: 5/68

INCDECTION AND TEST CEDTICICATE	QUALITY CONTROL				
INSPECTION AND TEST CENTIFICATE	INSPECTION AND TEST CERTIFICATE				

CERT. Nº:

702

PURCHASER:

ContiTech Oil & Marine Corp.

P.O. No:

4500421193

CONTITECH ORDER No:

538448

HOSE TYPE:

ID

Choke & Kill Hose

HOSE SERIAL Nº:

67554

10000

NOMINAL / ACTUAL LENGTH:

10,67 m / 10,66 m

68.9

W.P.

psi T.P. 103,4

MPa

15000

Duration: psi

60

min.

Pressure test with water at ambient temperature

MPa

See attachment. (1 page)

10 mm =

10 Min.

→ 10 mm =

MPa

COUPLINGS Type	Serial Nº		Quality	Heat N°
3" coupling with	1525	1519	AISI 4130	A0579N
4 1/16" 10K API Swivel Flange end			AISI 4130	035608
Hub			AISI 4130	A1126U

Not Designed For Well Testing

API Spec 16 C

Tag No.: 66 - 1225

14. April 2014.

Temperature rate:"B"

All metal parts are flawless

WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDER INSPECTED AND PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT.

STATEMENT OF CONFORMITY: We hereby certify that the above items/equipment supplied by us are in conformity with the terms, conditions and specifications of the above Purchaser Order and that these items/equipment were fabricated inspected and tested in accordance with the referenced standards, codes and specifications and meet the relevant acceptance criteria and design requirements.

Date:

Inspector

Quality Control

Contilech Rubber Industrial Kft. Quality Control B

Page: 1/1

tn +22.42 cr	% b z . 66		1 (m) (m) (1 (m)	Crair	Subject And King
RD +21.81 °C BL +1054. but	17.00 7.00			Secation (or troi Di
RD +21.64 90 9L +1056. bar CN +22 19 00	56			17 and 18	
RD #21.71 90 BL #1057. Bor CN #22.01 90	A-4-4-4				
RD +21.43 °C BL +1058. bar	5 6 6				
RD #21.38 90 BL +1060.bor CN +22.06 90	6.20			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
RD +21-32 90 BL +1063- bac	121-131-1 121-131-1			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
RD +21.31 90 BL #1067. bar	6:08				
11.04.2014. 15: 67542.67548.675	50 54 15450	77			7 12 2
1,1.04.2014. 15: 67542.67548.675	40 11 45				



CONTITECH RUBBER Industrial Kft.

No:QC-DB- 247/ 2014

Page:

6/68

ContiTech

Hose Data Sheet

CRI Order No.	538448
Customer	ContiTech Oil & Marine Corp.
Customer Order No	CBC557116 4500421193
Item No.	1
Hose Type	Flexible Hose
Standard	API SPEC 16 C
Inside dia in inches	3
Length	35 ft
Type of coupling one end	FLANGE 4.1/16" 10KPSI API SPEC 17D SV SWIVEL FLANGE SOURC/W BX155 ST/ST INLAID R.GR.
Type of coupling other end	FLANGE 4.1/16" 10KPSI API SPEC 17D SV SWIVEL FLANGE SOUR C/W BX155 ST/ST INLAID R.GR.
H2S service NACE MR0175	Yes
Working Pressure	10 000 psi
Design Pressure	10 000 psi
Test Pressure	15 000 psi
Safety Factor	2,25
Marking	USUAL PHOENIX
Cover	NOT FIRE RESISTANT
Outside protection	St.steel outer wrap
Internal stripwound tube	No
Lining	OIL + GAS RESISTANT SOUR
Safety clamp	Yes
Lifting collar	Yes
Element C	Yes
Safety chain	Yes
Safety wire rope	No
Max.design temperature [°C]	100
Min.design temperature [°C]	-20
Min. Bend Radius operating [m]	0,90
Min. Bend Radius storage [m]	0,90
Electrical continuity	The Hose is electrically continuous
Type of packing	WOODEN CRATE ISPM-15



CONTITECH RUBBER Industrial Kft.

No:QC-DB- 248 /2013 Page: 5/68

QUALITY CONTROL INSPECTION AND TEST CERTIFICATE

CERT. Nº:

731

PURCHASER:

ContiTech Oil & Marine Corp.

P.O. N°:

4500300249

CONTITECH RUBBER order N°: 536555

HOSE TYPE:

ID

Choke and Kill Hose

HOSE SERIAL No:

65346

psi

NOMINAL / ACTUAL LENGTH:

7,62 m / 7,66 m

W.P. 68,9

MPa

10000

T.P. 103,4

MPa

15000

Duration:

60 min.

Pressure test with water at ambient temperature

See attachment. (1 page)

10 mm =

10 Min.

→ 10 mm =

20 MPa

COUPLINGS Type	Serial N°		Quality	Heat N°
3" coupling with	3428	3433	AISI 4130	A1031U
4 1/16" API 10K Swivel Flange end			AISI 4130	034435 54961
Hub			AISI 4130	A0462U

NOT DESIGNED FOR WELL TESTING

API Spec 16 C

66 - 1042

NBRSN661042

Temperature rate:"B"

All metal parts are flawless

WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDER INSPECTED AND PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT.

STATEMENT OF CONFORMITY: We hereby certify that the above items/equipment supplied by us are in conformity with the terms, conditions and specifications of the above Purchaser Order and that these items/equipment were fabricated inspected and tested in accordance with the referenced standards, codes and specifications and meet the relevant acceptance criteria and design requirements.

Date:

Inspector

Quality Control

Contillech Rubber Industrial Kft.

03. May 2013.

Quality Control Dept.

No: 728,730,731

Page: 1/1

•		Hayn >
2		Contilleça Rubbe
GN	+25-19 °C 18:50	Industrial Kft.
RD	+26.41 °C 18:52	Quality Control Dep
BL		P
GH	+25-20-9C 18:40	
RP BL	+26.46 °C 18.40 +1848. bdr 18.40	
GN RD	+25.22 9C 18:36 +26.46 9C 18:36 +1649. bor 18:36	
BL	+1049- bar 18:30	
GN		
&P		
E .,	126.57 90 11051- bar 18:20	
GN	+25.23 90 18:18 +26.51 90 18:18 +1052. bd+ 18:18	
RD	+25.23 9U 18:00 +26.51 9C 18:00 +1052. Edn 18:00	
BL		
GN BD BD	+25-22 °C 18:00 +26-55 °C 18:00 +1054- bar 18:00	
2 2	+26.55 °C 18:66 +1854. Bar 18:66	
GN		
RD	1026-20 40 755 60 70	
BL	H25-21 90 1026-30 9030 40 17556 60 70	80 90 100
GN.		
設	H26-53 9C 1 17 M	38698
		Good
GN RD	H25-24 90 17:50 Fige 51NRC35069 17:50 16	
RO	#25.24 90 Page Sing 35069 17:30 166 #1063 bd 17:30 16	n-a-10,5
BL	+1063. bar 17:32	
21		
- 1		
652	98,65309,65346 17:10	
02.	98,65309,65346 17:10	
 	<u> </u>	- - ^- - - -
652	98,65309,65346 7-004-7 65.13 17:00	
60.	65. 13 17:00	
فسنسل		<u> </u>
' i		
19		
		<u></u>

CONTITECH RUBBER	No:QC-DB- 248 /2013		
Industrial Kft.	Page:	6 / 68	

©ntinental + CONTITECH

Hose Data Sheet

CRI Order No.	536555
Customer	ContiTech Oil & Marine Corp.
Customer Order No	4500300249 CBC384527
Item No.	1
Hose Type	Flexible Hose
Standard	API SPEC 16 C
Inside dia in inches	3
Length	25 ft
Type of coupling one end	FLANGE 4.1/16" 10KPSI API SPEC 17D SV SWIVEL FLANGEC/W BX155 ST/ST INLAID RING GR
Type of coupling other end	FLANGE 4.1/16" 10KPSI API SPEC 17D SV SWIVEL FLANGE C/W BX155 ST/ST INLAID RING GR
H2S service NACE MR0175	Yes
Working Pressure	10 000 psi
Design Pressure	10 000 psi
Test Pressure	15 000 psi
Safety Factor	2,25
Marking	USUAL PHOENIX
Cover	NOT FIRE RESISTANT
Outside protection	St.steel outer wrap
Internal stripwound tube	No
Lining	OIL RESISTANT
Safety clamp	Yes
Lifting collar	Yes
Element C	Yes
Safety chain	Yes
Safety wire rope	No
Max.design temperature [°C]	100
Min.design temperature [°C]	-20
MBR operating [m]	1,60
MBR storage [m]	1,40
Type of packing	WOODEN CRATE ISPM-15



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

SUPO Data Report

03/21/2019

APD ID: 10400032174

Submission Date: 07/25/2018

Highlighted data reflects the most recent changes

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Show Final Text

Well Type: CONVENTIONAL GAS WELL

Well Work Type: Drill

Section 1 - Existing Roads

Operator Name: CHISHOLM ENERGY OPERATING LLC

Will existing roads be used? YES

Existing Road Map:

BODACIOUS_5_32_FED_COM_WCA_6H_ACCESS_ROUTEMAP_07172018_20180718091525.pdf

Existing Road Purpose: ACCESS,FLUID TRANSPORT

Row(s) Exist? YES

ROW ID(s)

ID: 134601

Do the existing roads need to be improved? NO

Existing Road Improvement Description:

Existing Road Improvement Attachment:

Section 2 - New or Reconstructed Access Roads

Will new roads be needed? NO

Section 3 - Location of Existing Wells

Existing Wells Map? YES

Attach Well map:

BODACIOUS 5 32 FED COM WCA 6H MILE RADIUS 07172018 20180718091856.pdf

Well Name: BODACIOUS 5-32 FED COM WCB Well Number: 6H

Existing Wells description:

Section 4 - Location of Existing and/or Proposed Production Facilities

Submit or defer a Proposed Production Facilities plan? DEFER

Estimated Production Facilities description: If the well is productive, the anticipated facility will consist of a tank battery constructed in accordance with API standards, a flow line will be installed in accordance to the API standards and laid to a 3 phase separator, lines will then be laid from the separator to the tank battery.

Section 5 - Location and Types of Water Supply

Water Source Table

Water source use type: INTERMEDIATE/PRODUCTION CASING,

STIMULATION, SURFACE CASING

Describe type:

Source latitude:

Source longitude:

Water source type: GW WELL

Source datum:

Water source permit type: WATER WELL

Source land ownership: PRIVATE

Water source transport method: PIPELINE

Source transportation land ownership: PRIVATE

Water source volume (barrels): 140000 Source volume (acre-feet): 18.045033

Source volume (gal): 5880000

Water source and transportation map:

Bodacious_5_32_Fed_Com_WCB_6H_Water_Map_20180718093008.pdf

Water source comments: Chisholm Energy Operating, LLC has not chosen a water source at this time. Attached is a map showing the #1 option from where we will receive water at this time.

New water well? NO

New Water Well Info

Well latitude: Well Longitude:

Well datum:

Well target aquifer:

Est. depth to top of aquifer(ft):

Est thickness of aquifer:

Aquifer comments:

Aquifer documentation:

Wall danth (ft). Wall casing type:

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Well casing outside diameter (in.):

Well casing inside diameter (in.):

New water well casing?

Used casing source:

Drilling method:

Drill material:

Grout material:

Grout depth:

Casing length (ft.):

Casing top depth (ft.):

Well Production type:

Completion Method:

Water well additional information:

State appropriation permit:

Additional information attachment:

Section 6 - Construction Materials

Construction Materials description:

Construction Materials source location attachment:

Section 7 - Methods for Handling Waste

Waste type: DRILLING

Waste content description: Drilling Fluids

Amount of waste: 6000

barrels

Waste disposal frequency: Daily

Safe containment description: Steel tanks

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL

Disposal location ownership: COMMERCIAL

FACILITY

Disposal type description:

Disposal location description: Trucked to approved disposal facility. Estimated 6000 bbls total

Waste type: FLOWBACK

Waste content description: Flowback Water

Amount of waste: 25000

barrels

Waste disposal frequency: Daily

Safe containment description: Steel frac tanks

Safe containment attachment:

FACILITY

Disposal type description:

Disposal location description: Haul to approved SWD facility.

Well Name: BODACIOUS 5-32 FED COM WCB Well Number: 6H

Waste type: DRILLING

Waste content description: Cuttings

Amount of waste: 2000 barrels

Waste disposal frequency: Daily

Safe containment description: Steel bins, roll-offs

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL Disposal location ownership: COMMERCIAL

FACILITY

Disposal type description:

Disposal location description: Truck to an approved disposal facility

Waste type: GARBAGE

Waste content description: Trash and debris

Amount of waste: 200 pounds

Waste disposal frequency: Weekly

Safe containment description: Roll-off bin with netted top

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL Disposal location ownership: COMMERCIAL

FACILITY

Disposal type description:

Disposal location description: Truck to commercial waste facility

Waste type: SEWAGE

Waste content description: Human Waste

Amount of waste: 2000 gallons

Waste disposal frequency: Weekly

Safe containment description: Waste will be properly contained and disposed of at a state approve disposal facility

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL Disposal location ownership: COMMERCIAL

FACILITY

Disposal type description:

Disposal location description: Haul to a commercial disposal facility

Reserve Pit

Reserve Pit being used? NO

Temporary disposal of produced water into reserve pit?

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Reserve pit length (ft.)

Reserve pit width (ft.)

Reserve pit depth (ft.)

Reserve pit volume (cu. yd.)

Is at least 50% of the reserve pit in cut?

Reserve pit liner

Reserve pit liner specifications and installation description

Cuttings Area

Cuttings Area being used? NO

Are you storing cuttings on location? NO

Description of cuttings location

Cuttings area length (ft.)

Cuttings area width (ft.)

Cuttings area depth (ft.)

Cuttings area volume (cu. yd.)

Is at least 50% of the cuttings area in cut?

WCuttings area liner

Cuttings area liner specifications and installation description

Section 8 - Ancillary Facilities

Are you requesting any Ancillary Facilities?: NO

Ancillary Facilities attachment:

Comments:

Section 9 - Well Site Layout

Well Site Layout Diagram:

BODACIOUS_5_32_FED_COM_WCA_6H_SITE_MAP_07172018_20180718093320.pdf

Comments:

Well Name: BODACIOUS 5-32 FED COM WCB Well Number: 6H

Section 10 - Plans for Surface Reclamation

Type of disturbance: No New Surface Disturbance Multiple Well Pad Name: BODACIOUS 5-32 FED COM

Multiple Well Pad Number: 4H,5H,6H

Recontouring attachment:

Drainage/Erosion control construction: Drainage systems, if any, will be reshaped to original configuration with provisions made to alleviate erosion.

Drainage/Erosion control reclamation: Any portion of the site that is not needed for future operations will be reclaimed to the original stat as much as feasible.

Well pad proposed disturbance

(acres): 0

Road proposed disturbance (acres): 0

Powerline proposed disturbance

(acres): 0

Pipeline proposed disturbance

(acres): 0

Other proposed disturbance (acres): 0

Total proposed disturbance: 0

Well pad interim reclamation (acres): Well pad long term disturbance

Road interim reclamation (acres):

Powerline interim reclamation (acres):

Pipeline interim reclamation (acres):

Other interim reclamation (acres):

Total interim reclamation:

(acres):

Road long term disturbance (acres):

Powerline long term disturbance

(acres): 0

Pipeline long term disturbance

(acres):

Other long term disturbance (acres):

Total long term disturbance:

Disturbance Comments:

Reconstruction method: The operator plans to drill additional wells on the well pad. Therefore, no interim reclamation is planned at this time. Any portion of the site that is not needed for future operation and production operations will be recontoured to the original state as much as possible.

Topsoil redistribution: After the area has been shaped and contoured, topsoil from the stockpile will be placed over the disturbed area to the extent possible.

Soil treatment: NO treatment necessary.

Existing Vegetation at the well pad: Mesquite, shinnery oak

Existing Vegetation at the well pad attachment:

Existing Vegetation Community at the road: Mesquite, shinner oak

Existing Vegetation Community at the road attachment:

Existing Vegetation Community at the pipeline: Mesquite, shinnery oak

Existing Vegetation Community at the pipeline attachment:

Existing Vegetation Community at other disturbances: None.

Existing Vegetation Community at other disturbances attachment:

Non native seed used? NO

Non native seed description:

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

Will seedlings be transplanted for this project? NO

Seedling transplant description attachment:

Will seed be harvested for use in site reclamation? NO

Seed harvest description:

Seed harvest description attachment:

Seed Management

Seed Table

Seed type: PERENNIAL GRASS Seed source: COMMERCIAL

Seed name: LPC-Seed Mix 2

Source name: Source address:

Source phone:

Seed cultivar:

Seed use location: WELL PAD, WELL PAD

PLS pounds per acre: 5 Proposed seeding season: SPRING

Seed Summary			
Seed Type	Pounds/Acre		

PERENNIAL GRASS

Seed reclamation attachment:

Operator Contact/Responsible Official Contact Info

First Name: Jennifer

Last Name: Elrod

Total pounds/Acre: 5

Phone: (817)953-3728

Email: jelrod@chisholmenergy.com

Seedbed prep: Rip and add topsoil

Seed BMP:

Seed method:

Existing invasive species? NO

Existing invasive species treatment description:

Existing invasive species treatment attachment:

Weed treatment plan description: All areas will be monitored and weeds will be treated.

Well Number: 6H
USFS Ranger District:

Describe:

Surface Owner: BUREAU OF LAND MANAGEMENT, STATE GOVERNMENT

Other surface owner description:

BIA Local Office:

BOR Local Office:

COE Local Office:

Well Name: BODACIOUS 5-32 FED COM WCB

Well Number: 6H

NPS Local Office:

State Local Office: NM SLO

Military Local Office:

USFWS Local Office:

Other Local Office:

USFS Region:

USFS Forest/Grassland:

USFS Ranger District:

Section 12 - Other Information

Right of Way needed? NO

Use APD as ROW?

ROW Type(s):

ROW Applications

SUPO Additional Information: GCP ATTACHED APD RECEIPT ATTACHED

Use a previously conducted onsite? NO


Previous Onsite information:

Other SUPO Attachment

BODACIOUS_5_32_FED_COM_WCA_6H_AERIAL_MAP_07172018_20180718093422.pdf
BODACIOUS_5_32_FED_COM_WCA_6H_LOC_VERIFICATION_07172018_20180718093423.pdf
BODACIOUS_5_32_FED_COM_WCA_6H_VICINITY_MAP_07172018_20180718093424.pdf
GCP_BODACIOUS_5_32_FED_COM_WCB_6H_07252018_20180725133426.pdf
BODACIOUS_ASTEROID_CW_28_33_13_APD_RECEIPT_20180725141209.pdf

IN WITNESS WHEREOF, the undersigned, be adopted the foregoing resolutions effective as	eing the Directors, have approved, consented to and of the date first set forth above.
By: Name: James R. Levy Title: Director	· <u></u>
By:	
By:	
By:	
By: Name: Roger Pinkerton Title: Director	
By: Name: Stephen C. Hurley Title: Director	
By:	

SECTION 5, TOWNSHIP 23 SOUTH, RANGE 26 EAST, N.M.P.M. EDDY COUNTY, STATE OF NEW MEXICO AERIAL ACCESS ROUTE MAP

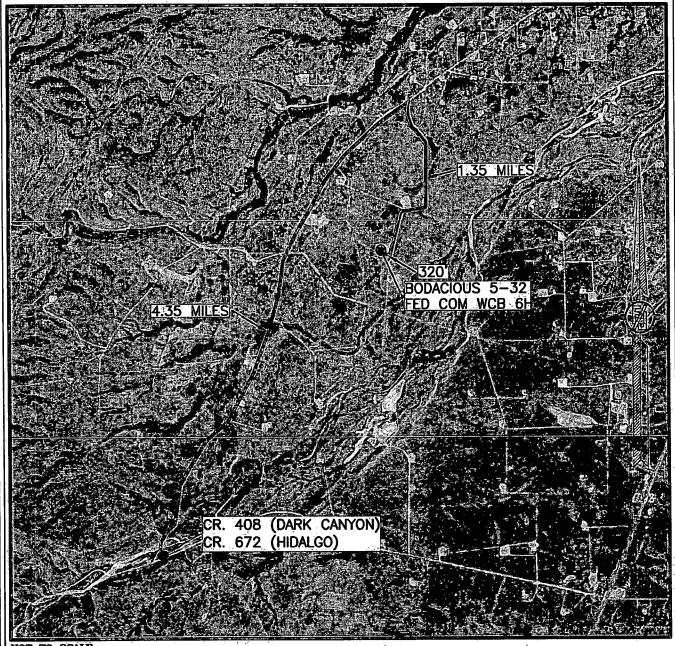


NOT TO SCALE AERIAL PHOTO: GOOGLE BARTH MAR. 2016


CHISHOLM ENERGY OPERATING, LLC
BODACIOUS 5-32 FED COM WCB 6H
LOCATED 230 FT. FROM THE SOUTH LINE
AND 1840 FT. FROM THE EAST LINE OF
SECTION 5, TOWNSHIP 23 SOUTH,
RANGE 26 EAST, N.M.P.M.
EDDY COUNTY, STATE OF NEW MEXICO

MAY 22, 2018

SURVEY NO. 6285


MADRON SURVEYING, INC. 301 SOLITH CARLSBAD, NEW MEXICO

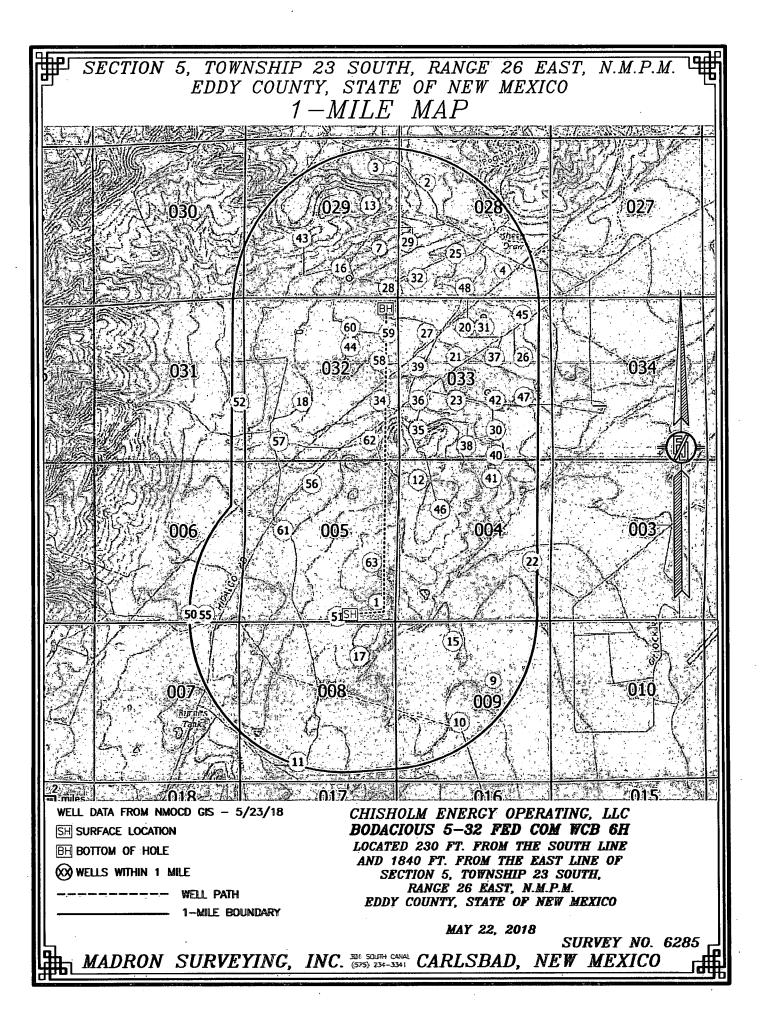

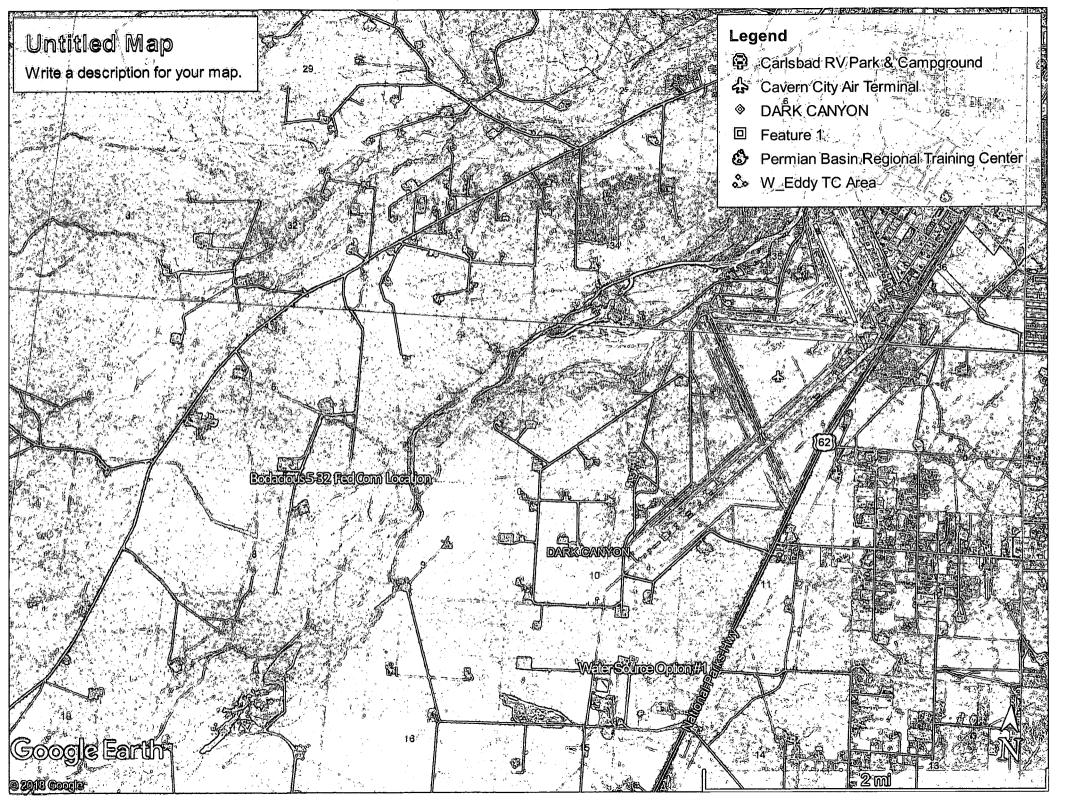

SECTION 5, TOWNSHIP 23 SOUTH, RANGE 26 EAST, N.M.P.M. EDDY COUNTY, STATE OF NEW MEXICO SITE MAP

NOTE: LATITUDE AND LONGITUDE COORDINATES ARE SHOWN USING THE NORTH AMERICAN DATUM OF 1983 (NAD83). LISTED NEW MEXICO STATE PLANE EAST COORDINATES ARE GRID (NAD83). BASIS OF BEARING AND DISTANCES USED ARE NEW MEXICO STATE PLANE EAST COORDINATES MODIFIED TO THE SURFACE. ELEVATION VALUES ARE NAVD 88.

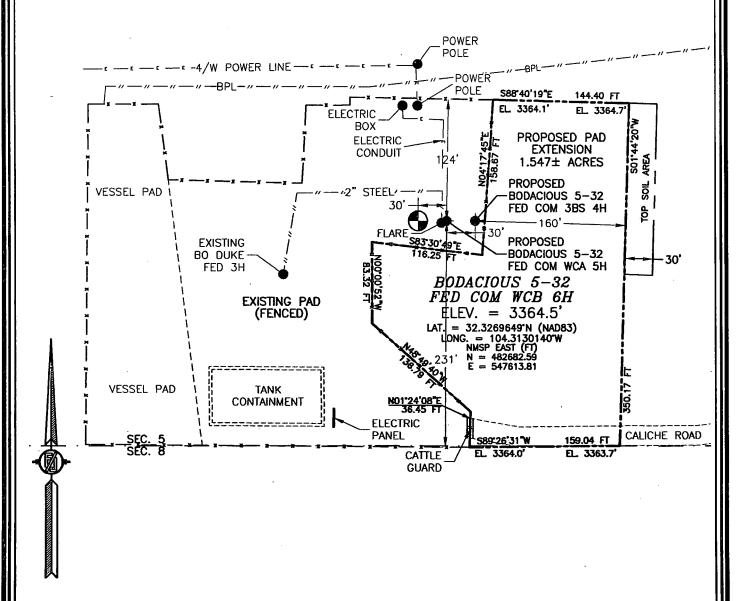

010 50 100 200

SCALE 1" = 100'

DIRECTIONS TO LOCATION

FROM CR. 408 (DARK CANYON) AND CR. 672 (HEDALGO) GO

NORTHEAST ON CR. 672 APPROX. 4.35 MILES, TURN RIGHT

ON CALICHE ROAD AND GO SOUTH AND WEST 1.35 MILES,

TURN RIGHT AND GO WEST 320' TO THE SOUTHEAST

CORNER OF EXISTING PAD AND LOCATION IS 215' NORTH.


CHISHOLM ENERGY OPERATING, LLC
BODACIOUS 5-32 FED COM WCB 6H
LOCATED 230 FT. FROM THE SOUTH LINE
AND 1840 FT. FROM THE EAST LINE OF
SECTION 5, TOWNSHIP 23 SOUTH,
RANGE 26 EAST, N.M.P.M.
EDDY COUNTY, STATE OF NEW MEXICO

MAY 22, 2018

SURVEY NO. 6285

MADRON SURVEYING, INC. SOUTH CANAL CARLSBAD, NEW MEXICO

SECTION 5, TOWNSHIP 23 SOUTH, RANGE 26 EAST, N.M.P.M. EDDY COUNTY, STATE OF NEW MEXICO AERIAL PHOTO

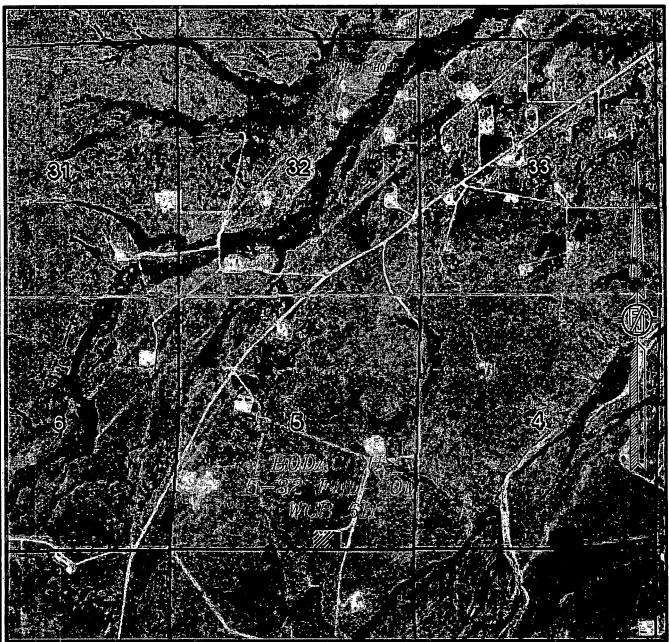

NOT TO SCALE AERIAL PHOTO: GOOGLE EARTH MAR. 2016


CHISHOLM ENERGY OPERATING, LLC
BODACIOUS 5-32 FED COM WCB 6H
LOCATED 230 FT. FROM THE SOUTH LINE
AND 1840 FT. FROM THE EAST LINE OF
SECTION 5, TOWNSHIP 23 SOUTH,
RANGE 26 EAST, N.M.P.M.
EDDY COUNTY, STATE OF NEW MEXICO

MAY 22, 2018

SURVEY NO. 6285

MADRON SURVEYING, INC. 30.1 SOUTH CARLAL CARLSBAD, NEW MEXICO

SECTION 5, TOWNSHIP 23 SOUTH, RANGE 26 EAST, N.M.P.M. EDDY COUNTY, STATE OF NEW MEXICO LOCATION VERIFICATION MAP

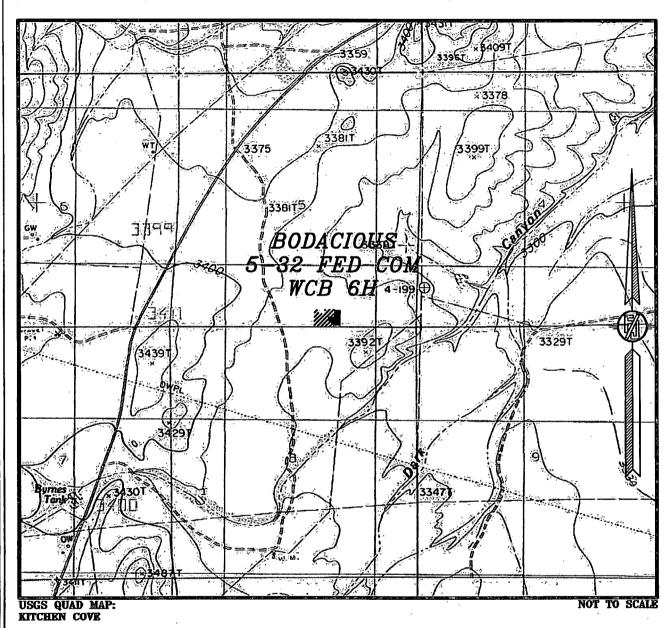


CHISHOLM ENERGY OPERATING, LLC
BODACIOUS 5-32 FED COM WCB 6H
LOCATED 230 FT. FROM THE SOUTH LINE
AND 1840 FT. FROM THE EAST LINE OF
SECTION 5, TOWNSHIP 23 SOUTH,
RANGE 26 EAST, N.M.P.M.
EDDY COUNTY, STATE OF NEW MEXICO

MAY 22, 2018

SURVEY NO. 6285

MADRON SURVEYING, INC. 30th SOLUTH CARAL CARLSBAD, NEW MEXICO

SECTION 5, TOWNSHIP 23 SOUTH, RANGE 26 EAST, N.M.P.M. EDDY COUNTY, STATE OF NEW MEXICO VICINITY MAP

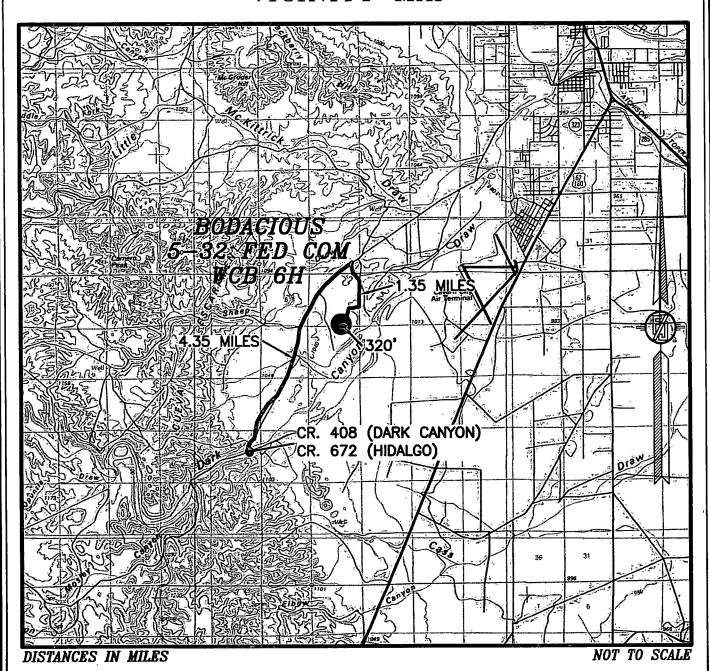

DIRECTIONS TO LOCATION

FROM CR. 408 (DARK CANYON) AND CR. 672 (HIDALGO) GO NORTHEAST ON CR. 672 APPROX. 4.35 MILES, TURN RIGHT ON CALICHE ROAD AND GO SOUTH AND WEST 1.35 MILES, TURN RIGHT AND GO WEST 320' TO THE SOUTHEAST CORNER OF EXISTING PAD AND LOCATION IS 215' NORTH.

CHISHOLM ENERGY OPERATING, LLC
BODACIOUS 5-32 FED COM WCB 6H
LOCATED 230 FT. FROM THE SOUTH LINE
AND 1840 FT. FROM THE EAST LINE OF
SECTION 5, TOWNSHIP 23 SOUTH,
RANGE 26 EAST, N.M.P.M.
EDDY COUNTY, STATE OF NEW MEXICO

MAY 22, 2018

SURVEY NO. 6285

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO



Receipt

Your payment is submitted

Pay.gov Tracking ID: 26B665Q1 Agency Tracking ID: 75537646408

Form Name: Bureau of Land Management (BLM) Application for Permit to Drill (APD) Fee

Application Name: BLM Oil and Gas Online Payment

Payment Information

Payment Type: Bank account (ACH)
Payment Amount: \$68,530.00

Transaction Date: 07/25/2018 04:09:27 PM EDT

Payment Date: 07/26/2018

Company: CHISHOLM ENERGY OPERATING, LLC

APD IDs: 10400032174, 10400032218, 10400032219, 10400032423, 10400032424, 10400032426, 10400032427

Lease Numbers: NMNM097120, NMNM097120, NMNM097120, NMNM070200, NMNM070200, NMNM070200,

NMNM113944

Well Numbers: 6H, 5H, 4H, 3H, 2H, 1H, 13H

Note: You will need your Pay.gov Tracking ID to complete your APD transaction in AFMSS II. Please ensure you write

this number down upon completion of payment.

Account Information

Account Holder Name: CHISHOLM ENERGY OPERATING, LLC

Routing Number: 114000093 Account Number: ********4470

Email Confirmation Receipt

Confirmation Receipts have been emailed to:

jelrod@chisholmenergy.com

amccullough@chisholmengergy.com

BUREAU OF LAND MANAGEMENT

Section 1 - General

Would you like to address long-term produced water disposal? NO

Section 2 - Lined Pits

Would you like to utilize Lined Pit PWD options? NO

Produced Water Disposal (PWD) Location:

PWD surface owner:

PWD disturbance (acres):

Lined pit PWD on or off channel:

Lined pit PWD discharge volume (bbl/day):

Lined pit specifications:

Pit liner description:

Pit liner manufacturers information:

Precipitated solids disposal:

Decribe precipitated solids disposal:

Precipitated solids disposal permit:

Lined pit precipitated solids disposal schedule:

Lined pit precipitated solids disposal schedule attachment:

Lined pit reclamation description:

Lined pit reclamation attachment:

Leak detection system description:

Leak detection system attachment:

Lined pit Monitor description:

Lined pit Monitor attachment:

Lined pit: do you have a reclamation bond for the pit?

Is the reclamation bond a rider under the BLM bond?

Lined pit bond number:

Section 3 - Unlined Pits

Produced Water Disposal (PWD) Location:

Injection PWD discharge volume (hhl/day).

PWD surface owner:

Would you like to utilize Unlined Pit PWD options? NO

Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Unlined pit PWD on or off channel:	
Unlined pit PWD discharge volume (bbl/day):	
Unlined pit specifications:	
Precipitated solids disposal:	
Decribe precipitated solids disposal:	
Precipitated solids disposal permit:	
Unlined pit precipitated solids disposal schedule:	
Unlined pit precipitated solids disposal schedule attachment:	
Unlined pit reclamation description:	
Unlined pit reclamation attachment:	
Unlined pit Monitor description:	
Unlined pit Monitor attachment:	
Do you propose to put the produced water to beneficial use?	
Beneficial use user confirmation:	
Estimated depth of the shallowest aquifer (feet):	
Does the produced water have an annual average Total Dissol that of the existing water to be protected?	ved Solids (TDS) concentration equal to or less than
TDS lab results:	
Geologic and hydrologic evidence:	
State authorization:	
Unlined Produced Water Pit Estimated percolation:	
Unlined pit: do you have a reclamation bond for the pit?	
Is the reclamation bond a rider under the BLM bond?	
Unlined pit bond number:	
Unlined pit bond amount:	
Additional bond information attachment:	
Section 4 - Injection	
Would you like to utilize Injection PWD options? NO	•

PWD disturbance (acres):

	,
Injection well type:	
Injection well number:	Injection well name:
Assigned injection well API number?	Injection well API number:
Injection well new surface disturbance (acres):	
Minerals protection information:	
Mineral protection attachment:	
Underground Injection Control (UIC) Permit?	
UIC Permit attachment:	
Section 5 - Surface Discharge	
Would you like to utilize Surface Discharge PWD options? NO	
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Surface discharge PWD discharge volume (bbl/day):	
Surface Discharge NPDES Permit?	
Surface Discharge NPDES Permit attachment:	
Surface Discharge site facilities information:	
Surface discharge site facilities map:	•
Section 6 - Other	
Would you like to utilize Other PWD options? NO	
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Other PWD discharge volume (bbl/day):	
Other PWD type description:	
Other PWD type attachment:	
Have other regulatory requirements been met?	
Other regulatory requirements attachment:	



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Bond Info Data Report

03/21/2019

Bond Information

Federal/Indian APD: FED

BLM Bond number: NMB001468

BIA Bond number:

Do you have a reclamation bond? NO

Is the reclamation bond a rider under the BLM bond?

Is the reclamation bond BLM or Forest Service?

BLM reclamation bond number:

Forest Service reclamation bond number:

Forest Service reclamation bond attachment:

Reclamation bond number:

Reclamation bond amount:

Reclamation bond rider amount:

Additional reclamation bond information attachment:

	,			
		' '	(9	
			,	
			. •	
				ı
			·	