DEPARTMENT OF THE INTERIOR ANISONAL FIELD BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well					8. Well Name and No. GOVERNMENT AB FEDERAL 13	
2. Name of Operator Contact: DAVID STEWART					9. API Well No. 30-015-40920-00-S1	
OXY USA WTP LIMITED PTNRSHIP E-Mail: david_stewart@oxy.com						
3a. Address 3b. Phone No. Ph: 432-68			(include area code) 10: Field and Pool or Exploratory Area OLD MILLMAN RANCH			r Exploratory Area
HOUSTON, TX 77210	F11. 432-003-3					
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State	
Sec 10 T20S R28E SENW 2135FNL 1725FWL					EDDY COUNTY, NM	
12. CHECK THE AF	PPROPRIATE BOX(ES) T	O INDICATE	NATURE OI	F NOTICE, F	REPORT, OR OT	THER DATA
TYPE OF SUBMISSION TYPE OF ACTION						
	☐ Acidize ☐ Deepen ☐ Pro		☐ Production	n (Start/Resume)	☐ Water Shut-Off	
☐ Notice of Intent	Alter Casing	<u> </u>		☐ Reclamat	•	☐ Well Integrity
Subsequent Report	Casing Repair	☐ New Co	_	Recomplete		Other
☐ Final Abandonment Notice	☐ Change Plans				rily Abandon	
_	Convert to Injection	vert to Injection Plug Back Wat		□ Water Di	sposal	
following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. TD-6710' PBTD-5980' Perfs-6353-6494' CIBP-6320' OXY USA WTP LP respectfully requests to temporarily abandon this well. It is currently being evaluated for future recompletion in the Delaware. 3/20/19 MIRU PU, pump 10# BW to attempt kill well.						
3/21/19 M&P 12# mud, attempt to load and test. Rel pump, start to POOH & LD rods.						RECEIVED
3/22/19 Continue to POOH & LD rods. ND WH, NU BOP, start to POOH, LD & scan tbg. 3/25/19 Pump 14# slug tbg, contiune to POOH, LD and scan tbg. RIH w/ guage ring to 6320' w/ TA Status Approved till 2/21/2020						
	I A Status Ap	provea tiii.	2/21/20	20	DISTRI	CT II-ARTESIA O.C.D.
	#4 Electronic Submission For OXY USA WTF nmitted to AFMSS for proce	P LIMITED PTNR	SHIP, sent to LLA PEREZ o	the Carlsbad	19PP1068SE)	
Name (Printed/Typed) DAVID STEWART			uc SN. NE	GOLATORT	ADVISOR	
Signature (Electronic	Submission)	Da	nte 04/04/2	019		
	THIS SPACE FO	R FEDERAL	OR STATE	OFFICE US	E	,
Approved By				ted for F		APR 1 0 2019
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Jonathon Shepard Carlsbad Field Office			
Title 18 U.S.C. Section 1001 and Title 43	U.S.C. Section 1212, make it a c	crime for any person	n knowingly and	l willfully to mal	ke to any department	or agency of the United

Additional data for EC transaction #460361 that would not fit on the form

32. Additional remarks, continued


obstructions, POOH. RIH w/ tbg & set CIBP @ 6320'.

3/26/19 Circ hole w/ pkr fluid, load & test CIBP to 500# for 30 min, tested good. M&P 35sx CL C cmt, PUH, WOC.

3/27/19 Notified BLM of MIT. RIH w/ tbg & tag cmt @ 5980', POOH & LD tbg. ND BOP, NU WH & flange. RU chart, run 30min MIT test to 535#.

3/28/19 RDPU.

OXY USA WTP LP - Current Government AB #13 API No. 30-015-40920

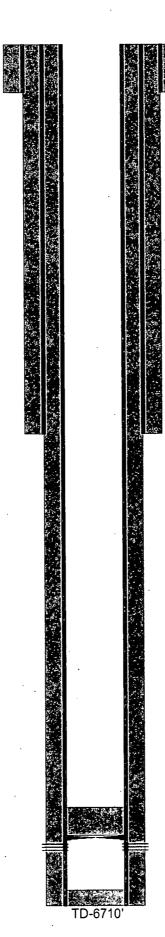

14-3/4" hole @ 374' 11-3/4" csg @ 374' w/ 320sx-TOC-Surf-Circ

10-5/8" hole @ 3040' 8-5/8" csg @ 3040' w/ 2375sx-TOC-Surf-Circ

7-7/8" hole @ 6710' 5-1/2" csg @ 6710' w/ 930sx-TOC-Surf-Circ

Perfs @ 6353-6494'

CIBP @ 6320' w/ 35sx to 5980' - Tagged

PB-6667'

