


Form 3160-5 (June 2015) DE BU SUNDRY Do not use thi abandoned we	enter an		FORM APPROVED OMB NO 1004 0137 Expires January 31, 2018 5 Lease Serial No NMLC028731A 6 If Indian Allottee or Tribe Name				
SUBMIT IN TRIPLICATE - Other instructions on page 2					7 If Unit or CA/Agreement, Name and/or No NMNM111789X		
1 Type of Well S Oil Well Gas Well Other					8 Well Name and No DODD FEDERAL UNIT 72		
2 Name of Operator Contact ABIGAIL ANDERSON COG OPERATING LLC E-Mail abbym@bcmandassociates com					9 API Well No 30-015-30153-0	9 API Well No 30-015-30153-00-S1	
			(include area code) 10 Field and		10 Field and Pool or		
4 Location of Well (Footage Sec T R M or Survey Description)				·	11 County or Parish	unty or Parish State	
Sec 22 T17S R29E SENE 208			EDDY COUNTY	Y, NM			
12 CHECK THE AF	PROPRIATE BOX(ES)	TO INDICAT	E NATURE O	F NOTICE	, REPORT, OR OTH	HER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	of Intent		en	Produc	tion (Start/Resume)	UWater Shut-Off	
- /	Alter Casing	🗖 Hydr	Hydraulic Fracturing		nation	Well Integrity	
Subsequent Report	Casing Repair	🗖 New	Construction	🗖 Recom	plete	🗖 Other	
Final Abandonment Notice	 Change Plans Convert to Injection 		and Abandon Back	Tempo Water	orarily Abandon Disposal		
 13 Describe Proposed or Completed Opt If the proposal is to deepen directional Attach the Bond under which the woi following completion of the involved testing has been completed Final At determined that the site is ready for final 1 Set 5 1/2" CIBP @ 3975' C WOC & Tag (DV Tool) 2 Spot 25 sx cmt @ 2550-240 	Illy or recomplete horizontally, k will be performed or provide operations If the operation re vandonment Notices must be fil nal inspection irculate hole w/ MLF Pre	, give subsurface 1 2 the Bond No on 2 sults in a multiple led only after all n	ocations and measu file with BLM/BIA completion or reco equirements includ	ared and true v A Required stompletion in a ling reclamati	ertical depths of all pertin ubsequent reports must be new interval, a Form 316 on have been completed	nent markers and zones filed within 30 days 50-4 must be filed once and the operator has RECENED	
3 Spot 25 sx cmt @ 2552-700 WOC & Tag (B/Salt & 8 5/8" Shoe) 4 Spot 50 sx cmt @ 365-Surface (T/Salt & 13 3/8" Shoe **Holes in 5 1/2" csg @ +/- 13')** 5 Cut off well head, verify cmt to surface, weld on Below Ground Dry Hole M					വര	JUL 8 1 2019	
					DISTRICTI-ARTESIAO.C SEE ATTACHED FOR		
alle					ALL ALLAUHE	UFOR	
	(, c. Accept	ed for necord	. NMOCD	(ONDITIONS (OF APPROVAL	
14 I hereby certify that the foregoing is	Electronic Submission #	OPERATING LL	C. sent to the C	arisbad			
Name (Printed/Typed) ABIGAIL	Title, REGUL	ATORY		<u> </u>			
Signature (Electronic S	Date 07/10/2	2019					
	THIS SPACE F	OR FEDERA	L OR STATE	OFFICE (JSE	_	
Approved By Lames Q. amo			Title St	ÉT		7.20-19 Date	
Conditions of approval, if any are attached Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon			Office	<i>20</i>			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent					nake to any department of	r agency of the United	
(Instructions on page 2)	ISED ** BLM REVISE	·····			D ** BLM REVISE	D **	

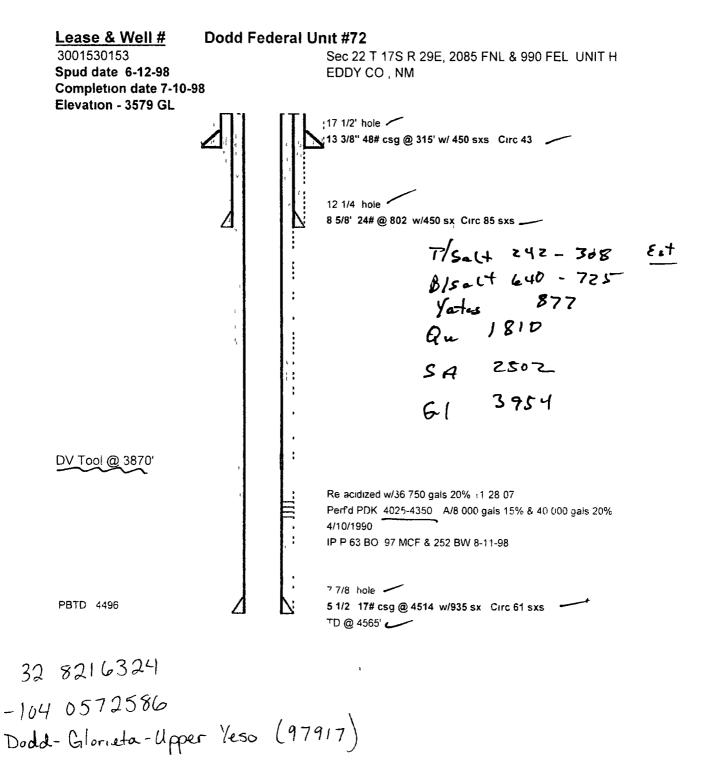


C Msers'BCM'AppDatal ceal Microsoft Windows/INciC uche Content Outlook/LTMTU9 MM/Dodd. Unit 72 WBS (2)

7/10/2619

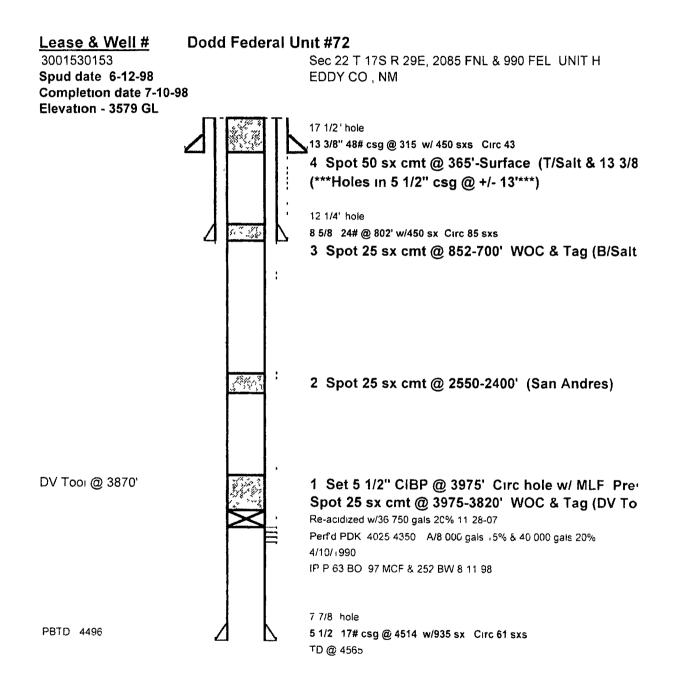

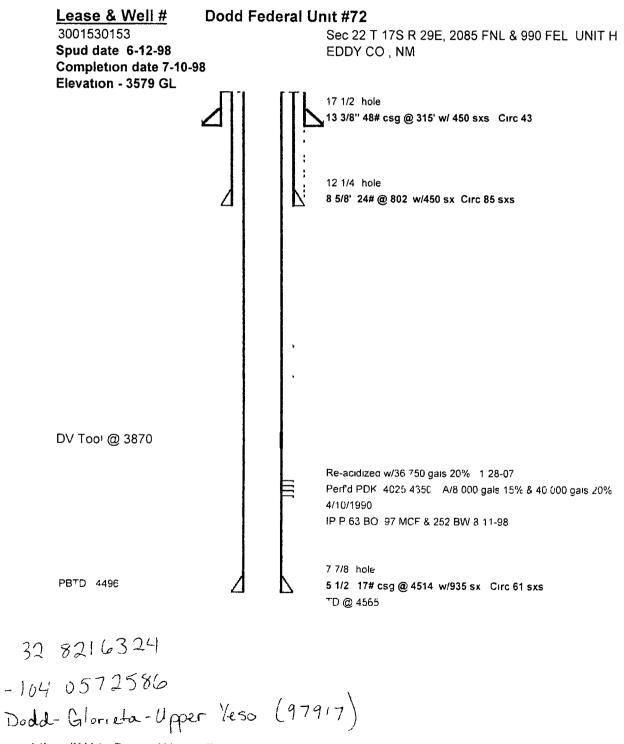

Chusers/BCM/AppDatou och Microsoft Windows LietCiele Conjent On Jook LTM1//84A0/0 wid 1/11/72/WBS (2)

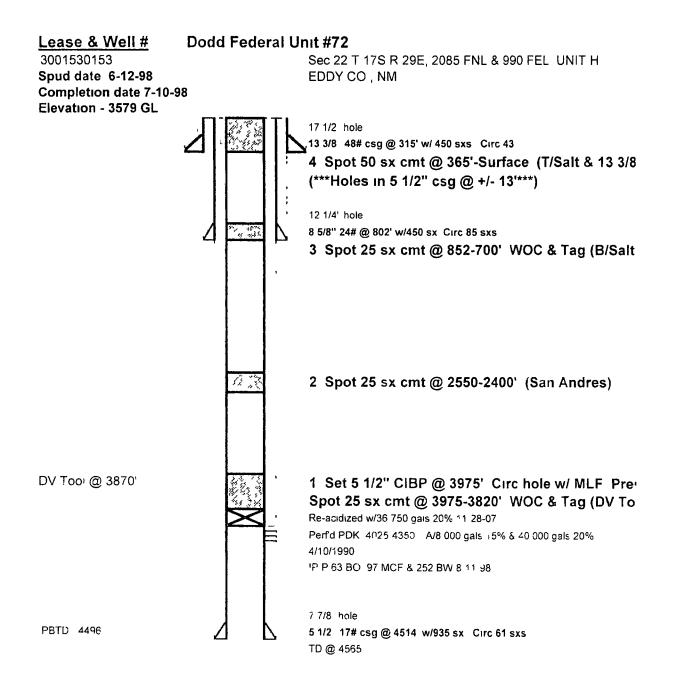

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163 1

1 Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged Failure to do so will result in enforcement action

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer Failure to do so may result in enforcement action

2 <u>Notification</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations For wells in Chaves and Roosevelt County call 575-627-0272, Eddy County, call 575-361-2822, Lea County call 575-393-3612

3 <u>Blowout Preventers</u> A blowout preventer (BOP) as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9 090 feet a CM system for a well not deeper than 13,636 feet and a 5M system for a well not deeper than 22,727 feet

⁴ <u>Mud Requirement</u> Mud shall be placed between all plugs Millimum consistency of plugging mud shall be obtained by mizing at the rate of 25 sacks (50 pounds each) of ge per 100 barrels of brime water Minimum nine (9) pounds per gailon

5 <u>Cement Requirement</u> Sufficient cement shall be used to bring any required plug to the specified depth and ler gth. Any given cement volumes on the proposed plugging procedule are merely estimates and are not final. Unless specific approval is received no plug except the suiface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In neu of a cement plug across perforations in a cased hole (not for an / other plugs) a pridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a patter is used to cap his plug 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP (ag will be required to verify depth. Based on depth a tag of the cement may be deemed necessary. Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs

6 <u>Dry Hole Marker</u> All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper) The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off

The well bore shall then be capped with a 4-inch pipe, 10-feet in length 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached) The following information shall be permanently inscribed on the dry hole marker well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds)

7 <u>Subsequent Plugging Reporting</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well <u>Show date well was plugged</u>

8 <u>Trash</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill Burial on site is not permitted

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required See attached reclamation objectives

1

c