Form 3160-5 (June 2015)

### UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

**OCD** Artesia

FORM APPROVED

OMB NO. 1004-0137	
Expires: January 31, 20	18

SUNDRY NOTICES AND REPORTS ON WELLS	
Do not use this form for proposals to drill or to re-enter a	n
shandoned well. Use form 3160-3 (APD) for such proposal	le

5. Lease Serial No. NMNM15295

abandoned we	6. If Indian, Allottee of	6. If Indian, Allottee or Tribe Name				
SUBMIT IN	7. If Unit or CA/Agre	7. If Unit or CA/Agreement, Name and/or No.				
1. Type of Well	8. Well Name and No. CK FEDERAL 3	8. Well Name and No.				
Oil Well Gas Well Oth  Oth  Name of Operator		IAN COVARRUBIAS	9. API Well No.			
MARATHON OIL PERMIAN L		30-015-32947-00-S1				
		Phone No. (include area code) 8067526153		10. Field and Pool or Exploratory Area WHITE CITY-WOLFCAMP		
4. Location of Well (Footage, Sec., T		11. County or Parish,	11. County or Parish, State			
Sec 8 T24S R26E NWNE 1225FNL 1400FEL			EDDY COUNT	Y, NM		
12. CHECK THE AI	PPROPRIATE BOX(ES) TO I	NDICATE NATURE OF	NOTICE, REPORT, OR OTI	HER DATA		
TYPE OF SUBMISSION		TYPE OF ACTION				
■ Notice of Intent	☐ Acidize	□ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off		
	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity		
☐ Subsequent Report	☐ Casing Repair	■ New Construction	☐ Recomplete	☐ Other		
☐ Final Abandonment Notice	☐ Change Plans	☑ Plug and Abandon	☐ Temporarily Abandon			
13. Describe Proposed or Completed Ope	Convert to Injection	☐ Plug Back	☐ Water Disposal			
following completion of the involved testing has been completed. Final At determined that the site is ready for f.  1) Set CIBP @ 11,600 20 20 20 21 21 22 21 22 22 22 23 25 24 24 25 25 24 25 25 25 25 25 25 25 25 25 25 25 25 25	operations. If the operation results in pandonment Notices must be filed onlinal inspection.  1,600' - T/11,384'  11,208' - T/10,995'; WOC and tagger of the filed onlinal inspection.  10,438' - T/10,233'; WOC and tagger of the filed onlinal inspection.  10,438' - T/10,233'; WOC and tagger of the filed online inspection.  10,438' - T/19,66'; WOC and tagger of the filed online inspection.  10,438' - T/1,966'; WOC and tagger of the filed online inspection.  10,438' - T/1,868'; WOC and tagger of the filed online inspection.  11,500' - T/1,385'; WOC and tagger of the filed online inspection.  12,500' - T/1,385'; WOC and tagger of the filed online inspection.	n a multiple completion or recory after all requirements, including the state of th	SEE ATTACHED CONDITIONS OF	FOR		
	Electronic Submission #48258	. PERMIAN LLC, sent to th g by PRISCILLA PEREZ or	Information System e Carlsbad	CEIVED		
Signature (Electronic S	Submission)	Date 09/10/20	110			
Creedonic I		EDERAL OR STATE				
	00		A _	91119		
Approved By Lam	es 6. lines	Title	T	9-21-19 Date		
Conditions of approval, if any, are attache certify that the applicant holds legal or equivalent would entitle the applicant to conditions.	uitable title to those rights in the subject operations thereon.	oct lease Office CFC	)			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a crime statements or representations as to any	for any person knowingly and matter within its jurisdiction.	willfully to make to any department or	agency of the United		

<sup>(</sup>Instructions on page 2) \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*



## Additional data for EC transaction #482581 that would not fit on the form

#### 32. Additional remarks, continued


13) Install Dry Hole Maker

Close Loop. All fluids to licensed facility. P&A mud between all plugs.



# Wellbore Schematic Well Name: C K FEDERAL 3

State/Province NEW MEXICO Country UNITED STATES ield Name Latitude (°) 32.23596000 North/South Distance (ft) North/South Reference 104.31101300 1,225.0 **FNL** PI/ IPO UWI KB-Ground Distance (ft) Ground Elevation (ft) KB-Mud Line Distance (ft) Well First Production Date Drilling Rig Spud Date Well Original Completion Date 3001532947 18:00 1/1/2004 3,483.00

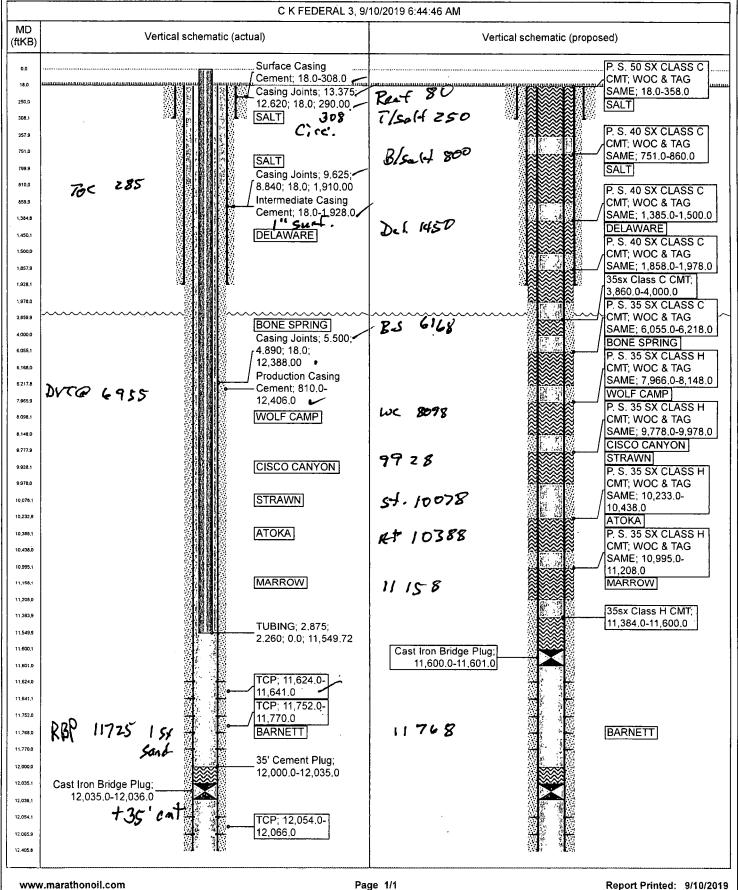

### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

### Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3 <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.