

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

AUG - 4 2009

FORM APPROVED
OMB No. 1004-0137
Expires: July 31, 2010

RM

OCD-ARTESIA

Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

(NMLC029339A)

6. If Indian, Allottee or Tribe Name

891008670

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

GJSAU #16

9. API Well No.

30-015-04135S1

10. Field and Pool, or Exploratory Area

GRAYBURG JACKSON SAN ANDRES

11. County or Parish, State
Eddy County, N.M.**SUBMIT IN TRIPLICATE - Other instructions on page 2**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

BURNETT OIL CO., INC.

3a. Address 801 CHERRY STREET, SUITE 1500

3b. Phone No. (include area code)

UNIT #9 FORT WORTH, TX. 76102-6881

(817) 332-5108

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UNIT I, 1980' FSL. 660' FEL. SEC 13. T17S. R30E- SURF & BHL

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input checked="" type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

2/20/2009 Notify BLM Richard Carrasco and NMOCD Mike Bratcher to begin P&A. 2/23/09 MIRU, NU BOP, GIH w/7" csg scraper, stuck @ 359'. Load hole, still could not pull w/30,00#. 2/24 Chemical cut tbg @ 334'. Tag @ 332' & wash down to top of fish. 2/25 Tag fish @ 480', POOH w/fish. GIH, tag fish @ 515', push down hole to 1116'. 2/26 Run csg image log from 1100' to surface. 2/27-3/2 Run 6-1/8" mills, clean out bridges down to 2806'. Set pkr @ 2772' establish pump in rate & POOH w/pkr. Set cmt retainer @ 2772' pump 100 sks Class "C" cement w/8 sks left on top of cmt ret. LD 1 jt tbg, pump 28 bbls 9.5 gel. POOH, RU W/L unit, tag @ 2748', pull up to 1338 & perforate csg. Run & set pkr @ 1050', pump 75 sks Class C cmt. 3/3 Pkr stuck, RU W/L, tag cmt @ 2654. pump 100 sks Class C cmt. WOC 5 hrs. Tag cmt @ 1058'. Ran Free point, tbg 100% stuck @ 7' above pkr. Chemical cut tbg @ 16' above pkr(1034') & POOH. Run W/L to 606', perforate. RIH w/pkr to 385' & set. Pump 20 bbls wtr down, no communication up hole. Pump 75 sks Class C cement, WOC 6 hrs. 3/4 Release pkr, tag cmt @ 435', RU W/L, shoot squeeze holes @ 60', unable to circ. Pump 75 sks Class C cmt, WOC 6 hrs. Unable to circ wtr, pump 50 sks Class C cmt plug to bring to surface, cement fell back some. Mix & pump 75 sks Class C cement. Have cement back to surface 5:09 PM 3/04/2009. Was witnessed by BLM's Darrell Carter. 4/07/2009 Remove all surface equipment, installed P&A marker as required, restore Location. 4/08/2009 This location is ready for BLM final inspection. 6/24/2009 BLM's Jennifer Vancuren approved location as ready to reseed in season.

14. I hereby certify that the foregoing is true and correct.)


Name (Printed/Typed)

MARK A. JACOBY

ENGINEERING MANAGER

Title

Signature

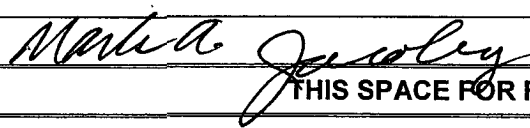

Date

6/24/2009

ACCEPTED FOR RECORD

JUL 31 2009

/s/ Chris Walls

BUREAU OF LAND MANAGEMENT

CARLSBAD FIELD OFFICE

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Date

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)