

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

SFP 28 2009

Form C-103
June 19, 2008

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-20172
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator MOMENTUM OPERATING CO., INC.		6. State Oil & Gas Lease No.
3. Address of Operator P O BOX 2439 ALBANY, TX 76430		7. Lease Name or Unit Agreement Name GULF
4. Well Location Unit Letter 990 : feet from the NORTH line and 330 feet from the EAST line Section 28 Township 18S Range 31E NMPM EDDY County		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3634 GL		9. OGRID Number 020451
		10. Pool name or Wildcat SHUGART Y-SR-OU-GB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

**Notify OCD 24 hrs. prior
To any work done.**

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

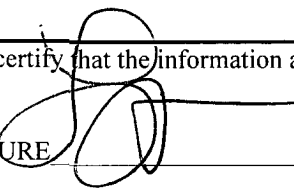
- * 1. SET 5 1/2" CEMENT RETAINER @ 3200', STING TUBING INTO RETAINER AND PUMP 125 SKS CEMENT UNSTING AND PUMP 25 SKS CEMENT ON TOP OF RETAINER. CIRCULATE WELL WITH PXA MUD.
- * 2. PERFORATE AND ATTEMPT TO SQUEEZE A 40 SACK CEMENT PLUG @ 1995-1895 - Tag
- * 3. PERFORATE AND ATTEMPT TO SQUEEZE AN 40 SACK CEMENT PLUG @ 750-650 - Tag?
- * 4. PERFORATE AND ATTEMPT TO SQUEEZE TO SURFACE A 200 SACK CEMENT PLUG @ 830-830 (8 5/8 CASING SHOE AND SURFACE PLUG) 877'-0'
5. DIG OUT AND CUT OFF WELL HEAD 3' B.G.L.; WELD ON STEEL PLATES & DRY HOLE MARKER.

* NO Cement Retainer. - A CIBP w/ 35' cmt on Top. must be placed with in 100' of Top perforations or a 100' cmt plug placed with in 100' of Top Perfs. cmt plug has to be Tagged.

Spud Date: 9/29/09


Rig Release Date: 10/06/09

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE TREASURER DATE 9-25-09

Type or print name LYNN NEFF E-mail address: NEFFLYNN@AOL.COM PHONE: 325 762-3331

For State Use Only

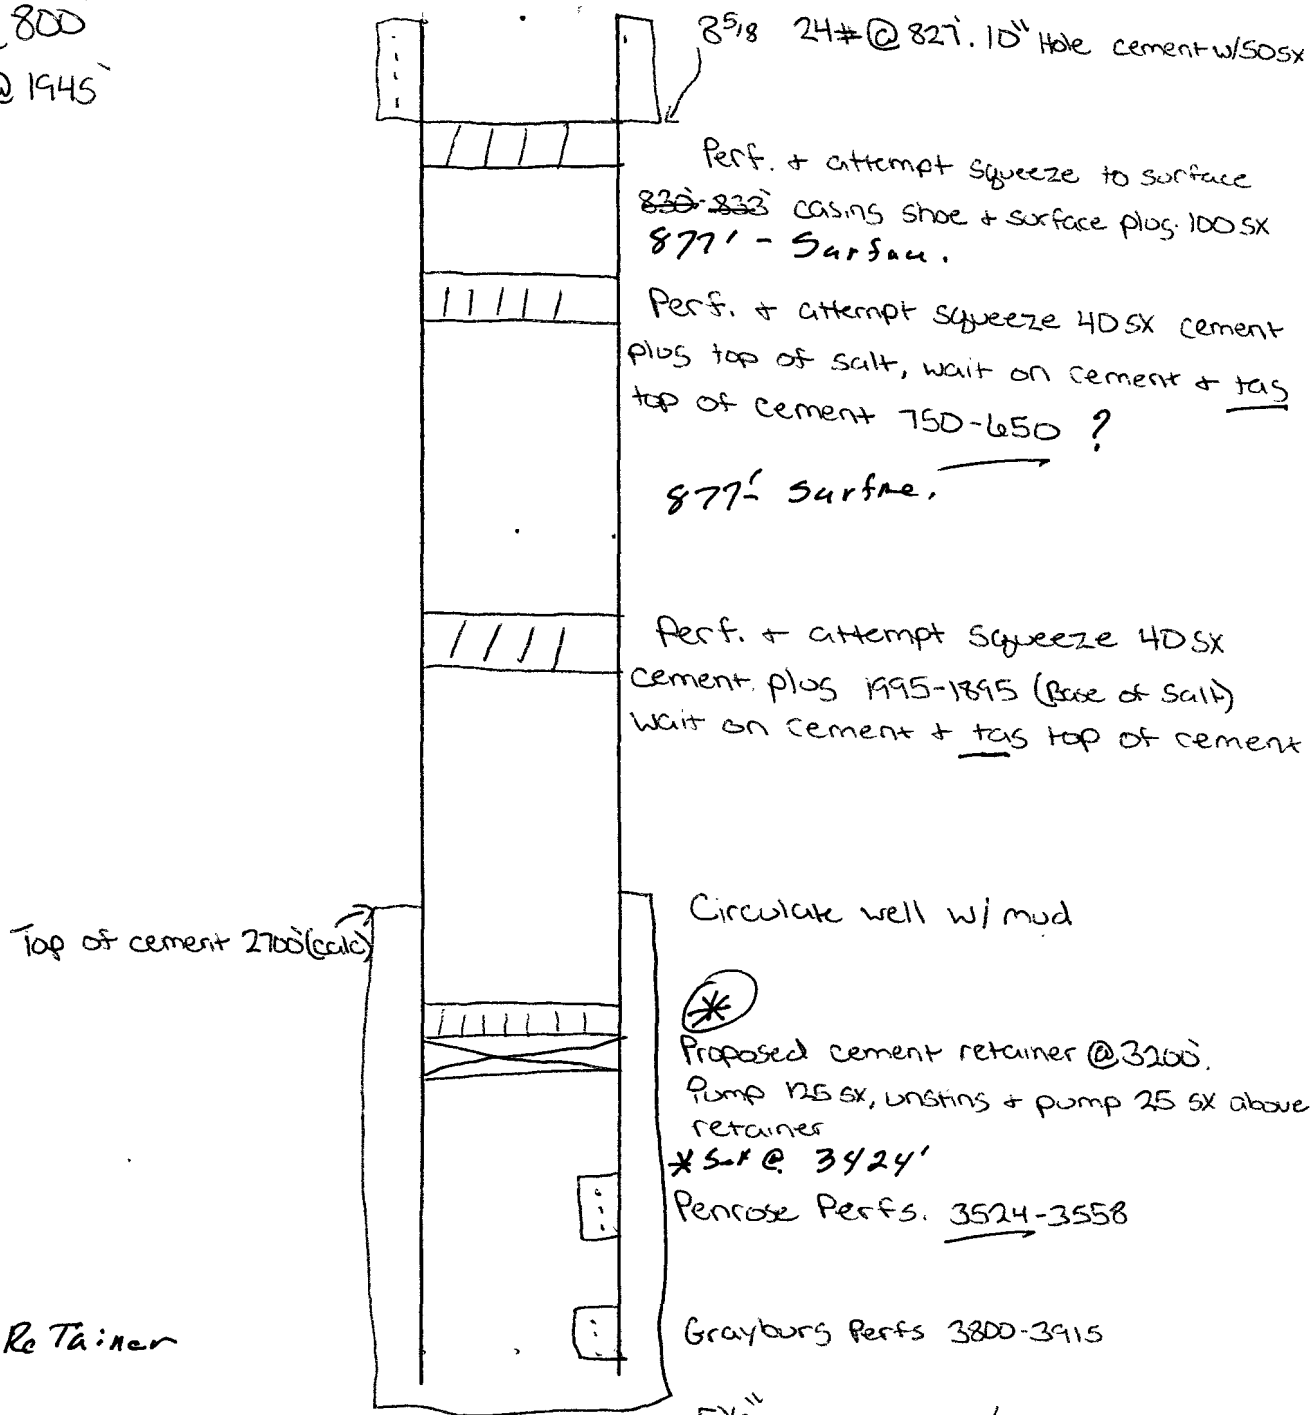
APPROVED BY  TITLE DATE 9/29/09

Conditions of Approval (if any):

Approval Granted providing work
is complete by 12/29/09

Momentum Operating Gulf #1

Top Salt @ 800'
Base of Salt @ 1945'



No Cement Retainer

* AC/BP w/ 35' CMT on Top
or a 100' CMT plug must be placed
within 100' of Top Perforation.
CMT Plug has to be Tagged

5 1/2" 14# @ 3927' cemented w/ 150 SX
8" hole. Top of cement @ 2700 (calc)