	•		ATS-1	28-494	\$
UNITED STATES (ABC) FINE-POTASH DEPARTMENT OF THE INTERPRETATION	TERIOR OCD 4-4	.	FOF	RM APPROVED B NO. 1004-0136	٨
JUN 18 2010 BUREAU OF LAND MANAC		la		November 30, 2000	
JUN 10 ARTESIA ATION FOR PERMIT TO DR	ILL OR REENTER		5. Lease Serial No NMNM041769		
	ENTER		6. If Indian, Allote		
lb. Type of Well	☐ Single Zone ☐ Multı	ole Zone	7 Unit or CA Agre	eement Name and No	
2. Name of Operator	1,000		8. Lease Name and		2 7!
OXY USA Inc. 3a. Address	16696 36. Phone No. (include	area code)	Lost Tank 9. API Well No.	3 Federal #ኒ5	(
P.O. Box 50250 Midland, TX 79710-0250	432-685-57		30-015- 3	7951 10.	د د
4. Location of Well (Report location clearly and in accordance with an At surface 2558 FNL 235 FWL SWA		Ĩ ₹ ⋒⋐⋐⋥	0. Field and Pool, Lost Tank	or Explorator Delaware, West	87 1
At proposed prod. zone 1650 FSL 660 FWL IN	wsw(r) LOCA	TION	1. Sec , T., R , M ,	Delaware, West or Blk. and Survey or	Area
14. Distance in miles and direction from nearest town or post office*	LUCA		Sec 3 T22 2. County or Parisl	S R31E 1 13.State	
	om Loving, NM		Eddy	NM	
15. Distance from proposed*	16. No. of Acres in lease		cing Unit dedicated		_
location to nearest property or lease line, ft (Also to nearest drg. unit line, if any)	640		યુ)	
8 Distance from proposed location*	19 Proposed Depth	20.BL	M/BIA Bond No.	on file	
to nearest well, drilling, completed, applied for, on this lease, ft.	8187', 8110 8350 M ELSO	o'V	ESC	0136	
21. Elevations (Show whether DF, KDB, RT, GL, etc.	22 Approximate date work	will start*	23. Estimated	duration	
3466.7' GL	1/10	`		45	
 Well plat certified by a registered surveyor A Drilling Plan A Surface Use Plan (if the location is on National Forest System Lar SUPO shall be filed with the appropriate Forest Service Office). 	Item 20 above). 5 Operator certificat	ion ecific information	•	xisting bond on file (so	
25. Signuature	Name (Printed/Typed)		Da	ute	_
Di Stell	David Stewart			नान ७१	
Title					
Sr. Regulatory Analyst Approved by (Signautre)	Name (Printed/Typed)	·		ate	
151 William Merheae	1-2 1 20 1	n Mex	bose	6-11-10	
A TIME STATE DIRECTOR	Office NN	STATE	OFFICE		
Application approval does not warrant or certify that the applicant hold conduct operations thereon Conditions of approval, if any, are attached		hts in the subje	ect lease which we	ould entitle the applica	int to
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make		ly and willfully			
United States any false, fictitious or fraudulent statements or representati	ions as to any matter within its jurisc	liction.	W		
*(Instructions on Reverse)	. /				
Carlsbad Controlled Water Basin	Kt		TTACHE		
		COND	ITIONS (F APPROV	AL
OCD CONDITION OF APPROVAL of Drilling. Intent to drill ONLY CANNOT produce until the Non-Standard		AP	PROVAL SL	IRIECT TO	
Location has been approved by OCD Santa Fe office.		GF	VERAL DEC	NIIDEMENTA ANTOI IU	
		C L I S Z NI	TODE DIVIT	UIREMENTS	_
		AND SP	ŧ₿HED ĸ⋈₩E⁄Ø₹₩₽	NOBROWPAID	S
·		*** 17/011	<i>U</i>		

District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Avenue, Artesia, NM 88210

_ *`

District III

Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Form C-102
Revised October 12, 2005
Submit to Appropriate District Office
State Lease- 4 Copies
Fee Lease- 3 Copies

District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

1000 Rio Brazos Rd., Aztec, NM 87410

☐ AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT


Santa Fe, NM 87505


State of New Mexico

API Number	Pool Code	Pool Name	
30-015- 37951	96582	Lost Tank Delawa	re, West
Property Code	Prope	rty Name	Well Number
304875	LOST TA	NK 3 FED.	15
OGRID No.	Opero	tor Name	Elevation
16696	OXY U	SA INC.	3466.7'
		ce Location	
UL or lot no. Section Township	Range Lot	Idn Feet from the North/South line Feet from the East	:/West line County

31 EAST, N.M.P.M. E 3 22 SOUTH 2558' **NORTH** 235" WEST **EDDY** Bottom Hole Location If Different From Surface UL or lot no. Section Township Lot Idn Feet from the North/South line Feet from the East/West line County 3 22 SOUTH 31 EAST, N.M.P.M. SOUTH WEST **EDDY** 1650' 660' Dedicated Acres Joint or Infill Consolidation Code Order No. 40

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

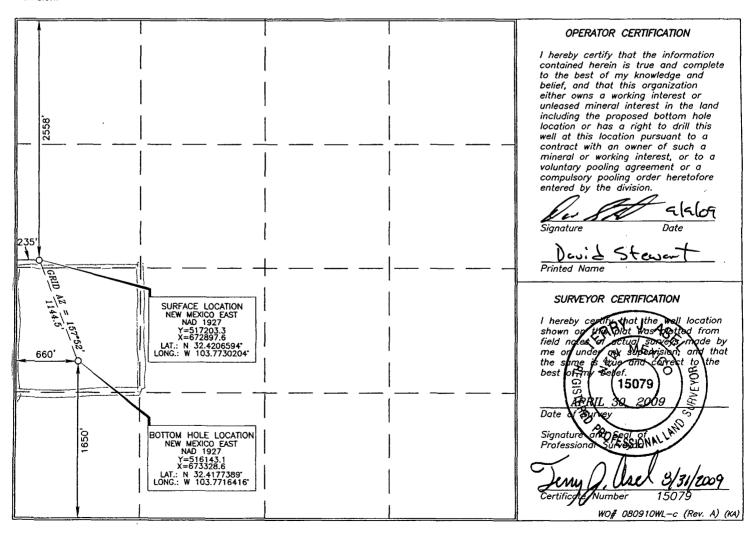

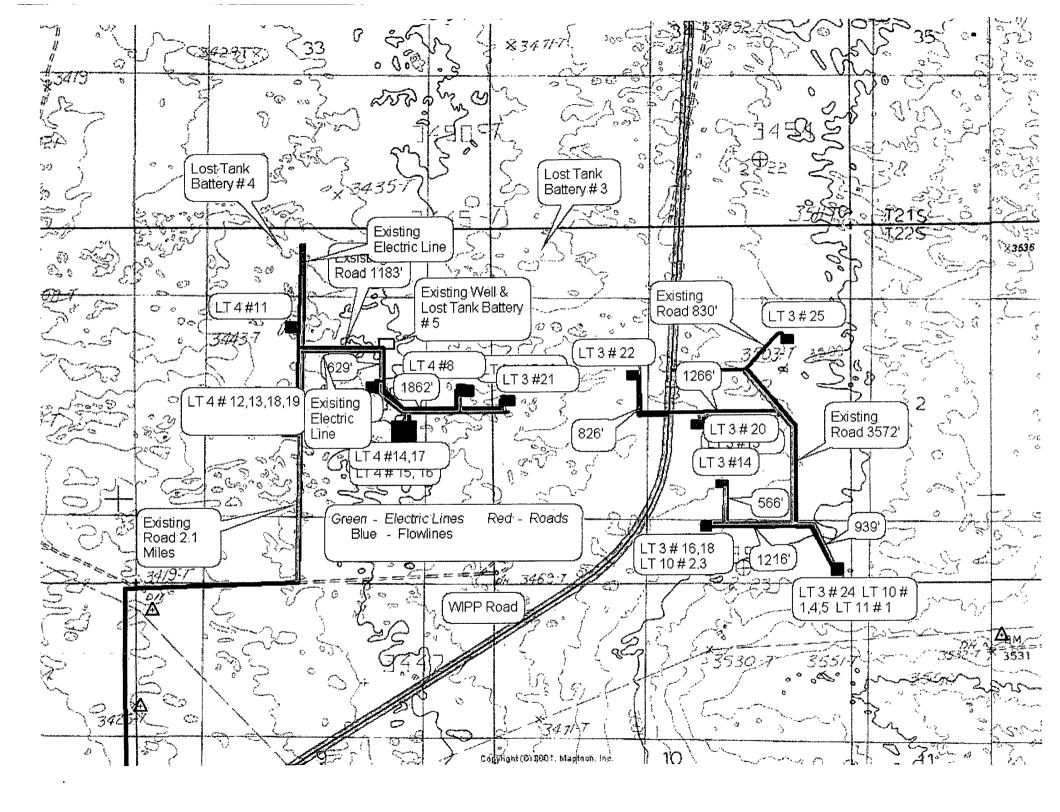


LostTank 3 Federal


	30015291930000 ×		30015296780000	300152974400	oo oo		3001532003600	3001532002	0000 3001523B960000			X 300123343300	90	
	300157020098 ×	30015296790000 ×	•	. 30	015306370000	300153333350000			30015319260000				<u> </u> 	
	300153028000000 ×	30015296800000 ×	30015296770000	300152946800 ©	00 30015299880000	0001531505 X 300153150	30015326000000	3001532001	0000 30015318510000	30015322400000	30915325120000	30015325110000 **		
32		33	30015301670000	300152946700	50	30015319	21\$ 31E 280000 34			35	30015323520000	30015337040000 O		30 300152671 ₩
	300153028100000 ×	30015296810000 **	•	30	015306360000	30015350910000 ×	3001531793000	3001531792	0000 30015316410000	30015316400000	0			
3G015290196000 ×	30015293300000	30015293810000	30015293820000	300152933800 		20000 30015350 ×	30015324	30015350890000 × 080000 3001531607	0000	30015316080000	30015323540000	30015313610000	30015267160000	30015325220000 300152658
30015301980000 X × ×	300153014B0000 ×	30015287270000	30015296110000	300152961700 300152707790 ×	00 30015296380000	ga may and on the state of the	30015323450000	300157011 5321670000 ×	30015316060600 • • • • • • • • • • • • • • • • • • •	30015319110000	leto Utitikas saeruser Pühitällääki, sakusikoolik	300152687500	> minyeditide.geepaweapequido.en.	300152681
57000399 300157000299	30015297420000 ×	30015297320000	30915791652007 a O	0015304140000 	300157916420 300157916420 X	07 •	30015321690000	30015321680000	30015319130000	30015319120000 3 00	30015316050000) 300152687 6 00	00	300152 6 83
x x	30015770992003 Ö	30015771032003 Ó 4	30015771042003 O	30015771002003 Ö		N	Eddy W Mexico	30015327250000	, , , 10015320278000	2	•	3 00152687700	9 00 36015268430000	-
	30015772312063	30015772222003	30015772232003	30015772242003		Ne	w Mexico	•		30015269746000 30019	5284560000	•	•	•
	•	٥	٥	Ó				30015327260000	2/015320280000		30015324 O	100000	3001525909	20000
	30815772292003 O	30015772282003 O	30015772262003 Ö	30015772252003 O	j i			•		3001: •	5284160000 •	3001526894000	015236550000	•
						300L577389200	22\$ 31E 30015773882003 O	300L5773872003 O	3001577392209: O	300157023492 ×	30015758002000 O 300157041491 X		015268600000	30015269420000 ©
								3001577391; O	300157023592	300157023392 ×	30015758012008 O 300157040191 ×	· • .	98 015268590000 ●	30015269180000
ě		9			•		10 -	0		3.1				12
					! !				300157020692 ×	300157029592 ×	30015267240000	300122665000	XD 30015267800000	30915269170090
					1				1			; : :	300	015784022 0 02 ×
•	1									309157840291 ×	30015267230000	30015265490000	3001.5267420000	300152685)

														20							<u></u> ئ					···				
				25%							1	00%																6		
<u> </u>		36			31	•			32			-	9	336	6	6		e 3	40	.	0"	g	35	0			ø (3 6 6	-	o- 100%
-@ ‡	Ĕ			25%								50%	•	6	6	0	e (e a	9	e'	5C	, oʻ	s d	5	e,ii	ම ම	6	ø		190%
6			ŧ								, -	o'	6	•	1	, <u>.</u>	60	<i>e</i> '	් ම	<u>.</u>		<u>•</u>	· 2	3	9 	<u>,</u>	9	6	Ö	100%
•		1	- \$ -		6				5	-	} ;	•		47	9 00	" e			, 8	91	6		, ~	9	e è	6 6	6	. (₽) Ø		70%
0	໌ ຄໍ ຊະ _ຄ							11 11 11 11 11				50°	0	g	e		200°C	o	0	9' 9'	9	e'	, 00%	•	o '	6' 887	• • •	•'		ø
9	ø [']	12			7				8	1116	<u>til</u>	6 1	 • "	9	1 2			50 9	10	50%			11	•	73		Ö"	12	200	00% SR
6			ג נ																• 5				,	•	, 83	79% 8	☆ o"			0,001
**************************************	*	ະ ່ 13 ₆	ં ે ≭ ;•					,		-									_) -4-4	•	•	•	•	9%	۔ مار	<u></u> 1
		9.			18				17					16					15				14	• •	; FEE		. 	e,		+
		 								}						+	φ '							•		5 ^u -	0) s" e"		00%
, o	®	24			19				20	-				21	+				22	<u>o</u> =	•	•	23) a '	<u>о</u> т		•	2	4	- C
0.		\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \																		o, Q,	0	00%		H H	e'	5	ၟၜ) o' 		0000
9 1-		258			30				29	_				28	2				77	ο <u>-</u>	•	6	20		e'	©	• 3	٠,		00%
o"	9 " 9	*			3 U				<u>د</u> ت					20				2	27	•			· <u> C</u>		•		,:X	25	3	
	*} ,, "o	6 6 60 4																		Θ,	100	rk.		;		1	00%		-	100%
		36			31				32	2				33	3				34					55				36	5	
(0))	* • • · · · ·														,	ø				10	ю%	\$	<u>ا</u> ت		•	,		k	; -
•	" ø" ¥	, ,	6 ' (5° 2°	© 13				5	1			O"	- 10)))	_	0"		-		ď		- 70	छ		<i>ਂ</i>	o'	71	1 6	~
	9	T • ₩	" . ‡‡"	s" ‡‡	6			ø						4					3		U	c	o ဝ	9	•	•	9	" (Ŏ,	
	,	% ; •" •" •"	軟,	ø" ø" ∞"								*									ំ	6	} }	*	•	.	o" €	6" •	,	
		12	├ ── [₹]	<u>*</u> "	7 ₀ °				ූ 8	'(<u>.</u>	;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;		9					10				1	11	_65	•		12	,,	6
								6	, est	- ·	, (e e						⊜"		ď	•		•	0	*	· •	` @ ∵ @	9 G		e e
		13			‡ 18	15		ø `	17	6 6 6		⊕ [;]	8 8	16		ø	g.	6	9 "		6	;	, i	-¢			o" ,	e (3	ei ei
						57	* *	X	5%	 -	6	3	Ø ²		•	5	e "	ø	oʻ				_10 F	•	6 ²⁸	€"				
						0	₩			9		6 6	و م) "	9 ())	9	9	်	o"	-;C	;	9 9	ø ø"	.	_ e	. ·	6 6	15	ě
*		24			19	0	©	0	26	50) (ම ම	6	9	3 6	S	⊕ 66	6	22 ⁵	o S	, G	3 6	2. 2.	3	9", (6) • •	6	9 6	24	Ó
1							100%	. 6	۷ •	ه د	(စ်	ت (ه	•		j'	ø"	o"	8	o'		21 3	(49)	.	9·1	20% (e)	ا ا	9"		
+		25	<u> </u>		30	•	©	;;;t	o' 6		,	☆	୍ର	°2	-1-)" 	•"	6 "	0"	9	000	Pm	® ,	nn (o" Come	e" pany		Đ ·	0	_
-					50	93	." * ' 0	-	3, 0	. 1) e	100	ن ان	" o	0				Lost	Tan Ed	k, Ne dy C	ff & : oun	Sano ty, I	i Du New	nes i Mex	Pros ico	pect			
						•	e. •	(e)	, 0	9		, ·	•, •) _e"	9	6) 14 14	ocatio ocatio ocatio	ons fo ons fo ons w	rVer rDare thAc	tical ection oprov	Wells ral W red Al	ells in PD's	otas n Po via r	h Are tash xror f	ea va Area Mosa	a Po via sic P	tash Potas otash	Agr sh A n De	eemen Agreem sal
		36			31	0	5	ص صد	32	9	· •	,	و پېښ	3:	3	6) W () P	Vells Todu	Dalled ana C	VCon NI We	oplete ell	d pu	SUZI	nt to	prior	Mos	aic f	Potas	h D)eal
					100%	0	6	9	6	6	r	_°.	्र ^{क्र} े ं	9	9		,	رمد Vater Leep	Gas V Dispo Produ jedi O	sal V ucing	Vell Gas	We	as	, .JCR		. 0	* * CI	iui Di	al	
			ł			ø	ക്	ø	e	e	;	e"	e"	•"	0	1	as F Y F	iugg Yuaa	jed () jed ():	a vve eep C	an Gas I	Nell								
-		1	0, 0	.	ø 6	6		•	5 e	9	;			- 2	5. (s-Hate				tes/s	50%14	ogn í	50%	Poto	ISSİLIM	iles	ises

. .

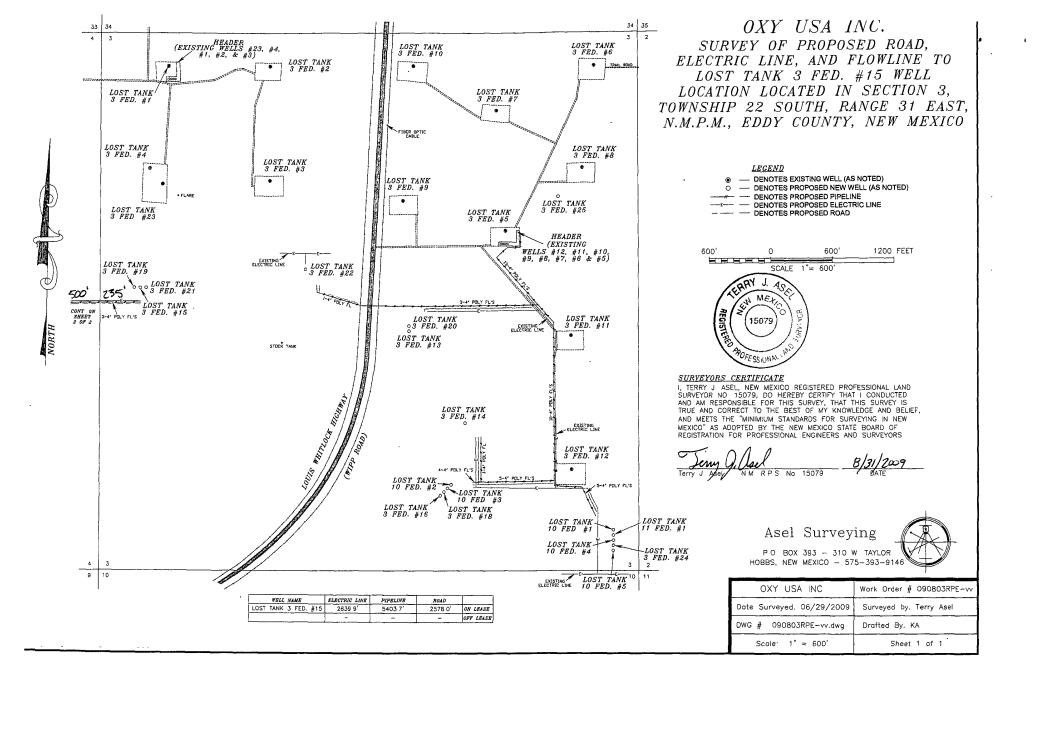

OXY USA INC.

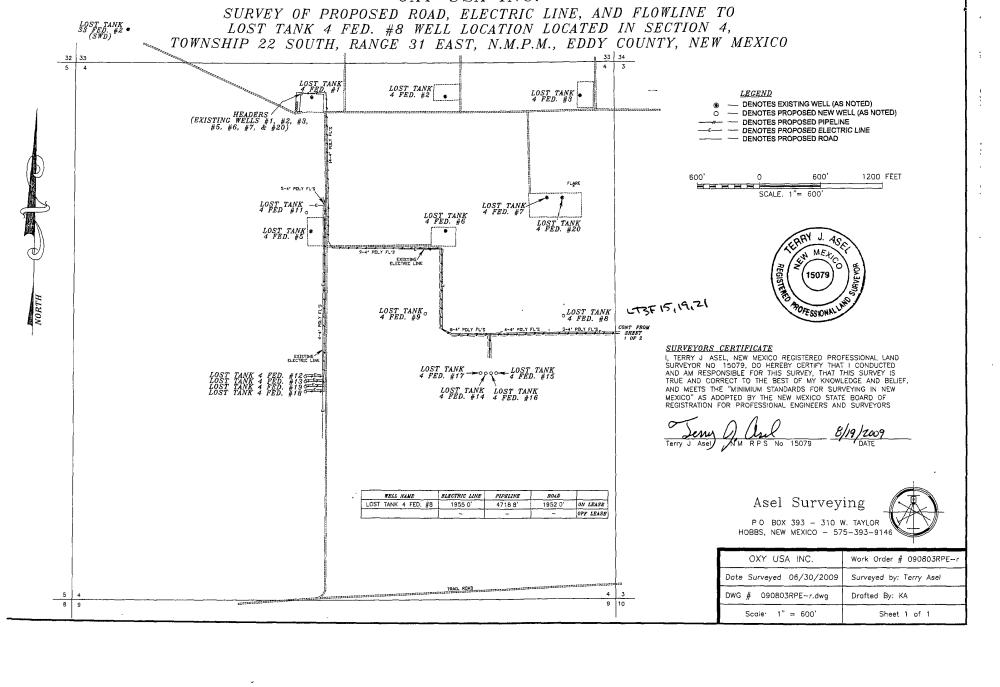

DRILLING PROGRAM

OXY USA Inc. 16696 Operator Name Lost Tank 3 Federal #15 304875 Federal Lease No. NMNM0417696 Lease Name/Number Lost Tank Delaware, West 96582 Pool Name/Number: 2558 FNL 235 FWL SWNW(E) **Surface Location:** Sec 3 T22S R31E

Bottom Hole Location: 1650 FSL 660 FWL NWSW(L) Sec 3 T22S R31E

9287 ' **.8350**' RGH 10/14/09 8110 ,**8150**'

Proposed TD: TVD TMD Elevation: 3466.7' NAD - 1927 SL-Lat: 32.4206594 Long: 103.7730204 X=672897.6 Y=517203.3 BHL-Lat: 32.4177389 Long: 103.7716416 X=673328.6 Y=516143.1 NAD - 1927

1. Geologic Name of Surface Formation:

a. Permian

2. Estimated Tops of Geological Markers & Depths of Anticipated Fresh Water, Oil or Gas:

Geological Marker	<u>Depth</u>	<u>Type</u>
a. Upper Permian Sand	450'	Water
b. Rustler	649'	
c. Top Salt - Salado	954'	
d. Bottom Salt	3944'	
e. Delaware	4230'	Oil
f. Bell Canyon	4289'	Oil
g. Cherry Canyon	5201'	Oil
h. Brushy Canyon	6484'	Oil
i. Bone Springs	8108'	Oil

3. Casing Program:

<u>Hole</u> <u>Size</u>	<u>Interval</u>	OD Csg	<u>Weight</u>	Collar	<u>Grade</u>	Condition	Collapse Design Factor	<u>Burst</u> <u>Design</u> <u>Factor</u>	Tension Design Factor
14-3/4"	680'	11-3/4"	42#	ST&C	H40	New	8.69	5.69	2.37
,									
10-5/8"	4000'	8-5/8"	32#	LT&C	- J55	New	2.32	1.31	2
	828	7'							
7-7/8"	8350	5-1/2"	17#	LT&C	J55	New	1.27	'1.4	1.94
	DVT-5900' DV	VT/ECPT-40)50'						

4. Cement Program

a. 11-3/4"	Surface	Circulate cement to Surface w/ 330sx PP w/ 4% Bentonite + 2% CaCl2, 13.5 ppg 1.74 yield followed by 270sx PP w/ 2% CaCl ₂ ., 14.8 ppg 1.34 yield
b. 8-5/8"	Intermediate	Circulate cement to surface w/ 880sx HES light PP w/ 5% Salt + 5#/sx Gilsonite + .125#/sx Poly-E-Flake 12.9 ppg 1.87 yield followed by 200sx PP, 14.8 ppg 1.32 yield.
c. 5-1/2"	Production	Cement 1st stage w/ 520sx Super H w/ .5% LAP-1 + .4% CFR-3 + 5#/sx Gilsonite + 3#/sx Salt + .25#/sx D-AIR 3000 + .3% HR-800, 13.2ppg 1.66 yield Cement 2nd stage w/ 590sx Super H w/ .5% LAP-1 + .4% CFR-3 + 5#/sx Gilsonite + 3#/sx Salt + .25#/sx D-AIR 3000 13.2ppg 1.66 yield Cement 3rd stage w/ 310sx IFC w/ .5% LAP-1 + .25#/sx D-AIR 3000 11.5ppg 2.79 yield followed by 100sx PP 14.8ppg 1.33 yield Estimated TOC @ Surface.

Drill he above cement volumes could be revised pending the caliper measurement.

• 5. Pressure Control Equipment:

Surface 0-680'

None

Production 680-8350'

11" X 5M Double Ram, 11" X 3M Annular, 5M Choke Manifold

See CDA All BOP's and associated equipment will be tested to 1200psi with the rig pump before drilling out the 11-3/4" casing shoe. Prior to drilling out the 8-5/8" casing shoe, the BOP's and Hydril will be tested as per BLM Drilling Operations Order #2.

Pipe Rams will be operated and checked each 24-hour period and each time the drill pipe is out of the hole. These functional tests will be documented on the daily driller's log. A 2" kill line and 3" choke line will be incorporated in the drilling spool below the ram-type BOP. Other accessory BOP equipment will include a Kelly cock, floor safety valve, choke lines and choke manifold having a 5000 psi WP rating.

See COA Request variance to connect BOP outlet to the choke manifold a flex line that is manufactured by Contitech Rubber Industrial KFT. It is a 3" ID X 35' flexible hose rated to 10000psi working pressure. It has been tested to 15000psi and is built to API Spec 16C. Once the flex line is installed, it will be tied down with safety clamps, certification attached.

6. Proposed Mud Circulation System

<u>Depth</u>	<u>Mud Wt.</u>	<u>Visc</u>	<u>Fluid</u>	Type System
	ppg	sec	Loss	
0-680'	8.4-8.8	32-34	NC	Fresh Water/MI Gel Spud Mud
680-4000'	9.9-10.0	28-29	NC	Brine Water
4000-7900'	8.4-8.5	28-29	NC	Fresh Water
7900-8350'	9.5-9.6	32-36	10-15	FW Mud/Duo Vis/Poly Pac R

The necessary mud products for weight additional and fluid loss control will be on location at all times.

7. Auxiliary Well Control and Monitoring Equipment:

- a. A Kelly cock will be in the drill string at all times.
- b. A full opening drill pipe stabbing valve having the appropriate connections will be on the rig floor at all times.
- c. Hydrogen Sulfide detection equipment will be in operation after drilling out the surface casing shoe until the production casing is cemented. Breathing equipment will be on location upon drilling the surface casing shoe until total depth is reached.

8. Logging, Coring and Testing Program:

- a. Drill stem tests are not anticipated but if done will be based on geological sample shows.
- > et b. The open hole electrical logging program will consist of Triple Combo CNL\LDT\DLL.
 - c. No coring program is planned but if done will be sidewall rotary cores.
 - d. Mud logging program will be initiated from 4000' to TD.

9. Potential Hazards:

No abnormal pressures, temperatures or H_2S gas are expected. The highest anticipated pressure gradient would 0.55psi/ft. If H_2S is encountered the operator will comply with the provisions of Onshore Oil & Gas Order No. 6. No lost circulation is expected to occur. All personnel will be familiar with all aspects of safe operation of equipment being used to drill this well. Adequate flare lines will be installed off the mud/gas separator where gas may be flared safely.

10. Anticipated Starting Date and Duration of Operations:

Road and location construction will begin after the BLM has approved the APD. Anticipated spud date will be as soon as possible after BLM approval and as soon as a rig will be available. Move in operations and drilling is expected to take 45 days. If production casing is run, then an additional 30 days will be needed to complete the well and construct surface facilities and/or lay flow lines in order to place well on production.



Project: Eddy County, NM

Site: Lost Tank 3 Federal Pad

Vertical Section at 157.88° (750 ft/in)

Well: Well #15 Wellbore: OH

Plan: Plan #1 (Well #15/OH)



Azimuths to Grid North True North: -0 30° Magnetic North. 7.60°

Magnetic Field Strength: 48920.7snT Dip Angle: 60.39° Date: 2009/08/28 Model. IGRF200510




WELL DETAILS: Well #15

Ground Elevation: 3466.70


RKB Elevation: RKB to MSL @ 3483.20ft (Flex 4)

Rig Name: Flex 4

+N/-S +E/-W Northing Easting Latittude Longitude Sic 0.00 0.00 517203.30 672897.60 32°25' 14.37427 N 103° 46' 22.87293 W **CASING DETAILS** TVD MD Size 4000.00 4000.00 8 5/8" 8-5/8 **SECTION DETAILS** MD Azi TVD +N/-S +E/-W DLeg **TFace** VSec Target 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 4200.00 0.00 0.00 4200.00 0.00 0.00 0.00 0.00 3 5118.39 18.37 157.88 5102.74 -135.21 54.96 2.00 157.88 145 95 431.00 0.00 0.00 1144.46 8287.08 18.37 157.88 8110.00 -1060.20 WELLBORE TARGET DETAILS (MAP CO-ORDINATES) 8 5/8"

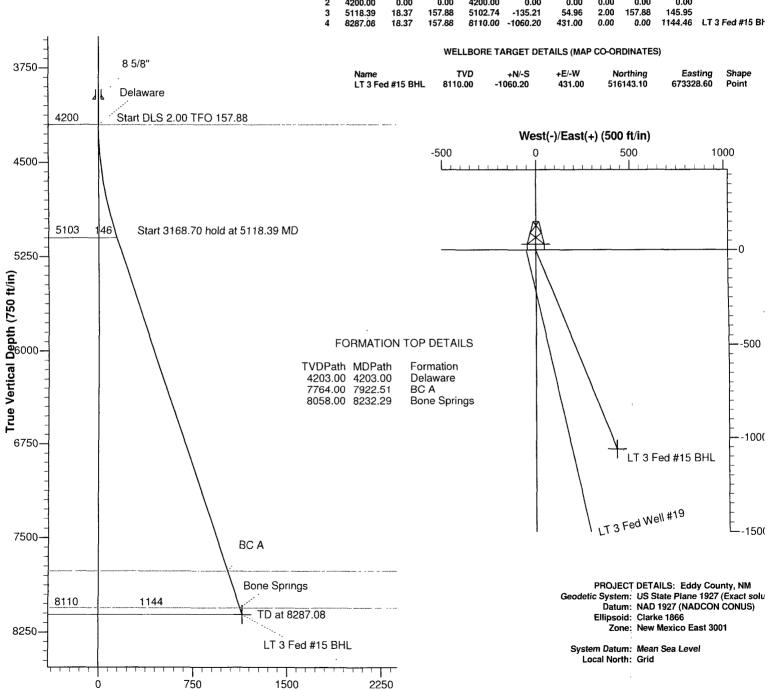

Plan: Plan #1 (We'll #15/OH) Created By: Kurt Ott©ate: 8:54, August 28 2009



Global X&Y Report



Company: OXY Permian

Project: Eddy County, NM

Site: Lost Tank 3 Federal Pad

Well: Well #15

Wellbore ÓН Design

Local Co-ordinate Reference:

TVD Reference:

MD Reference:

North Reference: Survey Calculation Method:

Database: 👌 😁

Well Well #15

RKB to MSL @ 3483.20ft (Flex 4) RKB to MSL @ 3483,20ft (Flex 4)

Minimum Curvature

Landmark Network DB

Eddy County, NM

US State Plane 1927 (Exact solution) Map System:

Geo Datum:

NAD 1927 (NADCON CONUS)

0.00 ft

Map Zone:

From:

New Mexico East 3001

System Datum:

Mean Sea Level

Lost Tank 3 Federal Pad

Site Position:

Position Uncertainty:

Position Uncertainty

Map

Northing: Easting: Slot Radius: 517,203.00 ft 672,847.60 ft

Latitude: Longitude:

32° 25' 14.37390 N 103° 46' 23.45626 W

Grid Convergence: 0.30°

Well Well #15

Well Position

+N/-S +E/-W 0.00 ft 0.00 ft 0 00 ft

Northing: Easting:

Wellhead Elevation:

7.90

517,203.30 ft 672.897.60 ft

60.39

32° 25' 14,37427 N 103° 46' 22.87293 W

Ground Level:

Latitude:

Longitude:

3.466.70 ft

Wellbore OH

Magnetics

Model Name

IGRF200510

Sample Date

Declination."

Dip Angle

Field Strength

48.921

Design Plan #1

Audit Notes:

Version:

Phase:

0.00

2009/08/28

PLAN

Tie On Depth:

0.00 **Direction**

Depth From (TVD

0.00

0.00

157.88

Date 2009/08/28 Survey Tool Program

From

0.00


(ft) Survey (Wellbore 8,287.08 Plan #1 (OH)

Tool Name

Description

MWD

MWD - Standard



Global X&Y Report



Company:

OXY Permian

Project Eddy County, NM

Site: 🕒 Lost Tank 3 Federal Pad

∵WeÎl: ∵ Wellbore: Design:

Well:#15

ОН Plan #1 Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference:

Survey Calculation Method:

Well Well #15


RKB to MSL @ 3483.20ft (Flex 4) RKB to MSL @ 3483.20ft (Flex 4)

Grid

Minimum Curvature

Database: Landmark Network DB

Design. 77 Y Tran # 1					An made in said the	Database.	and the second second	Landinark Network DD	
Planned Survey	1								
		William S. Artis							
	Înc.	Azi	TVD		V. Sec	Northing :	Easting	DLeg	
4,200 00		(°)	and the second and the second	(ft)	and many principal party and principal and an arrangement of the principal and the p	(ft) 517,203.30	(ft) 672,897.60	(°/ 100ft) 0.00	Maria Maria de La Caración de
4,200.00	0.00	0 00	4,200.00	-716.80	0.00	•	·		
	0.06	157.88	4,203.00	-719.80	0.00	517,203.30	672,897.60	2.00	
, Dèlaware 4,300.00	2 00	157.88	4,299.98	-816.78	1.75	517,201.68	672,898.26	2.00	
			,			•	,		
4,400.00	4 00	157.88	4,399.84	-916.64	6.98	517,196.84	672,900.23	2.00	
4,500.00	6.00	157.88	4,499.45	-1,016.25	15.69	517,188.76	672,903.51	2.00	
4,600.00	8.00	157.88	4,598.70	-1,115.50	27.88	517,177.47	672,908.10	2.00	
4,700.00	10 00	157.88	4,697.47	-1,214 27	43.52	517,162.98	672,913 99	2.00	
4,800.00	12.00	157.88	4,795.62	-1,312.42	62.60	517,145.31	672,921.18	2.00	
4,900.00	14.00	157.88	4,893.06	-1,409.86	85.10	517,124.47	672,929.65	2.00	
5,000.00	16.00	157.88	4,989.64	-1,506,44	110.98	517,100.49	672,939.39	2 00	
5,100.00	18.00	157.88	5,085.27	-1,602.07	140.21	517,073.41	672,950.40	2.00	
5,118.39	18.37	157.88	5,102.74	-1,619.54	145.95	517,068 09	672,952.56	2.00	
5,200.00	18.37	157.88	5,180.19	-1,696.99	171.67	517,044.27	672,962.25	0.00	
5,300.00	18.37	157 88	5,275.10	-1,791.90	203.18	517,015.08	672,974.12	0.00	
5,400.00	18.37	157.88	5,370 00	-1,886.80	234.69	516,985 89	672,985.98	0.00	
5,500.00	18.37	157.88	5,464.91	-1,981.71	266.20	516,956.70	672,997.85	0.00	
5,600.00	18.37	157.88	5,559.81	-2,076.61	297.71	516,927.50	673,009.72	0.00	
5,700.00	18.37	157.88	5,654.72	-2,171.52	329.23	516,898.31	673,021.59	0.00	
5,800.00	18.37	157.88	5,749.62	-2,266.42	360.74	516,869.12	673,033.45	0.00	
5,900.00	18.37	157.88	5,844.53	-2,361.33	392 25	516,839.93	673,045.32	0.00	
6,000.00	18.37	157.88	5,939.43	-2,456 23	423.76	516,810 74	673,057.19	0.00	
- 6,100.00 -	18.37	157.88	6,034.34	-2,551.14	455.27	516,781.55	673,069.05	0.00	
6,200.00	18.37	157.88	6,129.25	-2,646.05	486 78	516,752.35	673,080.92	0 00-	
6,300.00	18.37	157.88	6,224.15	-2,740.95	518.30	516,723.16	673,092.79	0.00	
6,400.00	18.37	157.88	6,319 06	-2,835 86	549.81	516,693.97	673,104.66	0.00	
6,500.00	18.37	157.88	6,413.96	-2,930.76	581.32	516,664 78	673,116.52	0.00	



Global X&Y Report



Company: Project: Site: Well: OXY Permian

Eddy County, NM Lost Tank 3 Federal Pad

Well.#15 Wellbore: ОН √Design:

Local Co-ordinate Reference:


TVD Reference: MD Reference: North Reference: Survey Calculation Method

Well Well #15

RKB to MSL @ 3483.20ft (Flex 4) RKB to MSL @ 3483 20ft (Flex 4)

Minimum Curvature Database Landmark Network DB


Marie II Carlot I have a server	caraconie visar sense sen			The bolis of the said and the said	Autimatic march bounter in		Maria 10 h Mahadi Karaba		
Planned Survey								en e	
MD In		Azil							
MD (ft)		AZI (°)	(ft).	TVDSS (ft)	V:Sec (ft)	Northing (ft)		DLeg 3/100ft),	
6,600.00	18.37	157.88	6,508.87	-3,025.67	612.83	516,635.59	673,128.39	0.00	der Stade für Stade in der Stade in Stade in Stade in Stad Stade in Stade in Stade in der Stade in der Stade in der Stade in Stade in Stade in Stade in Stade in Stade in
6,700.00	18.37	157.88	6,603.77	-3,120.57	644.34	516,606.40	673,140.26	0.00	
6,800.00	18.37	157.88	6,698.68	-3,215.48	675.85	516,577.20	673,152.12	0.00	
6,900.00	18.37	157.88	6,793.58	-3,310.38	707.37	516,548.01	673,163 99	0.00	
7,000.00	18.37	157.88	6,888.49	-3,405.29	738.88	516,518.82	673,175.86	0.00	
7,100.00	18.37	157.88	6,983.39	-3,500.19	770 39	516,489 63	673,187.73	0.00	
7,200.00	18.37	157.88	7,078 30	-3,595.10	801 90	516,460.44	673,199.59	0.00	
7,300.00	18.37	157.88	7,173.20	-3,690.00	833.41	516,431.25	673,211.46	0.00	
7,400.00	18.37	157.88	7,268.11	-3,784.91	864.92	516,402.05	673,223.33	0 00	
7,500.00	18.37	157.88	7,363.01	-3,879.81	896.44	516,372.86	673,235.20	0.00	
7,600.00	18.37	157.88	7,457.92	-3,974.72	927.95	516,343.67	673,247.06	0.00	•
7,700.00	18.37	157.88	7,552.83	-4,069.63	959.46	516,314.48	673,258.93	0.00	
7,800.00	18.37	157.88	7,647.73	-4,164 53	990.97	516,285.29	673,270.80	0.00	
7,900.00	18.37	157.88	7,742.64	-4,259.44	1,022 48	516,256.10	673,282.66	0.00	
7,922.51	18.37	157.88	7,764.00	-4,280.80	1,029.58	516,249 53	673,285.34	0.00	
BC A	•							4	
8,000.00	18.37	157.88	7,837.54	-4,354.34	1,053.99	516,226.90	673,294.53	0.00	
8,100.00	18.37	157.88	7,932.45	-4,449.25	1,085.50	516,197.71	673,306.40	0.00	
8,200.00	18.37	157.88	8,027.35	-4,544.15	1,117.02	516,168.52	673,318.27	0.00	
8,232.29	18.37	157.88	8,058.00	-4,574 80	1,127.19	516,159.09	673,322.10	0.00	
Bone Springs	10.07								
8,287.08	18.37	157.88	8,110.00	-4,626.80	1,144.46	516,143 10	673,328 60	0.00	
LT-3 Fed #15 BHL	•		-					*	•





Global X&Y Report




Well Well #15 Local Co-ordinate Reference: Company: OXY Permian RKB to MSL @ 3483,20ft (Flex 4) TVD Reference: Project: Eddy County, NM RKB to MSL @ 3483,20ft (Flex 4) MD Reference: Site: Lost Tank 3 Federal Pad Well: Well #15 North Reference: Minimum Curvature Survey Calculation Method: Wellbore: OH Landmark Network DB Design ... Plan #1 Targets Tärget Name ∏ärget Name ---hit/miss tärget Dip Angle +E/-₩ Easting 673,328.60 32° 25' 3.86057 N 03° 46' 17.90984 W LT 3 Fed #15 BHL 431.00 516,143.10 0.00 0.00 8,110.00 -1,060.20- plan hits target center Casing Points Measured Vertical *** Casing Hole -Diameter - 🙌 Depth Diameter Depth (ft) 4.000.00 4,000.00 8 5/8' Formations Ďip Vertical Measured Direction Depth Depth 🔞 🎉 4.203.00 4,203.00 Delaware 0.00 0.00 7,922,51 7,764.00 BC A 8,232.29 0.00 8,058.00 Bone Springs Checked By: Approved By: Date:

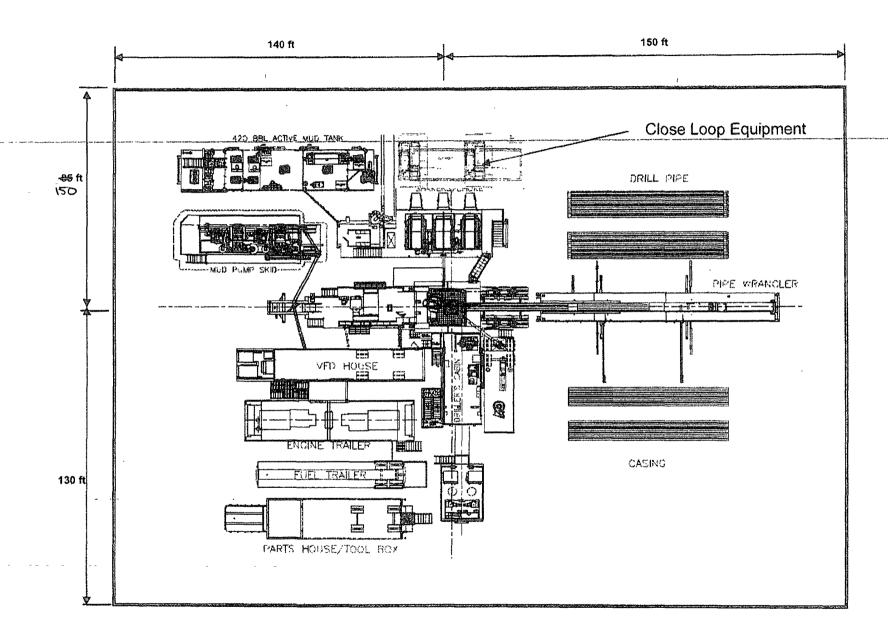

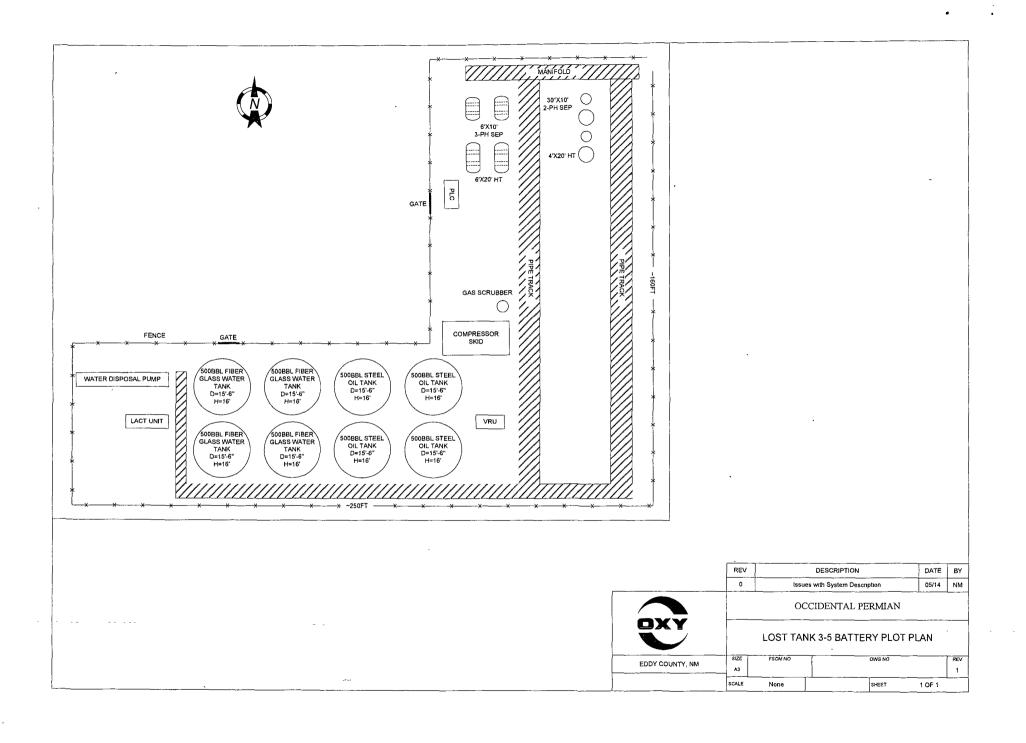

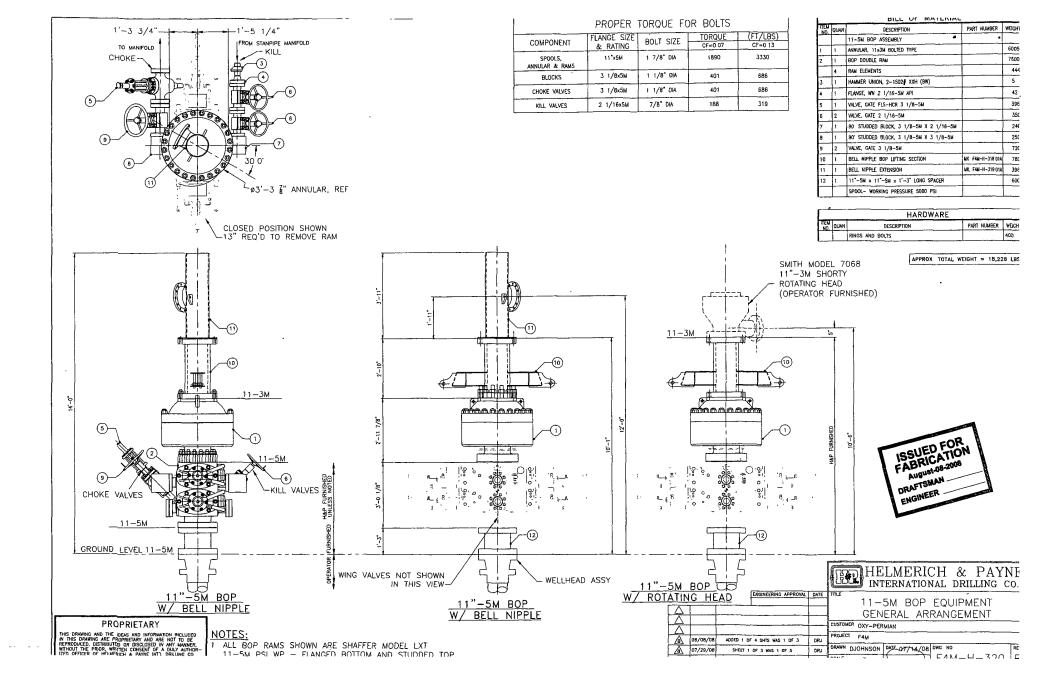

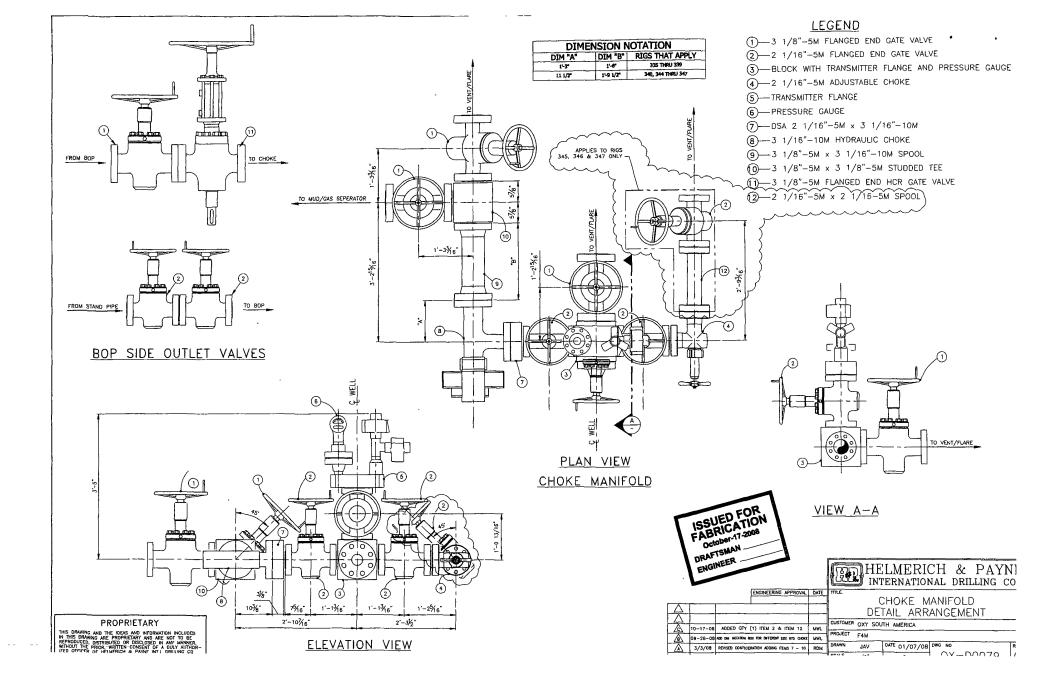

CERTIFICATE OF CONFORMITY

Supplier : CONTITECH RUBBER INDUSTRIAL KET.

Equipment: 6 pcs. Choke and Kill Hose with installed couplings

3" x 10,67 m WP: 10000 pel Supplier File Number : 412638 : April. 2008 Date of Shipment Phoenix Beattle Co. Customer

Customer P.o. : 002491

Referenced Standards

/ Codes / Specifications : API Spec 16 C Serial No.: 52754,52755,52776,52777,52778,52782

STATEMENT OF CONFORMITY

We hereby cartify that the above items/aquipment supplied by us are in conformity with the terms, conditions and specifications of the above Purchaser Order and that these Items/equipment were fabricated inspected and tasted in accordance with the referenced standards, codes and specifications and meet the relevant acceptance criteria and design requirements.

COUNTRY OF ORIGIN HUNGARY/EU

Date: 04. April. 2008

Position: Q.C. Manager

Part No	#FRECORM_REPT \$" LEE LEE COR ONE & 2 AFT CO. 1 2 ARK SCOTTAINED	
		ci leèue
SCHIEF CARE SAFETY CLARE SHOWN 3. DET CHAREN STARE. 1 251.0 MARKS SEC	SCAR-CHOCK STATE CHARLE CHARLES CHARLES CHARLES THE TENNES THE TEN	
SCOP. 1985 1 2402 1,588 1 2 2 2 2 2 2 2 2 2		
		~
	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	

We harshy certify that these goods have been inspected by our Quality Management System, and to the beet of our knowledge are found to personne to resevant industry attended the wittin the requirements of the purchase order as leasted to Phoenix Besttle Corporation.




Ontinental → CONTITECH

Real Technology

Quality Document

								
QUA INSPECTION	LITY CONT N AND TES		CATE		сент	RP:	748	
PURCHABER:	Phoenix Be	ettia Co.			P (3, 14*	. 0	02491	
CONTINUEDH CROER HT:	412836	HOSE TYPE	3"	Ð	Ch	olos and K	# Hose	
HOSE SERIAL IF:	52777	NOMENAL / AC	TUAL L	ENGTH	,	10,67 m		
W.P 68,96 MPH	10 000 PM	T.P. 103,4	₩Ps	15000	post	Durwiters	80 ~	ted
Process last will water a explaint temperature	t	<u> </u>	****					
		\					,	
	Sae	attactment	(1 pa	ge)				
								-
10 mm = 10 ±								
→ 10 mm = 25 M	Pt				<u>.</u>			
		COLF	LINGS					
Type		iariai Nº		Q.	-		Hout Nº	
3° coup ling with	917	913		AISI 4	(130		T7996A	
4 1/16" Plange and	'			AISI 4	130		25984	
	.							
INFOCHIP INSTALL	ED						1 Spec 18	
						Tem	penature nat	e:"B"
mutal parts are flowings								
E CHRITETY THAT THE ARCY CHRITET TRETED AS ABOY			8D M A	CONDAN	CE WITH	THE TENNE	OF THE ORDE	R AND
As:	Inspector		Quality 1	Control	****			
		ļ	•	/		nia Kubbur		
04. April. 2008			4	(· jamilly i	trini EFA. Optrol Dage.	1.1	ļ
	I		<u></u>	<u> </u>	->4	(0)	Janes	l

People 1/1

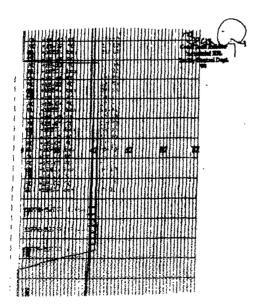

Phoposix Beattle Corp.
1988 britanes set brior
tendes. 17 7784.
191- disp. 201-disp.
191-disp.

Delivery Note

Customer Order Murriber 374-399-001	Delivery Note Number	763 67 5	Page	1
Comparison / Involve Address HELERICH & PAINE INT'L CREALING CO LCC SCHITT BOSLOCK TRUSH, CK. 74119	Delivery / Address HELPERION & RAME IDC ATTH: JOE STEPHERSON - RII 13699 INCLETRIAL 1990 HOUSTON, "X 17015	3 <i>1</i> 70		

Customer Acc No	Phoenit Seutile Contract Manager	Phoenix Beetile Reference	Dede
H01	n.	90633#	05/23/2666

Items No	Seattle Part Noveleer / Description	Ordered	City Seet	City To Follow
	HETIOCISA-36-AFT 3" 10K 16C CAK HOSE x 36ft ONL CH 4.1/16" AFT SPEC FLANGE E/ End 1. 4 1/16" 10Kps AFT Spec AR Type 60K FT ange End 2" 4.1/16" 10Kps AFT Spec AR Type 60K FT ange C/W 8XTSS Standard ring groove at each end	1	1	ō
	Surtable for RES Service Horking pressure: 10,000ps1 Test pressure: 15,000ps1 Standard: API 16C Fell specification Armor Bearding: Included Firm Retring: Not included Temperature reting: -28 Deg C to +100 Deg C			
	SECKS-1993 LIFTIME & SAFETY DUBINGST TO SULT HP16CK3-36-F1 2 x 160mm 10 Safety Chaps 2 x 240mm 10 Lifting Collers & element C's 2 x 7ft Stainless Steel wire rope 3/4" 00 4 x 7 75t Sheckles	e.4	ı	0
	SC725-200CS Sapety Clamp 200m 7 25T C/S Salvanised	1	1	0

Formi No 100/1:

--- PHOENIX Beattie

Proents Beattle Corp till attended by the private of the private o

Delivery Note

Customer Order Number 370-369-001	Delivery Note Number	003478	Page	Ş
Customer / Involve Address HEJERICH & PAYNE INT'L DRILLING CO 1487 SCATH BOULDER TUESA, OK 74119	Delivery / Address HELPERION & PANNE IDC ATTH: JOSE STEPPENSON - RH JASOS THEISTRIAL ROMD HOUSTON, TX 77015	i 376		

Customer Ace No	Phoenix Seettle Contract Manager	Phoenix Sestile Reference	Dete
10H	JI.	1/3633 0	05/23/2008

itsens No	Beatile Part Number / Description	Oty Ordered	City Sent	Oty To Follow
٠	SC725-1320S SAFETY CLAMP 132M 7 2ST C/S GALVANEZED C/M 20LTS	1	1	0
	OCCERT-HYDROU HYDROSTATIC PRESSURE TEST CERTIFICATE	1	1	0
	ENCERT-LUMD LIMO TEST CERTIFICATES	4.	1	Ð
	Sopretight Thicknow / Cultifound Freight Fre-Part & Ado to Firm. Diffolice Mintel Haveley, mist be accompanied by Frapenician (including The Freighase Orden, rug number to ensure proper payment	en e	1	1
		Hall		<u> </u>

Phoenix Besttle inspection Signature :

broked in Good Condition:

Separate Annual Property Annua

OXY Permian

EMERGENCY ACTION PLAN

Potash Area
Federal 23 #7,8,10,11,12,13,14,15
Federal 29 #9, 10, 11, 12
Lost Tank 3 Federal #13, 15, 19

DRILLING/WORKOVER

DRILLING AND CRITICAL WELL OPERATIONS

DRILLING/WORKOVER DRILLING AND CRITICAL WELL OPERATIONS

EMERGENCY ACTION PLAN

TABLE OF CONTENTS

<u>ITEM</u>	<u>PAGE</u>
PREFACE	. 3
EMERGENCY RESPONSE ACTIVATION AND GENERAL RESPONSIBILITIES	. 4
SPECIFIC EMERGENCY GUIDANCE - Well Control	. 6 . 7 . 7 . 7 . 7
PUBLIC RELATIONS	. 9
PHONE CONTACTS - OP DRILLING/WORKOVER	. 10
PHONE CONTACTS - OP PRODUCTION AND PLANT PERSONNEL	. 11
PHONE CONTACTS – OP HES PERSONNEL	. 13
MAP	. 22

PREFACE

An effective and viable Emergency Action Plan (EAP) is intended to provide prior planning and guidance in responding to emergency incidents. The primary considerations in its development are protection of personnel, the public, company and public property, and the environment.

Although the plan addresses varied emergency situations that may occur, it recognizes that flexibility and the use of the organization's knowledge and experience is critical to safe resolution of emergency incidents. Response actions outlined in the plan provide a framework, which may be placed into operation without confusion. These actions should promote quick and decisive actions during the critical initial period and immediately following an emergency. As the response progresses, additional guidelines and procedures may need to be implemented as the situation dictates. In addition, all emergency incidents must be properly reported per the Oxy Incident Reporting and Notification Policy, state and federal requirements, etc.

The following procedures are provided as Oxy Permian's minimum expectations. The Contractor's own procedures may be utilized in lieu of Oxy Permian's, provided that it meets or exceeds the minimum deliverables. It should be understood that this list is not all-inclusive, but the overall plan should assist in lateral application to similar incidents.

This EAP is intended for use on Oxy Drilling/Workover projects and the operations within their area of responsibility, such as drilling, critical well work, etc.

09/08/2009 Page 3 of 15

EMERGENCY RESPONSE ACTIVATION AND GENERAL RESPONSIBILITIES

Activation of the Emergency Action Plan

- A. In the event of any emergency situation, all personnel on location should first ensure that the following items are initiated. After that, they should refer to the appropriate Specific Emergency Guidance sections on pages five (5) through nine (9) in this document for further responsibilities:
 - 1. Notify the senior ranking contract representative on site.
 - 2. Notify Oxy representative in charge.
 - 3. Notify civil authorities if the Oxy Representative cannot be contacted and the situation dictates.
 - 4. Perform rescue and first aid as required (without jeopardizing additional personnel).

General Responsibilities

Oxy Permian Personnel:

- A. Drill Site Manager: The Oxy Drilling/Critical Well Servicing Operations Specialist or contract personnel serving in that capacity will serve as Operations Chief Officer for all emergency incidents. The Operations Chief Officer is responsible for:
 - 1. Notification to the Drilling/Workover Team Leader of the incident occurrence.
 - 2. Notification to the local RMT/PMT leader of the incident occurrence, and the need for the designated local RMT/PMT Incident Commander to act in that capacity for the response effort.
 - 3. Sole control of all tactical activities directed toward reducing the immediate hazard, establishing situational control and restoring the operations to a non-emergency state.
- B. Local RMT/PMT Designated Incident Commander: The Oxy local RMT/PMT Designated Incident Commander will serve as the overall Incident Commander for the drilling or critical well servicing emergency incident. The Incident Commander is responsible for:
 - 1. Coordinating with the Drilling Manager for notification to the Oxy Crisis Management team of the incident occurrence.
 - 2. Establishing and managing the overall incident command structure and response from inception through restoration of normal activities in the area.
- C. Drilling/Workover HES Tech: The Drilling/Workover HES Tech (or his designate) is responsible for reporting to the incident as soon as reasonably possible, to provide support to the response effort as required by the Operations Chief Officer or the Incident Commander.

Contract Drilling Personnel will immediately report to their assigned stations and perform their duties as outlined in the appropriate Specific Emergency Guidance sections on pages five (5) through nine (9) in this document.

Other Contractor Personnel will report to the safe briefing area to assist Oxy personnel and civil authorities as requested when it is safe to do so and if they have been adequately trained in their assigned duties.

Civil Authorities (Law Enforcement, Fire, and EMS) will be responsible for:

- 1. Establishing membership in the Unified Incident Command.
- 2. As directed by the Incident Commander and the Unified Command, control site access, re-route traffic, and provide escort services for response personnel.
- 3. Perform all fire control activities in coordination with the Unified Command.
- 4. Initiate public evacuation plans as instructed by the Incident Commander.
- 5. Perform rescue or recovery activities with coordination from the Unified Command.
- 6. Provide medical assistance as dictated by the situation at hand.

WELL CONTROL

The following procedures will be implemented when a loss of primary control is indicated. Indicators of loss of primary control are flow from the well, an increase in pit volume, or when the drilling fluid used to fill the hole on trips is less than the calculated pipe displacement volume. The emergency signal for well control procedures will be a single long blast of the rig air horn.

Kick While Drilling - Procedures And Responsibilities

Driller:

- 1. Stop the rotary and hoist the kelly above the rotary table.
- 2. Stop the mud pump(s).
- 3. Check for flow.
- 4. If flowing, sound the alarm immediately.
- 5. Ensure that all crew members fill their responsibilities to secure the well.
- 6. Record drill pipe and casing shut-in pressures and pit volume increase and begin kill sheet.

Derrickman:

- 1. Go to BOP/choke manifold area.
- 2. Open choke line valve on BOP.
- 3. Signal to Floorman #1 that the choke line is open.
- 4. Close chokes after annular or pipe rams are closed.
- 5. Record shut-in casing pressure and pit volume increase.
- 6. Report readings and observations to Driller.
- 7. Verify actual mud weight in suction pit and report to Driller.
- 8. Be readily available as required for additional tasks.

Floorman # 1:

- 1. Go to accumulator control station and await signal from Derrickman.
- 2. Close annular preventer and HCR on signal (if available, if not then close pipe rams).
- 3. Record accumulator pressures and check for leaks in the BOP or accumulator system.
- 4. Report to Driller, and be readily available as required for additional tasks.

Floorman # 2:

- 1. Start water on motor exhausts.
- 2. Notify Contractor Tool Pusher or Rig Manager of well control situation.
- 3. Check location for ignition sources and extinguish or turn off, and stop any welding in progress.
- 4. Report to Driller, and be readily available as required for additional tasks.

Floorman # 3:

1. Stand-by with Driller, and be readily available as required for additional tasks.

Tool Pusher/Rig Manager:

- 1. Notify Oxy Representative and report to rig floor.
- 2. Review and verify all pertinent information.
- 3. Communicate information to Oxy Representative, and confer on an action plan.
- 4. Finalize well control worksheets, calculations and preparatory work for action plan.
- 5. Initiate and ensure the action plan is carried out.
- 6. Communicate any changes in well or site conditions, or any indications that the action plan needs to be revised to the Oxy representative.

Oxy Representative:

1. Notify Drilling Superintendent or Drilling Manager and RMT Leader or Local Incident Commander, and Police, Fire Department, or other local emergency services as required.

WELL CONTROL (continued)

Kick While Tripping - Procedures and Responsibilities

Driller:

- 1. Sound the alarm immediately when pipe displacement volume is less than 75% of calculated.
- 2. Position the upper tool joint just above rotary table and set slips.
- 3. Check for flow.
- 4. Ensure that all crew members fill their responsibilities to secure the well.
- 5. Record drill pipe and casing shut-in pressures and pit volume increase, and begin kill sheets.

Derrickman: (same as while drilling)

Floor Man # 1:

- 1. Install full opening valve (with help from Floorman #2) in top drill string connection.
- 2. Tighten valve with make up tongs.
- 3. Go to accumulator control station and await signal from Derrickman.
- 4. Close annular preventer and HCR valve on signal (if available, if not then close pipe rams).
- 5. Record accumulator pressures and check for leaks in the BOP and accumulator system.
- 6. Report to Driller, and be readily available as required for additional tasks.

Floor Man # 2:

- 1. Assist installing full opening valve in drill string.
- 2. Position back-up tongs for valve make-up.
- 3. Start water on motor exhausts.
- 4. Notify Contractor Tool Pusher or Rig Manager of well control situation.
- 5. Check location for ignition sources and extinguish or turn off, and stop any welding in progress.
- 6. Report to Driller, and be readily available as required for additional tasks.

Floorman # 3, Rig Manager/Tool Pusher, and Oxy Representative: (same as while drilling)

H2S RELEASE

The following procedures and responsibilities will be implemented on activation of the H2S siren and lights.

All Personnel:

1. On alarm, don escape unit (if available) and report to upwind briefing area.

Rig Manager/Tool Pusher:

- 1. Check that all personnel are accounted for and their condition.
- 2. Administer or arrange for first aid treatment, and /or call EMTs as needed.
- 3. Identify two people best suited to secure well and perform rescue, and instruct them to don SCBA.
- 4. Notify Contractor management and Oxy Representative.
- 5. Remain at the briefing area, assess and monitor personnel and overall situation for hazards or conditions that might warrant a change in the action plan.

Two People Responsible For Shut-in and Rescue:

- 1. Don SCBA and acquire tools to secure well and perform rescue, i.e., wrenches, retrieval ropes, etc.
- 2. Utilize the buddy system to secure well and perform rescue(s).
- 3. Return to the briefing area and stand by for further instructions.

All Other Personnel:

1. Remain at the briefing area and await further instructions - do not leave unless instructed.

Oxy Representative:

- 1. Remain at the briefing area, assess and monitor personnel and overall situation for hazards or conditions that might warrant a change in the action plan.
- 2. Notify Drilling Superintendent or Drilling Manager and RMT Leader or Local Incident Commander, and Police, Fire Department, or other local emergency services as required.

PERSONAL INJURY OR DEATH

Call for assistance, and then administer first aid for the injured. Treatment should be prioritized by life-threatening conditions.

A. Do not move injured personnel unless they are in imminent danger. An ambulance should be summoned for any injury that appears to be serious.

FIRE OR EXPLOSION

Fire Fighting Philosophy

It is Oxy Permian's intent that Oxy and contract personnel will only extinguish incipient or beginning stage fires and perform or assist in initial non-threatening rescue operations. The responding fire department will be given primacy when they arrive to control a fire on any Oxy property. Any Oxy or contract employee who participates in a fire response must be fully trained and qualified as such, and must be utilizing appropriate Personal Protective Equipment.

Contract and Oxy Personnel Deployment

In the event of a fire or explosion all personnel will report to the safe briefing area. The Senior Contract Representative on site will designate personnel for rescue as appropriate depending on their qualifications and the risks of the rescue. Any rescue which involves significant risk to those performing the rescue should be deferred to professional response personnel.

No personnel will leave the area without direction / permission from the Senior Contract Representative onsite.

The Senior Contract Representative on site will notify local emergency response personnel as required, along with the Contract Company management and the Oxy Representative as soon as reasonably possible.

SPILLS

In the event of a significant spill of any substance, the person discovering it should immediately notify the rig supervisor and the Oxy Representative. Personnel onsite should **NOT** attempt identification, control or containment unless they are absolutely sure of the product spilled, are fully aware of the hazard characteristics, and are equipped with the appropriate personal protective equipment.

HYDROCARBON VAPOR CLOUD RELEASE

Upon discovery of a Hydrocarbon Vapor Cloud (NGL) release, take immediate safety precautions to protect any company personnel or others that might be in the area. Other emergency actions should be initiated only by trained expert personnel from the appropriate pipeline company.

The following guidelines should be followed:

- 1. Immediately notify the rig supervisor and the Oxy Representative.
- 2. Determine wind direction, and evacuate upwind or at 90 degrees to the release.
- 3. Maintain a safe distance from the cloud.
- 4. Render first aid and call for an ambulance as necessary.
- 5. Attempt to warn approaching individuals of the hazard.

BOMB THREAT

In the event of a bomb threat, the person receiving the call, on or off site, should try to get as much information as possible from the caller. The person receiving the call should immediately contact the supervisor in charge. Evacuation of the field should be considered at this time. Roadblocks may need to be installed. The supervisor in charge should make all appropriate contacts.

The Supervisor contacted should:

- a. Realize that every bomb threat is serious.
- b. Notify Corporate Security
- c. Inform Police/Sheriff's Department and Fire Department
- d. Contact RMT Leader or his designated relief to coordinate search efforts with the assistance of the local law enforcement agencies.

	•	BOMB THRE	AT CHECKLIST	
Date Na	ame of person takir	ng call	Phon	e # call came on
FILL OUT COMP	LETELY IMMEDIA	TELY AFTER BOI	MB THREAT	
 Where is the b What does the What type of b What will cause Did the caller p Why did the ca What is the caller 	omb set to explode? omb located? bomb look like? omb is it?_ e the bomb to explodace the bomb? ller place the bomb ler's name and add geRaceLen	ode??ress?		
DESCRIPTION O	F CALLER'S VOIC	E (Check all that	apply)	
Calm Angry Excited Slow Loud	RapidCryingNormalDistinctSlurred	Laughing Raspy Deep Ragged Nasal	LispAccentStutterDeepClearing Throa	Disguised Familiar? Who did it sound like? Deep Breathing
BACKGROUND S	SOUNDS:	•		
Street NoisesVoicesOffice	House NoisesMotorClear	Factory Machinery Animals Other	Music Static PA System	Local Call Long Distance Phone Booth
THREAT LANGUA	AGE:			
Well-Spoken Message Read	Fould by Threat Maker	Incoherent	Irrational	Taped
REMARKS:				

09/08/2009 Page 8 of 15

NATURAL DISASTERS

Tornadoes

These general procedures should be followed by everyone seeking shelter from a severe storm or tornado:

Indoors:

- 1. Protect yourself from flying glass and debris.
- 2. Take refuge near the core of the building for maximum protection.
- 3. Do not smoke while taking shelter.
- 4. Shut all doors to offices, if time permits.

In the field:

- 1. Seek cover in a low-lying area, such as a culvert, ditch, pit, or water injection valve box.
- 2. Get out of and away from your vehicle.
- 3. Stay away from power lines.
- 4. Cover your head with your arms and clothing.

Thunderstorms

Indoors:

- 1. Avoid water pipes, sinks, showers, tubs, etc.
- 2. Stay away from doors and windows.
- 3. Do not use the telephone.
- 4. Take off head sets.
- 5. Turn off, unplug, and stay away from appliances, computers, power tools, & TV sets.

In the field:

- 1. Avoid water.
- 2. Avoid high ground and open spaces.
- 3. Avoid all metal objects including electric wires, fences, machinery, motors, power tools, etc. <u>Unsafe places</u> include underneath canopies, small picnic or rain shelters, or near trees. Where possible, find shelter in a substantial building or in a fully enclosed metal vehicle such as a car, truck or a van with the windows completely shut. If lightning is striking nearby when you are outside, you should:
 - a. Crouch down, feet together, hands over ears
 - b. Avoid proximity (minimum of 15 ft.) to other people.
- 4. SUSPEND ACTIVITIES for 30 minutes after the last observed lightning or thunder.

PUBLIC RELATIONS

Oxy recognizes that the news media have a legitimate interest in incidents at Oxy facilities that could affect the public. It is to the company's benefit to cooperate with the news media when incidents occur because these media are our best liaison with the public.

Our objective is to see that all reports of any emergency are factual and represent the company's position fairly and accurately. Cooperation with news media representatives is the most reliable guarantee that this objective will be met.

All contract and Oxy employees are instructed <u>NOT</u> to make any statement to the media concerning the emergency incident. If a media representative contacts any employee, they should refer them to the designated Emergency Command Center where they should contact the Incident Commander or his designated relief for any information concerning the incident.

Drilling Dept. Emergency Contact list

Drilling Manager

Scott Cooper

713-366-5325 office

281-352-5865 cell

Drilling Superintendent Nelson Emery 713-215-7357 office

281-467-2862 cell

Drilling Eng. Supervisor Richard Jackson 713-215-7235 office

281-467-6383 cell

HES Specialist-Drilling

Brian Bielss

432-685-5719 office

432-813-6335 cell

Drilling Coordinator

Drue Dunaway 432-685-5715 office

432-556-3288 cell

Drilling Coordinator

Kevin Videtich 806-592-6213 office

806-891-2000 cell

OXY Permian Incident Reporting Phone List

OXY Permian Crisis Team Hotline	Notification	(713) 935-7210	
Person	Location	Office Phone	Cell/Mobile Phone
Asset Management-Operations Areas			•
OXY Permian President & General Manager:			
Ken Dillon	Houston	(713) 366-5140	(661) 333-9315
Operations Support Manager: Rick Callahan	Houston	(713)-215-7578	(281) 389-1141
Asset Development Manager-Jeff Simmons	Houston	(713) 366-5124	(713) 560-8073
Public Affairs: Stacey Crews	Houston	(713) 366-5304	(713) 416-8381
Operations South-Frontier			
RMT Lead Frontier-Barry Beresik	Houston	(713) 366-5016	(713) 560-8061
RMT Lead South-Keith Brown	Houston	. (713) 366-5354	(713) 264-1114
Surface Operations Team Lead-Bill Elliott	Midland	(432) 685-5845	(432) 557-6736
Well Operations Team Lead-Leamon Hood	Midland	(432) 685-5794	(432) 634-4486
Well Servicing Team Lead-Vicki Hollub	Houston	(713) 215-7332	(713) 885-6347
WST Coord Frontier-Kirk Hobbs	Midland	(432) 685-5951	(432) 634-3890
WST Coord South-Robert Ricks	Midland	(432) 685-5821	(432) 634-8791
NM Frontier Oper Coord -Larry Sammons	Carlsbad	(575) 887-8337	(575) 390-8397
NM-South Oper Coord-Gilbert Williams	Seminole	(432) 385-2778	(806) 215-0009
NM Frontier Oper Coord -Van Barton	Carlsbad	(575) 887-8337	
Completion Specialist-Dale Redding	Hobbs	(432) 385-3206	
HES Staff & Areas of First Contact Support			
HES Manager: John Kirby	Houston	(713) 366-5460	(281) 974-9523
Environmental Engineer, Air: Peggy Waisanen	Midland	(432) 685-5673	(432) 894-1968
Administrative Assistant: Judy Browning	Midland	(432) 685 5692	(432) 661 1048
Environmental Consultant: Dennis Newman	Houston	(713) 366-5485	(713) 560-8060
Safety Engineer: Derek Purvis	Houston	(713) 366-5932	(713) 582-1848
Pipeline Safety: Don Bales	Midland	(432) 685-5844	(432) 894-1960
HES Lead-Pete Maciula	Midland	(432) 685-5667	(432) 557-2450
HES Specialist: Eddie Gonzales	Midland	(432) 685-5929	(432) 556-6790
HES Specialist-Drilling: Robert Lovelady	Midland	(432) 685-5630	(432) 813-6332
HES Tech & Area of Responsibility			
Wasson San Andres RMT: Mark Andersen	Denver City	(806) 592-6299	(806) 215-0077
Hobbs RMT: Steve Bishop	Hobbs	(575) 397-8251	(575) 390-4784
Frontier-New Mexico: Rick Kerby	Carlsbad	(575) 887-8337	(575) 631-4972
South-New Mexico-CJ Summers	Hobbs	(575) 397-8236	(575) 390-9228
	110003	(373) 371-0230	(5/3) 5/0-/220
Regulatory Affairs Lead-Liz Bush-Ivie	Houston	(713) 366-5303	832-474-3701
Leau-Liz Dush-1vie	110021011	1 (/13) 300-3303	032-4/4-3/01

T	(122) (27, 57, 5	
		
Houston	(713) 366-5158	
Hobbs	(575) 397-8251	(575) 390-4784
Denver City	(806) 592-6274	(806) 215-0183
Levelland	(806) 229-9708	(806) 638-2425
Cogdell	(325) 573-7272	(325) 207-3367
Sharon Ridge	(325) 573-6341	(325) 207-3374
Midland	(432) 685-5844	(432) 894-1960
OOGC - Houston	(713) 215-7171	(713) 203-4050
OOGC - Houston		(713) 560-8037
		(832) 863-2240
J		
		
Los Angeles	(310) 443-6588	(310) 710-3233
Los Angeles	(310) 443-6542	(310) 710-2255
Dallas	(972) 404-3542	
Dallas	(972) 404-3974	
Dallas	(972) 404-3542	· · · · · · · · · · · · · · · · · · ·
	(972) 728-3600	
	X252	(800) 349-8492
	(877) 502 9466	
	(677) 302-9400	
Houston	(713) 366-5529	(713) 560-8049
Houston	(713) 366-5529	(713) 560-8049
Houston	(713) 215-7150	(713) 702-7949
Houston Houston	(713) 215-7150 (713) 215-7863	(713) 702-7949 (281) 799-7348
Houston Houston	(713) 215-7150 (713) 215-7863 (713) 366-5137	(713) 702-7949 (281) 799-7348 (713) 569-0386
Houston Houston	(713) 215-7150 (713) 215-7863	(713) 702-7949 (281) 799-7348
Houston Houston	(713) 215-7150 (713) 215-7863 (713) 366-5137	(713) 702-7949 (281) 799-7348 (713) 569-0386
Houston Houston	(713) 215-7150 (713) 215-7863 (713) 366-5137	(713) 702-7949 (281) 799-7348 (713) 569-0386
	Denver City Levelland Cogdell Sharon Ridge Midland OOGC - Houston OOGC - Houston OOGC - Houston Los Angeles Los Angeles Dallas Dallas	Midland (432) 685-5755 Houston (713) 366-5158 Hobbs (575) 397-8251 Denver City (806) 592-6274 Levelland (806) 229-9708 Cogdell (325) 573-7272 Sharon Ridge (325) 573-6341 Midland (432) 685-5844 OOGC – Houston (713) 366-5324 OOGC – Houston (713) 366-5039 Los Angeles (310) 443-6588 Los Angeles (310) 443-6542 Dallas (972) 404-3542 Dallas (972) 404-3542 Dallas (972) 404-3542 Dallas (972) 404-3542 (972) 728-3600

Bureau of Land Management	Carlsbad, NM	(575) 887-6544
Bureau of Land Management	Hobbs, NM	(575) 393-3612
Bureau of Land Management	Roswell, NM	(575) 393-3612
		
Bureau of Land Management DOT Juisdictional Pipelines-Incident	Santa Fe, NM	(505) 988-6030
Reporting New Mexico Public Regulation		(505) 827-3549
Commission	Santa Fe, NM	(505) 490-2375
DOT Juisdictional Pipelines-Incident		
Reporting Texas Railroad Commission	Austin, TX	(512) 463-6788
EPA Hot Line	Dallas, Texas	(214) 665-6444
Federal OSHA, Area Office	Lubbock, Texas	(806) 472-7681
National Response Center	Washington, D. C.	(800) 424-8802
National Infrastructure Coordinator Center		(202) 282-9201
New Mexico Air Quality Bureau	Santa Fe, NM	(505) 827-1494
New Mexico Oil Conservation Division	Artesia, NM	(575) 748-1283
New Mexico Oil Conservation Division	Hobbs, NM	(575) 393-6161
New Mexico Oil Conservation Division	Santa Fe, NM	(505) 471-1068
		(505) 827-7152
New Mexico OCD Environmental Bureau	Santa Fe, NM	(505) 476-3470
New Mexico Environmental Department	Hobbs, NM	(575) 827-9329
NM State Emergency Response Center	Santa Fe, NM	(505) 827-9222
	District 8, 8A Midland,	
Railroad Commission of TX	TX	(432) 684-5581
Texas Emergency Response Center	Austin, TX	(512) 463-7727
TCEQ Air	Region 2 Lubbock, TX	(806) 796-3494
TCEQ Water/Waste/Air	Region 7 Midland, TX	(432) 570-1359

Medical Facilities

Artesia General Hospital	Artesia, NM	(575) 748-3333
Guadalupe Medical Center	Carlsbad, NM	(575) 887-6633
Lea Regional Hospital	Hobbs, NM	(575) 492-5000
Medical Arts Hospital	Lamesa, TX	(806) 872-2183
Medical Center Hospital	Odessa, TX	(432) 640-4000
Memorial Hospital	Seminole, TX	(432) 758-5811
Midland Memorial Hospital	Midland, TX	(432) 685-1111
Nor-Lea General Hospital	Lovington, NM	(575) 396-6611
Odessa Regional Hospital	Odessa, TX	(432) 334-8200
St. Mary's Hospital	Lubbock, TX	(806) 796-6000
Union County General Hospital	Clayton, NM	(575) 374-2585
University Medical Center	Lubbock, TX	(806) 743-3111

Local Emergency Planning Comm.

Richard H. Dolgener	Andrews County, TX	(432) 524-1401	
Joel Arnwine	Eddy County, NM	(575) 887-9511	
County Judge Judy House	Gaines County, TX	(432) 758-5411	
Myra Sande	Harding County, NM	(575) 673-2231	
Jerry Reynolds	Lea County, NM	(575) 396-8600	(575) 399-2376

09/08/2009 Page 13 of 15

Royce Creager	Loving County, TX	(432) 377-2231
Mike Cherry	Quay County, NM	(575) 461-2476
Della Wetsel	Union County, NM	(575) 374-8896
Bonnie Leck	Winkler County, TX	(432) 586-6658
Carl Whitaker	Yoakum County, TX	(806) 456-7491
Car Williams	1 oakam Councy, 121	(600) 100 7 131
Law Enforcement - Sheriff		1
Andrews Cty Sheriff's Department	Andrews County	(432) 523-5545
Eddy Cty Sheriff's Department	Eddy County (Artesia)	(575) 746-2704
Eddy Cty Sheriff's Department	Eddy County (Carlsbad)	(575) 887-7551
Gaines Cty Sheriff's Department	Gaines County (Seminole)	(432) 758-9871
Lea Cty Sheriff's Department	Lea County (Eunice)	(575) 384-2020
Lea Cty Sheriff's Department	Lea County (Hobbs)	(575) 393-2515
Lea Cty Sheriff's Department	Lea County (Lovington)	(575) 396-3611
Union Cty Sheriff's Department	Union County (Clayton)	(505) 374-2583
Yoakum City Sheriff's Department	Yoakum Co.	(806) 456-2377
Law Enforcement - Police		
Andrews City Police	Andrews, TX	(432) 523-5675
Artesia City Police	Artesia, NM	(575) 746-2704
Carlsbad City Police	Carlsbad, NM	(575) 885-2111
Clayton City Police	Clayton, NM	(575) 374-2504
Denver City Police	Denver City, TX	(806) 592-3516
Eunice City Police	Eunice, NM	(575) 394-2112
		(575) 397-9265
Hobbs City Police	Hobbs, NM	(575) 393-2677
Jal City Police	Jal, NM	(575) 395-2501
Lovington City Police	Lovington, NM	(575) 396-2811
Seminole City Police	Seminole, TX	(432) 758-9871
Law Enforcement - FBI		
FBI	Alburqueque, NM	(505) 224-2000
FBI	Midland, TX	(432) 570-0255
T DDG		
Law Enforcement - DPS	A ND 6	(575) 746 0704
NM State Police	Artesia, NM	(575) 746-2704
NM State Police	Carlsbad, NM	(575) 885-3137
NM State Police	Eunice, NM	(575) 392-5588
NM State Police	Hobbs, NM	(575) 392-5588
NM State Police	Clayton, NM	(575) 374-2473; 911
TX Dept of Public Safety	Andrews, TX	(432) 524-1443
TX Dept of Public Safety	Seminole, TX	(432) 758-4041
TX Dept of Public Safety	Yoakum County TX	(806) 456-2377
Firefighting & Rescue		
Amistad/Rosebud	Amistad/Rosebud, NM	(505) 633-9113

09/08/2009 Page 14 of 15

		(432) 523-4820
Andrews	Andrews, TX	(432) 523-3111
Artesia	Artesia, NM	(575) 746-5051
Carlsbad	Carlsbad, NM	(575) 885-3125
Clayton	Clayton, NM	(575) 374-2435
Denver City	Denver City, TX	(806) 592-5426
Eunice	Eunice, NM	(575) 394-2111
Hobbs	Hobbs, NM	(575) 397-9308
Jal	Jal, NM	(575) 395-2221
Kermit	Kermit, TX	(432) 586-3468
Lovington	Lovington, NM	(575) 396-2359
Maljamar	Maljamar, NM	(575) 676-4100
Monahans	Monahans, TX	(432) 943-4343
Nara Visa	Nara Visa, NM	(575) 461-3300
Pecos	Pecos, TX	(432) 445-2421
Seminole	Seminole, TX	(432) 758-3676 (432) 758-9871


Ambulance

Allipulance		
Amistad/Rosebud	Amistad/Rosebud, NM	(575) 633-9113
Andrews Ambulance	Andrews, TX	(432) 523-5675
Artesia Ambulance	Artesia, NM	(575) 746-2701
Carlsbad Ambulance	Carlsbad, NM	(575) 885-2111; 911
Clayton, NM	Clayton, NM	(575) 374-2501
Denver City Ambulance	Denver City, TX	(806) 592-3516
Eunice Ambulance	Eunice, NM	(575) 394-3258
Hobbs, NM	Hobbs, NM	(575) 397-9308
Jal, NM	Jal, NM	(575) 395-2501
Lovington Ambulance	Lovington, NM	(575) 396-2811
Nara Visa, NM	Nara Visa, NM	(575) 461-3300
Pecos Ambulance	Pecos, TX	(432) 445-4444
	G	(432) 758-8816
Seminole Ambulance	Seminole, TX	(432) 758-9871

Medical Air Ambulance Service

AEROCARE - Methodist Hospital	Lubbock, TX	(800) 627-2376	
San Angelo Med-Vac Air Ambulance	San Angelo, TX	(800) 277-4354	
Southwest Air Ambulance Service	Stanford, TX	(800) 242-6199	
Southwest MediVac	Snyder, TX	(800) 242-6199	
Southwest MediVac	Hobbs, NM	(800) 242-6199	
Odessa Care Star	Odessa, TX	(888) 624-3571	
NWTH Medivac	Amarillo, TX	(800) 692-1331	

09/08/2009 Page 15 of 15

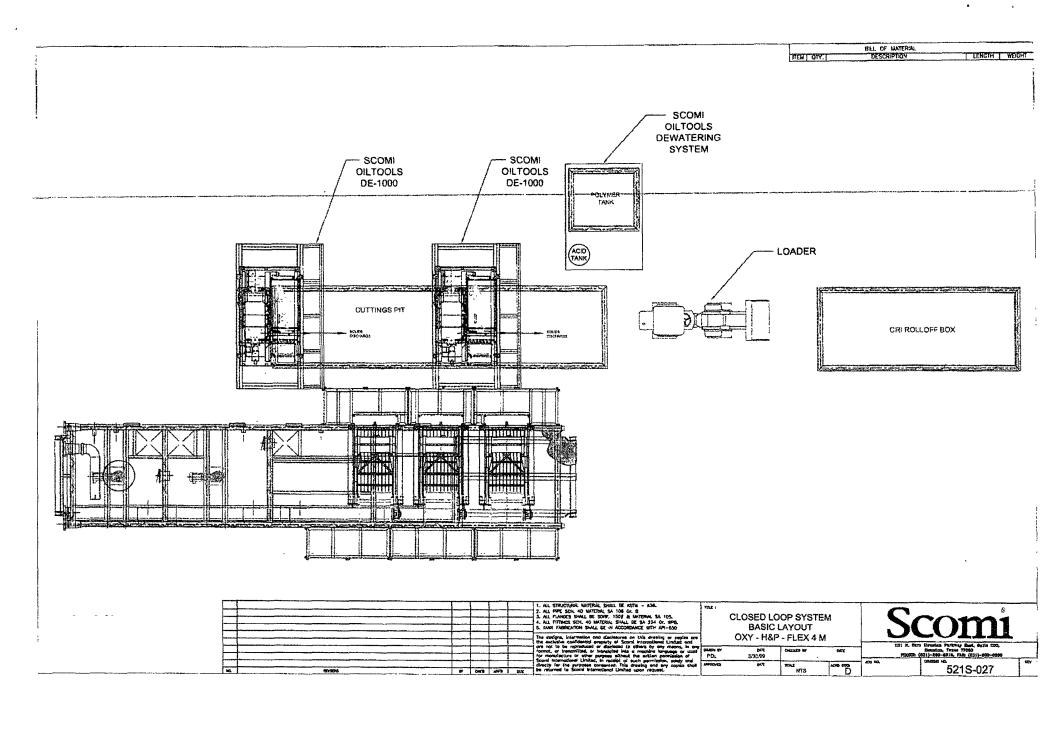

SURFACE USE PLAN OF OPERATIONS

Operator Name	OXY USA Inc.	16696
Lease Name/Number	Lost Tank 3 Federal #15	304875 Federal Lease No. NMNM0417696
Pool Name/Number:	Lost Tank Delaware, West	96582
Surface Location:	2558 FNL 235 FWL SWNW(E)	Sec 3 T22S R31E
Bottom Hole Location:	1650 FSL 660 FWL NWSW(L)	Sec 3 T22S R31E

1. Existing Roads

- a. A copy of a USGS "Livingston Ridge, N.M." quadrangle map is attached showing the proposed location. The well location is spotted on this map, which shows the existing road system.
- b. The well was staked by Terry J. Asel, Certificate No. 15079 on 4/30/09, certified 8/31/09.
- c. Directions to Location: From Jal, NM go west on SH 128 for 42.4 miles. Turn north/east on CR 802 for 3.7 miles. Turn north on Lewis Whitlock (WIPP) road for 2.5 miles. Turn north on caliche road for 0.8 miles, then east on caliche road for 0.5 miles, then north on caliche road for 0.6 miles, then east on caliche road for 0.1 miles, then south on caliche road for 0.1 miles, then east on caliche road for 0.3 miles to location.

2. New or Reconstructed Access Roads:

- a. A new access road will be built. The access road will run approximately 750' from an existing road to the location. See Exhibit #2.
- b. The maximum width of the road will be 15'. It will be crowned and made up of 6" of rolled and compacted caliche. Water will be deflected, as necessary, to avoid accumulation and prevent surface erosion.
- c. Surface material will be native caliche. This material will be obtained from a BLM approved pit nearest in proximity to the location. The average grade will be approximately 1%.
- d. No cattle guards, grates or fence cuts will be required. No turnouts are planned.

3. Location of Existing Wells:

Existing wells within a one mile radius of the proposed well are shown on Exhibit #3.

4. Location of Existing and/or Proposed Production Facilities.

- a. In the event the well is found productive, the Lost Tank 3 tank battery would be utilized and the necessary production equipment will be installed at the well site. See proposed Production Facilities Layout diagram, Exhibit #4.
- b. If necessary, electric power poles will be set along side of the access road.
- c. All flowlines will adhere to API Standards. Exhibit #4

5. Location and types of Water Supply.

This well will be drilled using a combination of water mud systems. It will be obtained from commercial water stations in the area and will be hauled to location by transport truck using existing and proposed roads.

6. Construction Materials:

All caliche utilized for the drilling pad and proposed access road will be obtained from an existing BLM approved pit or from prevailing deposits found under the location. Will use BLM recommended use of extra caliche from other locations close by for roads, if available.

7. Methods of Handling Waste Material:

- a. A closed loop system will be utilized consisting of above ground steel tanks and haul-off bins. Disposal of liquids, drilling fluids and cuttings will be disposed of at an approved facility, see C-144 CLEZ.
 - 1. Solids CRI
 - 2. Liquids Laguna
- b. All trash, junk, and other waste material will be contained in trash cages or bins to prevent scattering. When the job is completed, all contents will be removed and disposed of in an approved sanitary landfill.
- c. The supplier, including broken sacks, will pick up slats remaining after completion of well.
- d. A Porto-john will be provided for the rig crews. This equipment will be properly maintained during the drilling and completion operations and will be removed when all operations are complete.
- e. Disposal of fluids to be transported will be by the following companies: TFH Ltd. Laguna SWD Facility

8. Ancillary Facilities: None needed

9. Well Site Layout

Exhibit #5 shows the proposed well site layout with dimensions of the pad layout and equipment location.

V-Door	South	Tanks	East	Pad	280' X 290'
Lost Tank	3 Federal #19 and #21	will use the	same pad		

10. Plans for Surface Reclamation:

- a. After concluding the drilling and/or completion operations, if the well is found non-commercial, the caliche will be removed from the pad and transported to the original caliche pit or used for other drilling locations. The road will be reclaimed as directed by the BLM. The original top soil will again be returned to the pad and contoured, as close as possible, to the original topography.
- b. If the well is deemed commercially productive, caliche from areas of the pad site not required for operations will be reclaimed. The original top soil will be returned to the area of the drill pad not necessary to operate the well. These unused areas of the drill pad will be contoured, as close as possible, to match the original topography, and the area will be seeded with an approved BLM mixture to re-establish vegetation.

11. Surface Ownership

The surface is owned by the U.S. Government and is administered by the BLM. The surface is multiple use with the primary uses of the region for the grazing of livestock and the production of oil and gas. The surface is leased to: Kenneth Smith Inc. 267 Smith Rd. Hobbs, NM 88240.

They will be notified of our intention to drill prior to any activity.

12. Other Information

- a. The vegetation cover is generally sparse consisting of mesquite, yucca, shinnery oak, sandsage and perennial. native range grass. The topsoil is sandy in nature. Wildlife in the area is also sparse consisting of deer, coyotes, rabbits, rodents, reptiles, dove and quail.
- b. There is no permanent or live water in the general proximity of the location.
- c. There are no dwellings within 2 miles of the proposed well site.

d. A Cultural Resources Examination - this well is located in the Permian Basin MOA.

Pad + 1/4 mile road	\$1,339.00	750	\$0.15/ft over 1/4 mile	\$0.00	\$1,339.00
Pipeline - up to 1mile	\$1,236.00	5410	\$250 per 1/4 mile	\$250.00	\$1,236.00
Electric Line - up to 1mile	\$618.00	2650	\$0.17/ft over 1 mile	\$0.00	\$618.00
Total	\$3,193.00			\$0.00	\$3,193.00

13. Bond Coverage:

Bond Coverage is Nationwide Bond No. ES0136.

Operators Representatives:

The OXY Permian representatives responsible for ensuring compliance of the surface use plan are listed below.

Larry Sammons .
Production Leader
P.O. Box 50250
Midland, TX 79705
Office Phone: 432-685-5724

Cellular: 432-296-9323

Nelson Emery

Drilling Superintendent

P.O. Box 4294

Houston, TX 77210

Office Phone: 713-215-7357 Cellular: 281-467-2862

Richard Jackson

Drilling Engineering Supervisor

P.O. Box 4294 Houston, TX 77210

Office Phone: 713-215-7235 Cellular: 281-467-6383 Marvin McElroy

Production Coordinator

P.O. Box 1988

Carlsbad, NM 88220

Office Phone: 806-592-6200 Cellular: 806-215-6750

Calvin (Dusty) Weaver Construction Specialist

P.O. Box 50250 Midland, TX 79710

Office Phone: 432-685-5723 Cellular: 806-893-3067

Carmilo Arias Drilling Engineer P.O. Box 4294

Houston, TX 77210

Office Phone: 713-366-5953 Cellular: 281-468-4652

OPERATOR CERTIFICATION

I hereby certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions that presently exist; that I have full knowledge of State and Federal laws applicable to this operation; that the statements made in this APD package are, to the best of my knowledge, true and correct; and that the work associated with the operations proposed herein will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of false statements. Executed this 21st day of August, 2009.

Ala · Vala · A				
Name: Denise Woods Name: Denise Woods				
Position: RMT Leaader				
Address: 5 Greenway Plaza, Ste. 110, Houston, TX 77046				
Telephone: 713-215-7154				
E-mail: (optional): denise_woods@oxy.com				
Company: OXY USA Inc.				
Field Representative (if not above signatory): Marvin McElroy				
Address (If different from above): P.O.Box 1410 McCamey TX 79752				
Telephone (if different from above): 806-215-6750				
E-mail (if different from above); Marvin McElroy@oxy.com				

PECOS DISTRICT CONDITIONS OF APPROVAL

OPERATOR'S NAME:
LEASE NO.:
WELL NAME & NO.:
SURFACE HOLE FOOTAGE:
BOTTOM HOLE FOOTAGE
LOCATION:
LOCATION:
COUNTY:
OXY USA, INC.
NM0417696
LOST TANK 3 FEDERAL #15
2558' FNL & 235' FWL
1650' FSL & 660' FWL
Section 3, T. 22 S., R 31 E., NMPM
Eddy County, New Mexico

TABLE OF CONTENTS

Standard Conditions of Approval (COA) apply to this APD. If any deviations to these standards exist or special COAs are required, the section with the deviation or requirement will be checked below.

General Provisions
Permit Expiration
Archaeology, Paleontology, and Historical Site
Noxious Weeds
Special Requirements
Lesser Prairie Chicken
Ground-level Abandoned Well Marker
⊠ Construction
Notification
Topsoil
Closed Loop System
Federal Mineral Material Pits
Well Pads
Roads
◯ Road Section Diagram
☑ Drilling
R-111-Potash
Logging requirements
☐ Production (Post Drilling)
Well Structures & Facilities
Pipelines
Electric Lines
☐ Closed Loop System/Interim Reclamation
Final Abandonment/Reclamation

I. GENERAL PROVISIONS

The approval of the Application For Permit To Drill (APD) is in compliance with all applicable laws and regulations: 43 Code of Federal Regulations 3160, the lease terms, Onshore Oil and Gas Orders, Notices To Lessees, New Mexico Oil Conservation Division (NMOCD) Rules, National Historical Preservation Act As Amended, and instructions and orders of the Authorized Officer. Any request for a variance shall be submitted to the Authorized Officer on Form 3160-5, Sundry Notices and Report on Wells.

II. PERMIT EXPIRATION

If the permit terminates prior to drilling and drilling cannot be commenced within 60 days after expiration, an operator is required to submit Form 3160-5, Sundry Notices and Reports on Wells, requesting surface reclamation requirements for any surface disturbance. However, if the operator will be able to initiate drilling within 60 days after the expiration of the permit, the operator must have set the conductor pipe in order to allow for an extension of 60 days beyond the expiration date of the APD. (Filing of a Sundry Notice is required for this 60 day extension.)

III. ARCHAEOLOGICAL, PALEONTOLOGY & HISTORICAL SITES

Any cultural and/or paleontological resource discovered by the operator or by any person working on the operator's behalf shall immediately report such findings to the Authorized Officer. The operator is fully accountable for the actions of their contractors and subcontractors. The operator shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery shall be made by the Authorized Officer to determine the appropriate actions that shall be required to prevent the loss of significant cultural or scientific values of the discovery. The operator shall be held responsible for the cost of the proper mitigation measures that the Authorized Officer assesses after consultation with the operator on the evaluation and decisions of the discovery. Any unauthorized collection or disturbance of cultural or paleontological resources may result in a shutdown order by the Authorized Officer.

IV. NOXIOUS WEEDS

The operator shall be held responsible if noxious weeds become established within the areas of operations. Weed control shall be required on the disturbed land where noxious weeds exist, which includes the roads, pads, associated pipeline corridor, and adjacent land affected by the establishment of weeds due to this action. The operator shall consult with the Authorized Officer for acceptable weed control methods, which include following EPA and BLM requirements and policies.

V. SPECIAL REQUIREMENT(S)

Lesser Praire Chicken Timing and Low Profile Well Marker.

Timing Limitation Stipulation/Condition of Approval for Lesser Prairie-Chicken: Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1st through June 15th annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 ft. from the source of the noise.

Ground-level Abandoned Well Marker to avoid raptor perching: Upon the plugging and subsequent abandonment of the well, the well marker will be installed at ground level on a plate containing the pertinent information for the plugged well. For more installation details, contact the Carlsbad Field Office at 575-234-5972.

VI. CONSTRUCTION

A. NOTIFICATION

The BLM shall administer compliance and monitor construction of the access road and well pad. Notify the Carlsbad Field Office at (575) 234-5972 at least 3 working days prior to commencing construction of the access road and/or well pad.

When construction operations are being conducted on this well, the operator shall have the approved APD and Conditions of Approval (COA) on the well site and they shall be made available upon request by the Authorized Officer.

B. TOPSOIL

The operator shall stockpile the topsoil of the well pad. The topsoil shall not be used to backfill the reserve pit and will be used for interim and final reclamation.

C. Closed Loop System

Closed Loop System V-Door south

Tanks are required for drilling operations: No Pits.

The operator shall properly dispose of drilling contents at an authorized disposal site.

D. FEDERAL MINERAL MATERIALS PIT

If the operator elects to surface the access road and/or well pad, mineral materials extracted during construction of the reserve pit may be used for surfacing the well pad and access road and other facilities on the lease.

Payment shall be made to the BLM prior to removal of any additional federal mineral materials from any site other than the reserve pit. Call the Carlsbad Field Office at (575) 234-5972.

E. WELL PAD SURFACING

Surfacing of the well pad is not required.

If the operator elects to surface the well pad, the surfacing material may be required to be removed at the time of reclamation.

The well pad shall be constructed in a manner which creates the smallest possible surface disturbance, consistent with safety and operational needs.

F. ON LEASE ACCESS ROADS

Road Width

The access road shall have a driving surface that creates the smallest possible surface disturbance and does not exceed fourteen (14) feet in width. The maximum width of surface disturbance, when constructing the access road, shall not exceed thirty (30) feet.

Surfacing

Surfacing material is not required on the new access road driving surface. If the operator elects to surface the new access road or pad, the surfacing material may be required to be removed at the time of reclamation.

Where possible, no improvements should be made on the unsurfaced access road other than to remove vegetation as necessary, road irregularities, safety issues, or to fill low areas that may sustain standing water.

The Authorized Officer reserves the right to require surfacing of any portion of the access road at any time deemed necessary. Surfacing may be required in the event the road deteriorates, erodes, road traffic increases, or it is determined to be beneficial for future field development. The surfacing depth and type of material will be determined at the time of notification.

Crowning


Crowning shall be done on the access road driving surface. The road crown shall have a grade of approximately 2% (i.e., a 1" crown on a 14' wide road). The road shall conform to Figure 1; cross section and plans for typical road construction.

Ditching

Ditching shall be required on both sides of the road.

Turnouts


Vehicle turnouts shall be constructed on the road. Turnouts shall be intervisible with interval spacing distance less than 1000 feet. Turnouts shall be constructed on all blind curves. Turnouts shall conform to the following diagram:

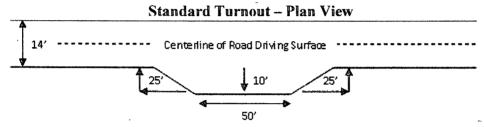

Drainage

Drainage control systems shall be constructed on the entire length of road (e.g. ditches, sidehill outsloping and insloping, lead-off ditches, culvert installation, and low water crossings).

A typical lead-off ditch has a minimum depth of 1 foot below and a berm of 6 inches above natural ground level. The berm shall be on the down-slope side of the lead-off ditch.

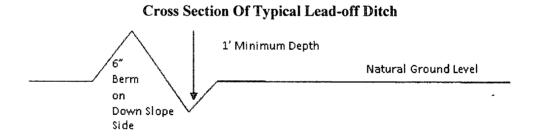

All lead-off ditches shall be graded to drain water with a 1 percent minimum to 3 percent maximum ditch slope. The spacing interval are variable for lead-off ditches and shall be determined according to the formula for spacing intervals of lead-off ditches, but may be amended depending upon existing soil types and centerline road slope (in %);

Formula for Spacing Interval of Lead-off Ditches

Example - On a 4% road slope that is 400 feet long, the water flow shall drain water into a lead-off ditch. Spacing interval shall be determined by the following formula:

400 foot road with 4% road slope: 400'/4% + 100' = 200' lead-off ditch interval **Culvert Installations**

Appropriately sized culvert(s) shall be installed at the deep waterway channel flow crossing.

Cattleguards

An appropriately sized cattleguard(s) sufficient to carry out the project shall be installed and maintained at fence crossing(s).

Any existing cattleguard(s) on the access road shall be repaired or replaced if they are damaged or have deteriorated beyond practical use. The operator shall be responsible for the condition of the existing cattleguard(s) that are in place and are utilized during lease operations.

A gate shall be constructed and fastened securely to H-braces.

Fence Requirement


Where entry is required across a fence line, the fence shall be braced and tied off on both sides of the passageway prior to cutting.

The operator shall notify the private surface landowner or the grazing allotment holder prior to crossing any fence(s).

Public Access

Public access on this road shall not be restricted by the operator without specific written approval granted by the Authorized Officer.

Figure 1 – Cross Sections and Plans For Typical Road Sections

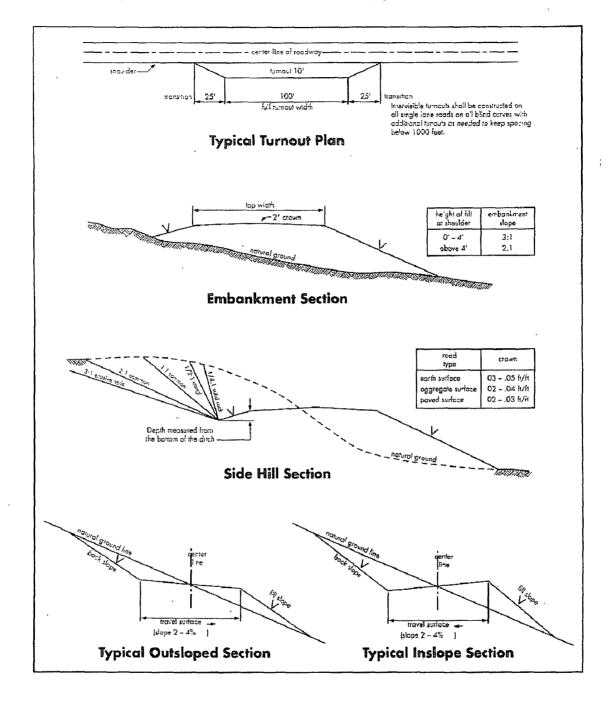

VII. DRILLING

A. DRILLING OPERATIONS REQUIREMENTS

The BLM is to be notified a minimum of 4 hours in advance for a representative to witness:

- a. Spudding well
- b. Setting and/or Cementing of all casing strings
- c. BOPE tests

⊠. Eddy County

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- 1. Although Hydrogen Sulfide has not been reported in this section, it is always a potential hazard. If Hydrogen Sulfide is encountered, please report measured amounts and formations to the BLM.
- 2. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
- 3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works is located, this does not include the dog house or stairway area.
- 4. The record of the drilling rate along with the CAL/GR/N well log run from TD to surface will be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt is to be recorded on the Completion Report.

B. CASING

Changes to the approved APD casing and cement program require submitting a sundry and receiving approval prior to work. Failure to obtain approval prior to work will result in an Incident of Non-Compliance being issued.

Centralizers required on surface casing per Onshore Order 2.III.B.1.f.

Wait on cement (WOC) time for a primary cement job will be a minimum 18 hours for a water basin, 24 hours in the potash area, or 500 pounds compressive strength, whichever is greater for all casing strings. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. See individual casing strings for details regarding lead cement slurry requirements.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

R-111-Potash

Possible high pressure air pockets in the Rustler and Salado Groups.

Possible water and brine flows in the Salado and Castile Groups.

Possible lost circulation in the Delaware and Bone Spring formations.

- 1. The 11-3/4 inch surface casing shall be set at approximately 680 feet (a minimum of 25 feet into the Rustler Anhydrite and above the salt) and cemented to the surface. If the salt is encountered at a shallower depth, the casing is to be set a minimum of 25 feet above the salt.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement.
 - b. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.
- 2. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:

 The intermediate should be set in the Fletcher Anhydrite or Lamar Limestone within 100 to 600 feet below the base of the salt.
 - Cement to surface. If cement does not circulate see B.1.a, c-d above.

 Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to potash concerns.

- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
 - a. First stage to DV tool, cement shall:
 - Cement to circulate. If cement does not circulate, contact the appropriate BLM office, before proceeding with second stage cement job.
 - b. Second stage above DV tool, cement shall:
 - Cement to circulate. If cement does not circulate, contact the appropriate BLM office, before proceeding with third stage cement job.
 - c. Third stage above DV tool, cement shall:
 - Cement to surface. If cement does not circulate, contact the appropriate BLM office.
- 4. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 5. Whenever a casing string is cemented in the R-111-Potash area, the NMOCD requirements shall be followed.

C. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Variance approved to use flex line from BOP to choke manifold. Check condition of 3" flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends.
- 3. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi. Operator is using a 5M system but testing as a 3M.

- 4. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. The tests shall be done by an independent service company.
 - b. The results of the test shall be reported to the appropriate BLM office.
 - c. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
 - d. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug.
 - e. Effective November 1, 2008, no variances will be granted on reduced pressure tests on the surface casing and BOP/BOPE. Onshore Order 2 requirements will be in effect.

D. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

RGH 101409

VIII. PRODUCTION (POST DRILLING)

A. WELL STRUCTURES & FACILITIES

Placement of Production Facilities

Production facilities should be placed on the well pad to allow for maximum interim recontouring and revegetation of the well location.

Containment Structures

The containment structure shall be constructed to hold the capacity of the entire contents of the largest tank, plus 24 hour production, unless more stringent protective requirements are deemed necessary by the Authorized Officer.

Painting Requirement

All above-ground structures including meter housing that are not subject to safety requirements shall be painted a flat non-reflective paint color Shale Green, Munsell Soil Color Chart # 5Y 4/2

B. PIPELINES

STANDARD STIPULATIONS FOR SURFACE INSTALLED PIPELINES

A copy of the APD and attachments, including stipulations, survey plat and/or map, will be on location during construction. BLM personnel may request to you a copy of your permit during construction to ensure compliance with all stipulations.

Holder agrees to comply with the following stipulations to the satisfaction of the Authorized Officer:

- 1. The holder shall indemnify the United States against any liability for damage to life or property arising from the occupancy or use of public lands under this grant.
- 2. The holder shall comply with all applicable Federal laws and regulations existing or hereafter enacted or promulgated. In any event, the holder shall comply with the Toxic Substances Control Act of 1976 as amended, 15 USC 2601 et seq. (1982) with regards to any toxic substances that are used, generated by or stored on the right-of-way or on facilities authorized under this right-of-way grant. (See 40 CFR, Part 702-799 and especially, provisions on polychlorinated biphenyls, 40 CFR 761.1-761.193.) Additionally, any release of toxic substances (leaks, spills, etc.) in excess of the reportable quantity established by 40 CFR, Part 117 shall be reported as required by the Comprehensive Environmental Response, Compensation, and Liability Act, section 102b. A copy of any report required or requested by any Federal agency or State government as a result of a reportable release or spill of any toxic substances shall be furnished to the authorized officer concurrent with the filing of the reports to the involved Federal agency or State government.
- 3. The holder agrees to indemnify the United States against any liability arising from the release of any hazardous substance or hazardous waste (as these terms are defined in the Comprehensive Environmental Response, Compensation and Liability Act of 1980, 42 U.S.C. 9601, et seq. or the Resource Conservation and Recovery Act, 42 U.S.C. 6901, et seq.) on the Right-of-Way (unless the release or threatened release is wholly unrelated to activity of the Right-of-Way holder's activity on the Right-of-Way), or resulting from the activity of the Right-of-Way holder on the Right-of-Way. This agreement applies without regard to whether a release is caused by the holder, its agent, or unrelated third parties.
- 4. The holder shall be liable for damage or injury to the United States to the extent provided by 43 CFR Sec. 2883.1-4. The holder shall be held to a standard of strict liability for damage or injury to the United States resulting from pipe rupture, fire, or spills caused or substantially aggravated by any of the following within the right-of-way or permit area:
- a. Activities of the holder including, but not limited to construction, operation, maintenance, and termination of the facility.

- b. Activities of other parties including, but not limited to:
 - (1) Land clearing.
 - (2) Earth-disturbing and earth-moving work.
 - (3) Blasting.
 - (4) Vandalism and sabotage.
- c. Acts of God.

The maximum limitation for such strict liability damages shall not exceed one million dollars (\$1,000,000) for any one event, and any liability in excess of such amount shall be determined by the ordinary rules of negligence of the jurisdiction in which the damage or injury occurred.

This section shall not impose strict liability for damage or injury resulting primarily from an act of war or from the negligent acts or omissions of the United States.

- 5. If, during any phase of the construction, operation, maintenance, or termination of the pipeline, any oil, salt water, or other pollutant should be discharged from the pipeline system, impacting Federal lands, the control and total removal, disposal, and cleaning up of such oil, salt water, or other pollutant, wherever found, shall be the responsibility of the holder, regardless of fault. Upon failure of the holder to control, dispose of, or clean up such discharge on or affecting Federal lands, or to repair all damages resulting therefrom, on the Federal lands, the Authorized Officer may take such measures as he deems necessary to control and clean up the discharge and restore the area, including, where appropriate, the aquatic environment and fish and wildlife habitats, at the full expense of the holder. Such action by the Authorized Officer shall not relieve the holder of any responsibility as provided herein.
- 6. All construction and maintenance activity will be confined to the authorized right-of-way width of ____25 feet.
- 7. No blading or clearing of any vegetation will be allowed unless approved in writing by the Authorized Officer.
- 8. The holder shall install the pipeline on the surface in such a manner that will minimize suspension of the pipeline across low areas in the terrain. In hummocky of duney areas, the pipeline will be "snaked" around hummocks and dunes rather then suspended across these features.
- 9. The pipeline shall be buried with a minimum of 24 inches under all roads, "two-tracks," and trails. Burial of the pipe will continue for 20 feet on each side of each crossing. The condition of the road, upon completion of construction, shall be returned to at least its former state with no bumps or dips remaining in the road surface.

- 10. The holder shall minimize disturbance to existing fences and other improvements on public lands. The holder is required to promptly repair improvements to at least their former state. Functional use of these improvements will be maintained at all times. The holder will contact the owner of any improvements prior to disturbing them. When necessary to pass through a fence line, the fence shall be braced on both sides of the passageway prior to cutting of the fence. No permanent gates will be allowed unless approved by the Authorized Officer.
- 11. In those areas where erosion control structures are required to stabilize soil conditions, the holder will install such structures as are suitable for the specific soil conditions being encountered and which are in accordance with sound resource management practices.
- 12. Excluding the pipe, all above-ground structures not subject to safety requirement shall be painted by the holder to blend with the natural color of the landscape. The paint used shall be a color which simulates "Standard Environmental Colors" **Shale Green**, Munsell Soil Color No. 5Y 4/2; designated by the Rocky Mountain Five State Interagency Committee.
- 13. The pipeline will be identified by signs at the point of origin and completion of the right-of-way and at all road crossings. At a minimum, signs will state the holder's name, BLM serial number, and the product being transported. Signs will be maintained in a legible condition for the life of the pipeline.
- 14. The holder shall not use the pipeline route as a road for purposes other than routine maintenance as determined necessary by the Authorized Officer in consultation with the holder. The holder will take whatever steps are necessary to ensure that the pipeline route is not used as a roadway.
- 15. Any cultural and/or paleontological resource (historic or prehistoric site or object) discovered by the holder, or any person working on his behalf, on public or Federal land shall be immediately reported to the authorized officer. Holder shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the authorized officer. An evaluation of the discovery will be made by the authorized officer to determine appropriate cultural or scientific values. The holder will be responsible for the cost of evaluation and any decision as to proper mitigation measures will be made by the authorized officer after consulting with the holder.

C. ELECTRIC LINES

STANDARD STIPULATIONS FOR OVERHEAD ELECTRIC DISTRIBUTION

LINES

A copy of the APD and attachments, including stipulations, survey plat and/or map, will be on location during construction. BLM personnel may request to you a copy of your permit during construction to ensure compliance with all stipulations.

Holder agrees to comply with the following stipulations to the satisfaction of the Authorized Officer:

- 1. The holder shall indemnify the United States against any liability for damage to life or property arising from the occupancy or use of public lands under this grant.
- 2. The holder shall comply with all applicable Federal laws and regulations existing or hereafter enacted or promulgated. In any event, the holder shall comply with the Toxic Substances Control Act of 1976 as amended, 15 USC 2601 et seq. (1982) with regards to any toxic substances that are used, generated by or stored on the right-of-way or on facilities authorized under this right-of-way grant. (See 40 CFR, Part 702-799 and especially, provisions on polychlorinated biphenyls, 40 CFR 761.1-761.193.) Additionally, any release of toxic substances (leaks, spills, etc.) in excess of the reportable quantity established by 40 CFR, Part 117 shall be reported as required by the Comprehensive Environmental Response, Compensation, and Liability Act, section 102b. A copy of any report required or requested by any Federal agency or State government as a result of a reportable release or spill of any toxic substances shall be furnished to the authorized officer concurrent with the filing of the reports to the involved Federal agency or State government.
- 3. The holder agrees to indemnify the United States against any liability arising from the release of any hazardous substance or hazardous waste (as these terms are defined in the Comprehensive Environmental Response, Compensation and Liability Act of 1980, 42 U.S.C. 9601, et seq. or the Resource Conservation and Recovery Act, 42 U.S.C. 6901, et seq.) on the Right-of-Way (unless the release or threatened release is wholly unrelated to the Right-of-Way holder's activity on the Right-of-Way), or resulting from the activity of the Right-of-Way holder on the Right-of-Way. This agreement applies without regard to whether a release is caused by the holder, its agent, or unrelated third parties.
- 4. There will be no clearing or blading of the right-of-way unless otherwise agreed to in writing by the Authorized Officer.
- 5. Powerlines shall be constructed in accordance to standards outlined in "Suggested Practices for Raptor Protection on Powerlines," Raptor Research Foundation, Inc., 1981. The holder shall assume the burden and expense of proving that pole designs not shown in the above publication are "raptor safe." Such proof shall be provided by a raptor expert approved by the Authorized Officer. The BLM reserves the right to require modification or additions to all powerline structures placed on this right-of-way, should they be necessary to ensure the safety of large perching birds. Such modifications and/or additions shall be made by the holder without liability or expense to the United States.

- 6. The holder shall minimize disturbance to existing fences and other improvements on public lands. The holder is required to promptly repair improvements to at least their former state. Functional use of these improvements will be maintained at all times. The holder will contact the owner of any improvements prior to disturbing them. When necessary to pass through a fence line, the fence shall be braced on both sides of the passageway prior to cutting the fence. No permanent gates will be allowed unless approved by the Authorized Officer.
- 7. The BLM serial number assigned to this authorization shall be posted in a permanent, conspicuous manner where the power line crosses roads and at all serviced facilities. Numbers will be at least two inches high and will be affixed to the pole nearest the road crossing and at the facilities served.
- 8. Upon cancellation, relinquishment, or expiration of this grant, the holder shall comply with those abandonment procedures as prescribed by the Authorized Officer.
- 9. All surface structures (poles, lines, transformers, etc.) shall be removed within 180 days of abandonment, relinquishment, or termination of use of the serviced facility or facilities or within 180 days of abandonment, relinquishment, cancellation, or expiration of this grant, whichever comes first. This will not apply where the power line extends service to an active, adjoining facility or facilities.
- 10. Any cultural and/or paleontological resource (historic or prehistoric site or object) discovered by the holder, or any person working on his behalf, on public or Federal land shall be immediately reported to the Authorized Officer. Holder shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery will be made by the Authorized Officer to determine appropriate actions to prevent the loss of significant cultural or scientific values. The holder will be responsible for the cost of evaluation and any decision as to proper mitigation measures will be made by the Authorized Officer after consulting with the holder.

11. Special Stipulations:

- For reclamation remove poles, lines, transformer, etc. and dispose of properly.
- Fill in any holes from the poles removed.
- See attached reclamation plans.

IX. INTERIM RECLAMATION & RESERVE PIT CLOSURE

A. INTERIM RECLAMATION

If the well is a producer, interim reclamation shall be conducted on the well site in accordance with the orders of the Authorized Officer. The operator shall submit a Sundry Notices and Reports on Wells (Notice of Intent), Form 3160-5, prior to conducting interim reclamation.

During the life of the development, all disturbed areas not needed for active support of production operations should undergo interim reclamation in order to minimize the environmental impacts of development on other resources and uses.

The operators should work with BLM surface management specialists to devise the best strategies to reduce the size of the location. Any reductions should allow for remedial well operations, as well as safe and efficient removal of oil and gas.

During reclamation, the removal of caliche is important to increasing the success of revegetating the site. Removed caliche may be used for road repairs, fire walls or for building other roads and locations. In order to operate the well or complete workover operations, it may be necessary to drive, park and operate on restored interim vegetation within the previously disturbed area. Disturbing revegetated areas for production or workover operations will be allowed. If there is significant disturbance and loss of vegetation, the area will need to be revegetated. Communicate with the appropriate BLM office for any exceptions/exemptions if needed.

Seed Mixture for LPC Sand/Shinnery Sites

The holder shall seed all disturbed areas with the seed mixture listed below. The seed mixture shall be planted in the amounts specified in pounds of pure live seed (PLS)* per acre. There shall be <u>no</u> primary or secondary noxious weeds in the seed mixture. Seed will be tested and the viability testing of seed will be done in accordance with State law(s) and within nine (9) months prior to purchase. Commercial seed will be either certified or registered seed. The seed container will be tagged in accordance with State law(s) and available for inspection by the authorized officer.

Seed will be planted using a drill equipped with a depth regulator to ensure proper depth of planting where drilling is possible. The seed mixture will be evenly and uniformly planted over the disturbed area (smaller/heavier seeds have a tendency to drop the bottom of the drill and are planted first). The holder shall take appropriate measures to ensure this does not occur. Where drilling is not possible, seed will be broadcast and the area shall be raked or chained to cover the seed. When broadcasting the seed, the pounds per acre are to be doubled. The seeding will be repeated until a satisfactory stand is established as determined by the authorized officer. Evaluation of growth will not be made before completion of at least one full growing season after seeding.

Species to be planted in pounds of pure live seed* per acre:

Species	<u>lb/acre</u>
Plains Bristlegr	ass 5lbs/A
Sand Bluestem	5lbs/A
Little Bluestem	3lbs/A
Big Bluestem	6lbs/A

Plains Coreopsis Sand Dropseed

**Four-winged Saltbush

5lbs/A

2lbs/A

1lbs/A

* This can be used around well pads and other areas where caliche cannot be removed.

*Pounds of pure live seed:

Pounds of seed x percent purity x percent germination = pounds pure live seed

X. FINAL ABANDONMENT & REHABILITATION REQUIREMENTS

Upon abandonment of the well and/or when the access road is no longer in service the Authorized Officer shall issue instructions and/or orders for surface reclamation and restoration of all disturbed areas.

On private surface/federal mineral estate land the reclamation procedures on the road and well pad shall be accomplished in accordance with the private surface land owner agreement.