

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED
OMB NO. 1004-0135
Expires: November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

OXY USA Inc.

16696

3a. Address

P.O. Box 50250, Midland, TX 79710-0250

3b. Phone No. (include area code)

432-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

SL-2200 FSL 2260 FWL NESW(K) Sec 4 T22S R31E
BHL-1956 FSL 461 FWL NWSW(L) " " "

5. Lease Serial No.

NMNM0417696

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No

8. Well Name and No.

Lost Tank 4 Federal #12

9. API Well No.

30-015-37955

10. Field and Pool, or Exploratory Area

Lost Tank Delaware, West

11. County or Parish, State

Eddy NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☐ Acidize

☐ Deepen

☐ Production (Start/Resume)

☐ Water Shut-Off

☐ Alter Casing

☐ Fracture Treat

☐ Reclamation

☐ Well Integrity

☐ Casing Repair

☐ New Construction

☐ Recomplete

☒ Other Amend

☒ Change Plans

☐ Plug and Abandon

☐ Temporarily Abandon

Intermediate/Prod

☐ Convert to Injection


☐ Plug Back

☐ Water Disposal


Casing & Cementing

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

See attached.

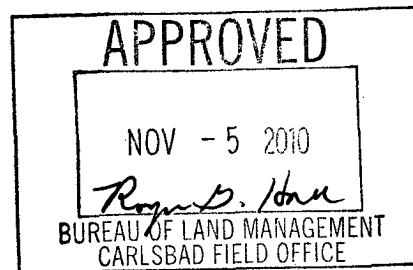

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

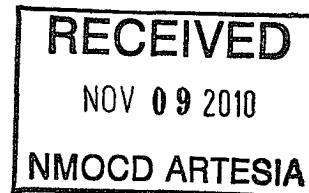

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

David Stewart

Title

Sr. Regulatory Analyst

Date

10/26/10

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

OXY USA Inc

Lost Tank 4 Federal #12

API No. 30-015-37955

STATE: NM

COUNTY: Eddy

SURFACE LOCATION: 2200 FSL 2260 FWL NESW(K) Sec 4 T22S R31E

BOTTOM HOLE LOCATION: 1956 FSL 461 FWL NWSW(L) Sec 4 T22S R31E

SL: LAT:32.4192392° **LONG:** 103.7835945° **X:** 669637.3 **Y:** 516669.7 **NAD:** 27

BH: LAT:32.4185623° **LONG:** 103.7894229° **X:** 667840.0 **Y:** 516414.2 **NAD:** 27

1. CEMENT PROGRAM (Changes form Original APD): :

Intermediate Interval

Interval	Amount sx	Ft of Fill	Type	Gal/Sk	PPG	Ft ³ /sk	24 Hr Comp
Intermediate (TOC: 0' -3900')							
Lead: 0' - 3416 (150 % Excess)	860	3416	Light Premium Plus Cement, with 5% Salt, 5 lb/sk Gilsonite, & 0.125 lb/sk Poly-E-Flake, 1% Halad-344, 2%Calcium Chloride	9.63	12.9	1.91	851 psi
Tail: 3416 ' -3900' (150 % Excess)	200	484'	Premium Plus cement with 1% WellLife 734	6.38	14.80	1.34	1343 psi

Production Interval

Interval	Amount sx	Ft of Fill	Type	Gal/Sk	PPG	Ft ³ /sk	24 Hr Comp
Production (TOC: 6000') 1st Stage							
Lead: 6000' - 8496' (100 % Excess)	550	2496'	Super H Cement with 0.5% Halad-344 (Low Fluid Loss Control), 0.4% CFR-3 (Dispersant), 5 lb/sk Gilsonite, 1 lb/sk Salt, 0.3% HR-800 (Retarder), 0.125 lb/sk Ploy-E-Flake (lost circulation additive)	7.87	13.20	1.62	1817 psi
DV Tool @ 6000							
Production (TOC: 3950') 2nd Stage							
Lead: 3950' - 6000' (200% Excess)	670	2050'	Super H Cement with 0.5% Halad-344 (Low Fluid Loss Control), 0.125 lb/sk Poly-E-Flake (Lost Circulation Additive), 5 lb/sk Gilsonite (lost circulation additive), 0.4% CFR-3 (dispersant), 1 lb/sk Salt	7.86	13.20	1.61	1536 psi
Pack-Off Stage Tool @ 3950 '							
Production (TOC: Surface) 3rd Stage							
Lead: 0' - 3173 ' (35 % Excess)	370	3173 '	Light Premium Plus with 3 lb/sk Salt	11.67	12.4	2.08	560 psi
Tail: 3173 ' - 3950 ' 35 % Excess of Annular Volume)	150	777 '	Premium Plus with 5 lb/sk Gilsonite (Low Fluid Loss Control), 0.125 lb/sk Poly-E-Flake (Lost circulation additive)	5.81	14.80	1.33	1750 psi

Casing

8-5/8" 32# J55 LTC
5-1/2" 17# J-55, LTC

Hole Size

10-5/8
7-7/8"

Interval

0-3900'
0-8496'

TOC

Surface
Surface

DVT @ 6000'

POST @ 3950'

**PECOS DISTRICT
CONDITIONS OF APPROVAL**

OPERATOR'S NAME:	OXY USA Inc.
LEASE NO.:	NMNM0417696
WELL NAME & NO.:	Lost Tank 4 Federal #12
SURFACE HOLE FOOTAGE:	2200' FSL & 2260' FWL
BOTTOM HOLE FOOTAGE:	1956' FSL & 461' FWL
LOCATION:	Section 04, T. 22 S., R 31 E., NMPM
COUNTY:	Eddy County, New Mexico

B. CASING

1. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:
The intermediate should be set in the Fletcher Anyhydrite or Lamar Limestone within 100 to 600 feet below the base of the salt.

☒ Cement to surface. If cement does not circulate see B.1.a, c-d above.
Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to potash.

The DV tool should be placed a minimum of 50 feet below the intermediate casing shoe.

Centralizers required on directional leg, must be type for directional service and minimum of one every other joint.

2. The minimum required fill of cement behind the 5-1/2 inch production casing is:

- a. First stage to DV tool, cement shall:

☒ Cement to circulate. If cement does not circulate, contact the appropriate BLM office, before proceeding with second stage cement job. Operator should have plans as to how they will achieve circulation on the next stage.

- b. Second stage above DV tool, cement shall:

☒ Cement to circulate. If cement does not circulate, contact the appropriate BLM office before proceeding with third stage cement job. Operator should have plans as to how they will achieve circulation on the next stage.

- c. Third stage above DV tool, cement shall:

☒ Cement to surface. If cement does not circulate, contact the appropriate BLM office.

RGH 110510

5 1/2	inside the	8 5/8	<u>Design Factors</u>						
Segment	Grade	#/ft	Coupling	Joint	Collapse	Burst	Length	Weight	
"A"	J 55	17.00	LT&C	1.58	1.20	1.34	8,496	144,432	
"B"							0	0	
"C"							0	0	
"D"							0	0	
7,984	= Max Vertical Depth of the Lateral Portion of Wellbore.						Totals:	8,496	144,432
A	Segment Design Factors would be:				1.82	1.23	if it were a vertical wellbore.		
<u>Compare Cement Vol(s), Proposed to Min, with 3900 ft overlap above 2nd csg shoe.</u>									
Hole Size	Annular Volume	Proposed Sx Cmt	CuFt Cmt Proposed	Min Cu Ft	Excess DVT Cmt	Drilling Mud Wt	Calc MASP	Req'd BOPE	Min Dist Hole-Cplg
7 7/8	0.1733	1740	2939	1493	O K	9.60			0.91
Comments for 5 1/2 " Csg		4200 KOP, 33° curve 2 1/100ft, 5841 EOC, hold slope to 8,496MVD = 7,984VTD. Sundry for a 3-stage cement job. DV Tool at +/- 6000'and pack-off stage tool @ 3950.							