


STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input checked="" type="checkbox"/>
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

OIL CONSERVATION DIVISION

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

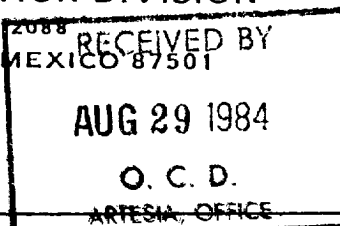

Form C-103  
Revised 10-1-73

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
L-4861	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name	
2. Name of Operator MWJ PRODUCING COMPANY		8. Farm or Lease Name State GWA	
3. Address of Operator 1804 First National Bank Bldg Midland, Texas 79701		9. Well No. 2	
4. Location of Well UNIT LETTER <u>P</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>36</u> TOWNSHIP <u>20S</u> RANGE <u>27E</u> NMPM.		10. Field and Pool, of Wildcat <u>Horton Blaine</u> <u>W/C Bone Springs</u>	
15. Elevation (Show whether DF, RT, GR, etc.) 3225.7' GL		12. County Eddy	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <u>Perforate and Acidize</u> <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8/20/84: MI & RU PU. Unset pkr & pulled 136 jts 2-3/8" tbg & std SN. LD pkr. RU CRC & ran Baker Model "D" expendable plug to 4730 & set. Ran std SN & 136 jts 2-3/8" tbg & flanged up w/SN @ 4395'. RU Western Co & loaded & tstd to 1500 psi. Spt'd 500 gals 15% HCL ac & 2% KCL wtr. Pulled 136 jts tbg & LD 13 jts. CRC perf'd CHRRRY CANYON from 4367-73' w/2 SPF w/4" OD csg gun. POOH & RD CRC. Ran Baker Model R-3 pkr, std SN & 133 jts 2-3/8" tbg w/NS @ 4298' (top of pkr). Western rev'd ac back in tbg w/13 bbls 2% KCL wtr. Set pkr w/13000# tension & flanged up. Press csg to 1000 psi, brk dn @ 1400 psi. Acd w/500 gals 15% HCL ac @ 1.5 BPM @ 950 psi w/14.5 bbls flush wtr. ISIP 900 psi, 5 min 700 psi. RU & swbd to pit, rec'd 17 bbls flush w/est 9 bbls ac wtr.

8/21-23: Swbd. RD & MO.

8/24/84: SI.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Pat Drexler TITLE Pat Drexler - Agent DATE 8/27/84

APPROVED BY ORIGINAL SIGNED BY LARRY BROOKS  
CONDITIONS OF APPROVAL, IF ANY, GEOLOGIST - NMOC

TITLE \_\_\_\_\_ DATE SEP 10 1984