

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Conservation Division

611 S. 1st Street

Artesia, NM 88210-2834

FORM APPROVED

Bureau No. 1004-0135

Expires: March 31, 1993

c/s

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir

Use "APPLICATION FOR PERMIT --" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well



OIL
WELL

GAS
WELL

OTHER

2. Name of Operator

TEXACO EXPLORATION & PRODUCTION INC.

3. Address and Telephone No.

205 E. Bender, HOEBBS, NM 88240

397-0405

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit Letter

E

2310

Feet From The

NORTH Line and

330 Feet From The

WEST

Line

Section 13

Township 22S

Range

31E

5. Lease Designation and Serial No.

6. If Indian, Alottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and Number

NEFF 13 FEDERAL

9. API Well No.

30 015 26929

10. Field and Pool, Exploratory Area
LIVINGSTON RIDGE DELAWARE

11. County or Parish, State

EDDY, NM

12.

Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data

TYPE OF SUBMISSION

Notice of Intent

☒ Subsequent Report

Final Abandonment Notice

TYPE OF ACTION

Abandonment

☒ Recompletion

Plugging Back

Casing Repair

Altering Casing

☒ OTHER: LOWER BRUSHY CANYON

Change of Plans

New Construction

Non-Routine Fracturing

Water Shut-Off

Conversion to Injection

Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

7-27-00: MIRU, NDWH, NUBOP.

7-28-00: TIH W/BIT, CSG SCRAPER, & PU WS. STOP BIT @ 2621'.

7-31-00: TAG @ 8086'. TIH W/BI, CAVITY, BAILER ON WS. TAG @ 8086. C/O TO 8138.

8-01-00: TIH & RUN CCL/GR 8115-6500. TIH W/PERF GUN & PERF IN LOWER BRUSHY CANYON FORMATION 8077-8094.8059-8076. 8052-8058, 168-42" HLS.RDWL.

8-02-00: TIH W/PKR & SN ON TBG. TEST TO 3000#. SET PKR @ 7969'. PUMP DN ANNULUS W/REV UNIT. ACIDIZE LOWER BRUSHY CANYON PERFS 8052-8094 W/1500 GALS 15% NEFE HCL. RU SWAB. FL @ 800'. END FL @ 7500'. RD SWAB. REL PKR. LOWER TOOLS & TAG SALT FILL @ 8075'. WASH OUT SALT TO 8115'. PULL PKR TO 7969 & SET.

8-03-00: FL @ 4000'. SWAB DRY. FRAC LOWER BRUSHY CANYON PERFS 8052-8094 W/22,076 GALS 30# X-LINKED GEL. FLSH W/48 BBLs.

8-04-00: REL PKR. PKR DRAGGING. PULL 32 JTS TO 6959'. PKR HUNG UP.

8-05-00: RUN FREE POINT. FREE @ 6950. PKR STUCK @ 6957'. PUMP 35 BBLs 2% KCL WTR DN TBG. TIH & CHEM CUT TBG @ 6942'. TIH W/OVERSOT, BMPR SUB, JARS, DC'S. LATCH ON FSH @ 6931'.

8-07-00: TIH W/OS, GRAPPLE, BMPR SUB, JARS, DC'S. LATCH ONTO FSH @ 6950'. JAR LOOSE. PULL TO 6644'. RU AIR UNIT. PKR CAME FREE.

8-08-00: PULL PKR 120'. TIH W/JUNK MILL, DC'S & TBG TO 5986'.


8-09-00: TIH TO 8080'. C/O SAND TO 8309'. PULL MILL TO 6750'.

8-10-00: TIH & TAG @ 8309. RUN SN, TBG. SN @ 8146'. TAC @ 7858'. NDBOP. NUWH. SET TAC.

8-11-00: TIH W/RDS, &N PMP.

8-14-00: HUNG ON & LOAD & TEST TO 500#-OK. WELL PUMPING @ 5:00 PM.

8-18-00: ON 24 HR OPT. PUMPED 160 BO, 221 BW, & 212 MCF. BRUSHY CANYON 7012-8094. FINAL REPORT

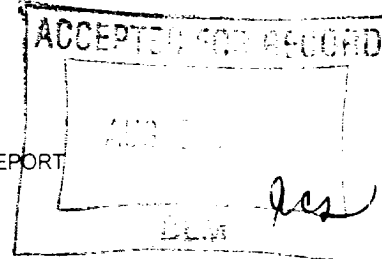

14. I hereby certify that the foregoing is true and correct

SIGNATURE

TITLE Engineering Assistant

DATE

9/25/00

TYPE OR PRINT NAME

J. Denise Leake

(This space for Federal or State office use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE

RECEIVED

AUG 29 2000

BLM
POSWELL, NM