State of New Mexico Energy, Minerals and Natural Resources Department

Susana Martinez

Governor

David Martin

Cabinet Secretary-Designate

Brett F. Woods, Ph.D. Deputy Cabinet Secretary Jami Bailey, Division Director Oil Conservation Division



New Mexico Oil Conservation Division approval and conditions listed below are made in accordance with OCD Rule 19.15.7.11 and are in addition to the actions approved by BLM on the following 3160-4 or 3160-5 form.

Operator Sign	nature Date: 6/20/1	4,.											
	Type: P&A				an	ge [Rec	or	np	let	e/l	DΗ	IC
Well informa	tion:												
API WELL#	Well Name	Well #	Operator Name	Туре	Stat	County	Surf_Owner	UL	Sec	Twp	N/S	Rng	W/E
30-039-21476-00- 00	VALENCIA CANYON UNIT	010	XTO ENERGY, INC	G	A	Rio Arriba	F	Н	34	28	N	4	W
Conditions of	f Approval:		•										
Notify NMO	CD 24hrs prior to b	eginn	ing operations	3									
Provide CBL	to agencies for revi	iew/a	pproval prior t	to ce	me	nting							
Extend top of	f Ojo Alamo plug to	340	0 feet										

NMOCD Approved by Signature

7/10/14 Date Form 3160-5 (August 2007) 54

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED OMB NO. 1004-0137

Expires July 31, 2010

Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an

MIN 23 2017 NMNM-14922 6. If Indian, Allottee or Tribe Name

abandoned well. Use Fori	m 3160-3 (APD) fo	r such proposals.	11 m m 2 2 2 3 3 3 3 3	US FOREST SERVICE SURFACE			
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No			
1. Type of Well Oil Well X Gas Well Other 2. Name of Operator XTO ENERGY INC.				8. Well Name and No. VALENCIA CANYON UNIT #10 9. API Well No.			
3a. Address		3b. Phone No. (include ar	rea code)	30-039-21476 10. Field and Pool, or Exploratory Area			
382 CR 3100 AZTEC, NM 87410		505-333-3630					
4. Location of Well (Footage, Sec., T., R., M., or Survey I 1830' FNL & 820' FEL SENE Sec.3 12. CHECK APPROPRIATE	4 (H) -T28N-R4W	N.M.P.M. DICATE NATURE OF N	NOTICE REPO	11. County or Parish, State RIO ARRIBA NM ORT OR OTHER DATA			
TYPE OF SUBMISSION			PE OF ACTION				
X Notice of Intent Subsequent Report Final Abandonment Notice	Acidize Alter Casing Casing Repair Change Plans Convert to Injecti	Deepen Fracture Treat New Construction X Plug and Abandon Plug Back	Reclamation Recomple	te Other			
3. Describe Proposed or Completed Operation (clearly	y state all pertinent deta	ils, including estimated starti	ing date of any pr	oposed work and approximate duration thereof.			

If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

XTO Energy Inc. intends to plug and abandon this well per the attached procedure and will be using a Closed Loop System. Please see also the attached current and proposed wellbore diagrams.

BLM'S APPROVAL OR ACCEPTANCE OF THIS action does not relieve the lessee and OPERATOR FROM OBTAINING ANY OTHER authorization required for operations On Federal and Indian Lands

102 ZO14

SEE ATTACHED FOR LAVORAGE SUPPROVAL CONS. DIV DIST. 3

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)	
	itle REGULATORY ANALYST
Signature Sherry Amouron I	Date 6/20/2014
THIS SPACE FOR FEDERAL	OR STATE OFFICE USE
Approved by Troy Salvers	Title Petroleum Engineer Pala 2014
Conditions of approval, ifany, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

LWA	
MTG	
Approved	

PLUG AND ABANDONMENT PROCEDURE

June 3, 2014

Valencia Canyon Unit #10

Choza Mesa Pictured Cliffs

	1830' FNL and 820' FEL, Section 34, T28N, R4W Rio Arriba County, New Mexico / API 30-039-21476 Lat:/ Lat:/
Note:	All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class B, mixed at 15.6 ppg with a 1.18 cf/sx yield.
1.	Install and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP.
2.	Rods: Yes, NoX, Unknown Tubing: YesX_, No, Unknown, Size2-3/8", Length4266' Packer: Yes, NoX, Unknown, Type If this well has rods or a packer, then modify the work sequence in step #2 as appropriate. NOTE: BLM requires a CBL log to be run on all wells where the cement did not circulate to surface or where a T.S. or CBL log was not previously run. The procedure will be modified as necessary based on the CBL.
3.	Plug #1 (Pictured Cliffs interval and Fruitland top, 4074' – 3849'): Round trip 4.5" gauge ring to 4074'or as deep as possible. RIH and set 4.5" CR at 4074'. Pressure test tubing to 1000#.

Circulate well clean. Pressure test casing to 800 PSI. If casing does not test, then spot or tag subsequent plug as appropriate. Mix and pump 21 sxs Class B cement above CR to isolate the Pictured Cliffs interval and cover the Fruitland top. PUH.

See COA

4. Plug #2 (Kirtland and Ojo Alamo tops, 3734' - 3444'): Mix and pump 21 sxs cement inside casing to cover the Kirtland and Ojo Alamo tops. PUH.

See COA

- 5. Plug #3 (Nacimiento top, 2426'- 2326'): Mix and pump 12 sxs cement inside casing to cover the Nacimiento top. TOH and LD tubing.
- 6. Plug #4 (Surface Casing shoe, 304' to Surface): Perforate 3 squeeze holes at 304'. Establish circulation out bradenhead with water and circulate the BH annulus clean. Mix approximately 110 sxs Class B cement and pump down the 4.5" casing to circulate good cement out bradenhead. Shut in well and WOC.
- 7. ND BOP and cut off casing below surface casing flange. Install P&A marker with cement to comply with regulations. RD, move off location, cut off anchors and restore location.

Valencia Canyon Unit #10

Current

Choza Mesa Pictured Cliffs 1830' FNL, 820' FEL, Section 34, T-28-N, R-4-W, Rio Arriba County, NM / API #30-039-21476

Today's Date: 10/16/12

Spud: 10/14/77 Completed: 12/20/77 Elevation: 7276' GL

7288' KB

12.25" hole

8-5/8", 24#, K-55 Casing set @ 254'
Cement with 250 sxs (Circulated to Surface)

TOC unknown, did not circulate and calculated cement should have been to surface. Similar wells have casing issues above the 1100'.

2-3/8" tubing at 4266'
(137 jts, 4.7#, J-55, SN and notched collar)

Nacimiento @ 2376' *est

Ojo Alamo @ 3494' *est

Kirtland @ 3684' *est

Fruitland @ 3899 *est

Pictured Cliffs @ 4124'

Pictured Cliffs Perforations: 4124' – 4272'

4.5", 11.6#/10.5#, K-55 Casing set @ 4369' Cement with 1235 sxs (1729 cf)

7-7/8" hole

TD 4370' PBTD 4346'

Valencia Canyon Unit #10 Proposed P&A

Choza Mesa Pictured Cliffs 1830' FNL, 820' FEL, Section 34, T-28-N, R-4-W, Rio Arriba County, NM / API #30-039-21476

Today's Date: 10/16/12

Spud: 10/14/77 Completed: 12/20/77 Elevation: 7276' GL

7288' KB

12.25" hole

12.25 1101

Nacimiento @ 2376' *est


Ojo Alamo @ 3494' *est

Kirtland @ 3684' *est

Fruitland @ 3899 *est

Pictured Cliffs @ 4124'

7-7/8" hole

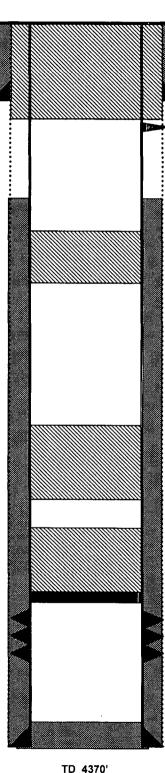

TD 4370' PBTD 4346'

8-5/8", 24#, K-55 Casing set @ 254' Cement with 250 sxs (Circulated to Surface)

Set CR @ 304'

Plug #4: 304' - 0' Class B cement, 110 sxs

TOC unknown, did not circulate and calculated cement should have been to surface. Similar wells have casing issues above the 1100'.

See CoA Plug #3: 2426' - 2326'

Plug #3: 2426' - 2326' Class B cement, 12 sxs

See COA

Plug #2: 3734' - 3444' Class B cement, 26 sxs

Plug #1: 4074' - 3849' Class B cement, 21 sxs

Set CR @ 4074'

Pictured Cliffs Perforations: 4124' – 4272'

4.5", 11.6#/10.5#, K-55 Casing set @ 4369' Cement with 1235 sxs (1729 cf)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: Valencia Canyon Unit #10

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
- 3. The following modifications to your plugging program are to be made:
 - a) Adjust the placement of plug #2 (3816-3526) ft. to cover the Kirtland and Ojo Alamo tops. Adjust cement volume accordingly.
 - b) Bring the top of plug #3 to 2277 ft. to cover the Nacimiento top. Adjust cement volume accordingly.

Operator will run a CBL to verify cement top. Outside plugs will be required if cement top is not adequate for zonal isolation. Submit electronic copy of the log for verification to the following BLM address: tsalyers@blm.gov

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.