	UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT			OM	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No.	
				5. Lease Serial No.		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					NMNM021121 6. If Indian, Allottee or Tribe Name	
				7. If Unit or CA/A	Agreement, Name and/or No	
SUBMIT IN TRIPLICATE - Other instructions on page 2				SW131	SW131	
1. Type of Well	Gas Well 🔲 Oth		8. Well Name and No. MONCRIEF FEDERAL 1			
2. Name of Operator Contact: TOYA COLVIN BP AMERICA PRODUCTION COMPANY Mail: Toya.Colvin@bp.com				9. API Well No. 30-045-0808	9. API Well No. 30-045-08084-00-S1	
3a. Address 501 WESTLA HOUSTON, T	KE PARK BLVD X 77079		b. Phone No. (include area code h: 281.892.5369			
4. Location of Well	(Footage, Sec., T	., R., M., or Survey Description)		11. County or Par	ish, State	
	R12W SENE 14 Lat, 108.081090	50FNL 1190FEL W Lon		SAN JUAN (COUNTY, NM	
12. 0	CHECK THE AI	PPROPRIATE BOX(ES) TC) INDICATE NATURE (DF NOTICE, REPORT, OR (OTHER DATA	
TYPE OF SU	BMISSION		TYPE O	TYPE OF ACTION		
Notice of Int	tent	□ Acidize	Deepen	□ Production (Start/Resume) 🗖 Water Shut-Of	
□ Subsequent]		□ Alter Casing	Hydraulic Fracturing	_	U Well Integrity	
		Casing Repair	□ New Construction	□ Recomplete	□ Other	
Final Aband	onment Notice	Change Plans	Plug and Abandon	Temporarily Abandon		
	61	Convert to Injection	Plug Back	Water Disposal ng date of any proposed work and ap		
testing has been of determined that the Due to the po	completed. Final Al the site is ready for f	bandonment Notices must be filed o inal inspection. rop at our surface, BP reques	only after all requirements, inclu	o oubjoot from	CONS. DIV DIST. 3	
SW131					AUG 2 5 2017	
A O A	CTION DOES NO PERATOR FRO!	L OR ACCEPTANCE OF THIS OT RELIÈVE THE LESSEE AI M OBTAINING ANY OTHER N REQUIRED FOR OPERATIO D INDIAN LANDS	ND	SEE ATTACHED FOR CONDITIONS OF APPROVAL		
	that the foregoing is	Electronic Submission #385	515 verified by the BLM We	Il Information System		
14. I hereby certify		tted to AFMSS for processing		NI on 08/22/2017 (17AE0309SE)	
		DLVIN	Title REGU	LATORY ANALYST		
14. I hereby certify Name (Printed/Ty						
		Submission)	Date 08/22/2	2017		
Name (Printed/Ty	yped) TOYA CO	,	Date 08/22/2			
Name (Printed/Ty Signature	(Electronic S	THIS SPACE FOR	FEDERAL OR STATE		Date 08/22/2	
Name (Printed/Ty Signature Approved ByABE Conditions of approva certify that the applica	(Electronic S (Electronic S (Electronic S (ELGADIR ELM) al, if any, are attache ant holds legal or equ	THIS SPACE FOR	FEDERAL OR STATE	OFFICE USE	Date 08/22/2	
Name (Printed/Ty Signature Approved ByAB Conditions of approva certify that the applica which would entitle th Title 18 U.S.C. Sectio	(Electronic S (Electronic S (Electronic S (Electronic S (Electronic S (Electronic S) (Electronic	THIS SPACE FOR ANDANI d. Approval of this notice does not uitable title to those rights in the sub act operations thereon.	FEDERAL OR STATE TitlePETROLI warrant or oject lease Office Farming ne for any person knowingly and	OFFICE USE EUM ENGINEER gton d willfully to make to any department	Date 08/22/2 nt or agency of the United	
Name (Printed/Ty Signature Approved By ABE Conditions of approva certify that the applica which would entitle th Title 18 U.S.C. Sectio	(Electronic S (Electronic S DELGADIR ELM al, if any, are attache ant holds legal or equ e applicant to condu in 1001 and Title 43 itious or fraudulent :	THIS SPACE FOR ANDANI d. Approval of this notice does not uitable title to those rights in the sub act operations thereon. U.S.C. Section 1212, make it a crin statements or representations as to a	FEDERAL OR STATE TitlePETROLE warrant or oject lease Office Farming ne for any person knowingly and iny matter within its jurisdiction	OFFICE USE EUM ENGINEER gton d willfully to make to any department	nt or agency of the United	

-

PLUG AND ABANDONMENT PROCEDURE

August 21, 2017

Moncrief Federal #1

West Kutz Pictured Cliffs 1450 FNL and 1190' FEL, Section 22, T29N, R12W San Juan County, New Mexico / API 30-045-08084

-Cut off existing P&A marker. MI and RU.

-Install wellhead. Monitor casing for gas.

-PU drill collar(s) and power swivel. Drill out cement to appropriate depth (top of Kirtland at 470').

-RU Wireline and run CBL from top of drill out to surface.

-Based on CBL review and perforate at appropriate depth and establish circulation.

-If able to establish circulation mix and pump cement to surface; circulating good cement

out casing and annulus. SI well and hestitate squeeze until well locks up.

-If unable to establish circulation then Spot Plug to isolate the Kirtland and Ojo Alamo top. WOC and tag. -Based on CBL perforate 4 squeeze holes at _____. Establish circulation. Spot Plug.


-Mix and pump cement to surface; circulating good cement out casing and annulus.

-SI with pressure and WOC. If cement is at surface set P&A marker. RD and MOL.

-Si with pressure and wood, in cement is at sunace set if an market. The an


-If cement is not at surface then contact operator for further instructions.


As Plugged 6/30/17

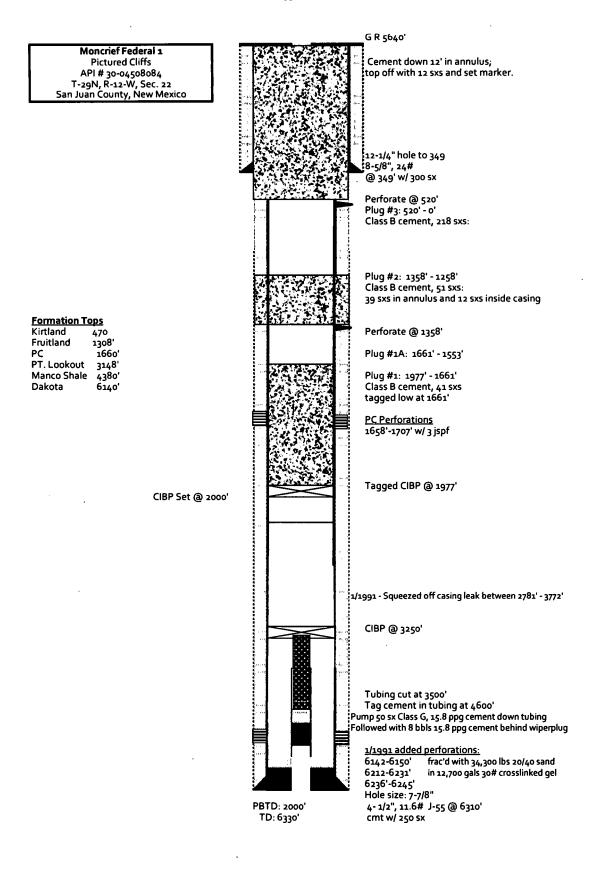





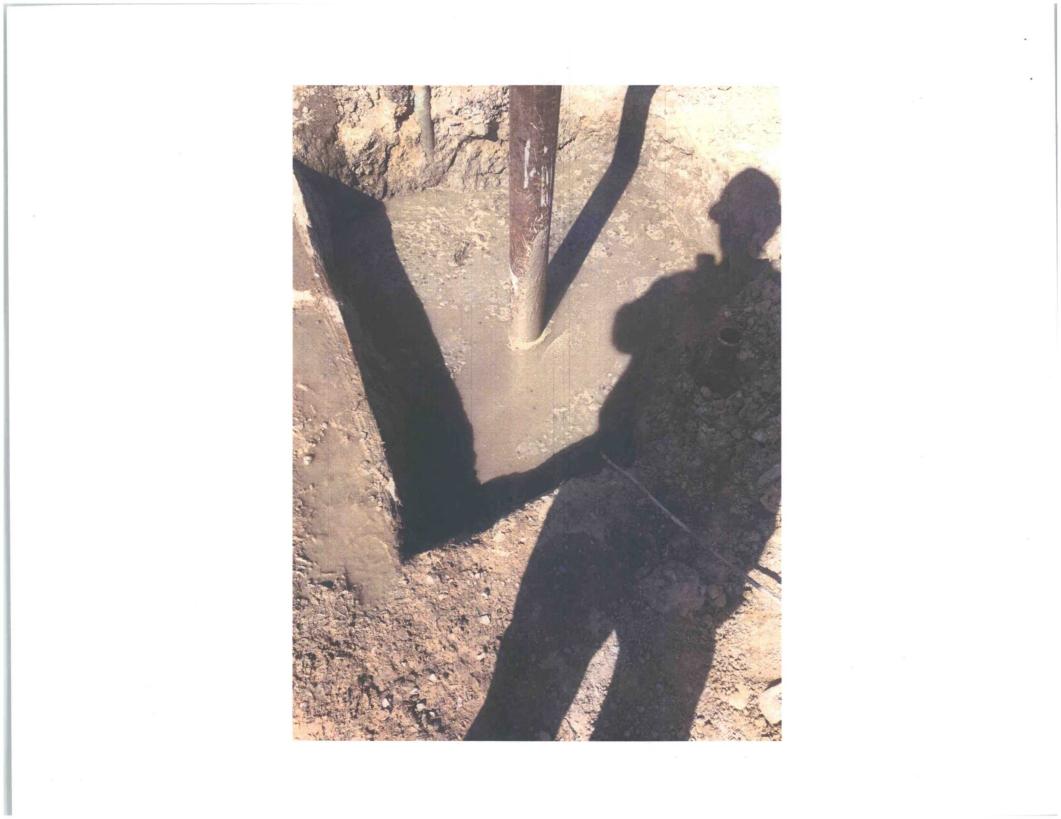

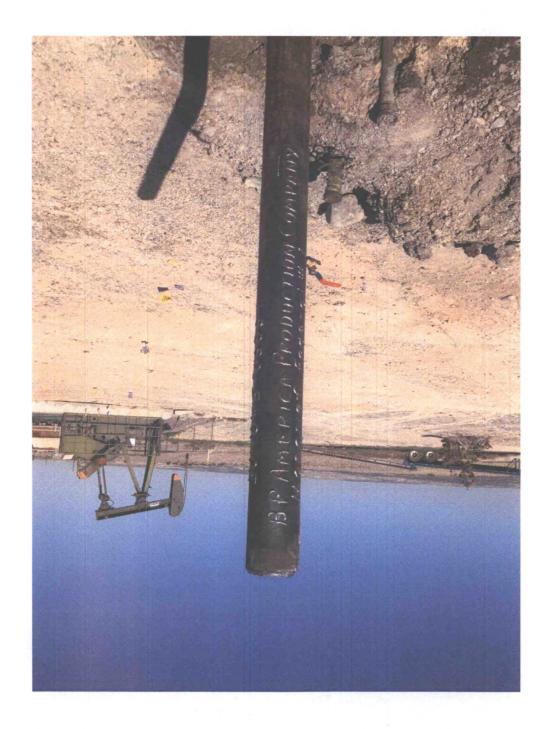

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE 6251 COLLEGE BLVD.

FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: Moncrief Federal #1

<u>CONDITIONS OF APPROVAL</u>

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.