State of New Mexico Energy, Minerals and Natural Resources Department

Susana Martinez Governor

Ken McQueen Cabinet Secretary

Matthias Sayer Deputy Cabinet Secretary Heather Riley, Division Director Oil Conservation Division



New Mexico Oil Conservation Division approval and conditions listed below are made in accordance with OCD Rule 19.15.7.11 and are in addition to the actions approved by BLM on the following 3160-4 or 3160-5 form.

Operator Signature Date: 5-14-18

Well information:

API WELL#	Well Name	Well #	Operator Name	Туре	Stat	County	Surf_Owner	UL	Sec	Twp	N/S	Rng W/E
30-039-21340- 00-00	SAN JUAN 29 5 UNIT		HILCORP ENERGY COMPANY	G		Rio Arriba	F	I	7	29	Ν	5 W

Applic	ation Type:
11	P&A Drilling/Casing Change Location Change
	Recomplete/DHC (For hydraulic fracturing operations review EPA Underground injection control Guidance #84; Submit Gas Capture Plan form prior to spudding or initiating recompletion operations) Other:
	Unier.

Conditions of Approval:

- Notify OCD 24hrs prior to beginning operations.
- Submit CBL to the Agencies for review and approval prior to perforating.
- If remedial cement is needed notify the agencies of Hilcorp's proposed plan so it can be reviewed and approved prior to the work being performed.

Brand Dell

5/29/18

NMOCD Approved by Signature

Date

Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

RECEIVED

FORM APPROVED OMB No. 1004-0137

Expires: July 31, 2010

5-Lease Serial Noticed Offins F078277

SUNDRY NOTICES AND REPORTS (Do not use this form for proposals to drill abandoned well. Use Form 3160-3 (APD) for	6. If Indian, Allottee or Tribe Name				
SUBMIT IN TRIPLICATE - Other instructions	on page 2.	7. If Unit of CA/Agreement, Name and/or No.			
1. Type of Well Oil Well X Gas Well Other		8. Well Name and No. San Juan 29-5 Unit 7A			
2. Name of Operator		9. API Well No. 30-039-21340			
Hilcorp Energy Company 3a. Address 3b. Pho	ne No. (include area code)	10. Field and Pool or Exploratory Area			
382 Road 3100, Aztec, NM 87410	505-599-3400	Gobernador PC/Blanco Mesaverde			
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) Surface Unit I (NESE) 1700'FSL & 810' FEL, Sec	c. 7, T29N, R05W	11. Country or Parish, State Rio Arriba , New Mexico			
12. CHECK THE APPROPRIATE BOX(ES) TO INI	DICATE NATURE OF NO	TICE, REPORT OR OTHER DATA			
TYPE OF SUBMISSION	TYPE OF AC	TION			
Alter Casing Fra	cture Treat	Production (Start/Resume) Water Shut-Off Reclamation Well Integrity			
		Recomplete Other			
		Water Disposal			
Attach the bond under which the work will be performed or provide the Bond No. following completion of the involved operations. If the operation results in a multi-Testing has been completed. Final Abandonment Notices must be filed only after determined that the site is ready for final inspection.) Hilcorp Energy Company plans to recomplete the subjection with the existing Mesaverde. Attached is the PC C102, application will be submitted and approved prior to consumption of APPROVAL SEE ATTACHED FOR CONDITIONS OF APPROVAL	ect well in the Picture recomplete procedur mmingling. A Closed	tin a new interval, a Form 3160-4 must be filed once amation, have been completed and the operator has d Cliffs formation and downhole commingle to & wellbore schematic. The DHC			
Tammy Jones	Title Operations/	Regulatory Technician - Sr.			
Signature Tommy Jones	Date 6/14/	2018			
THIS SPACE FOR FEI	DERAL OR STATE OF	FICE USE			
Approved by Conditions of approval, if any, are attached. Approval of this notice does not warrant of that the applicant holds legal or equitable title to those rights in the subject lease which entitle the applicant to conduct operations thereon. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any	n would Office	to make to any department or agency of the United States any			

(Instruction on page 2)

false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 **District III**

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division

August 1, 2011 Permit 252382

Form C-102

Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-039-21340	2. Pool Code 77440	3. Pool Name GOBERNADOR PICTURED CLIFFS (GAS)
4. Property Code 318837	5. Property Name SAN JUAN 29 5 UNIT	6. Well No. 007A
7. OGRID No. 372171	8. Operator Name HILCORP ENERGY COMPANY	9. Elevation 6517


10. Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
1	7	29N	05W		1700	S	810	E	RIO ARRIBA

11. Bottom Hole Location If Different From Surface

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
12. Dedicated A 320			13. Joint or Infill		14. Consolidatio	n Code		15. Order No.	

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

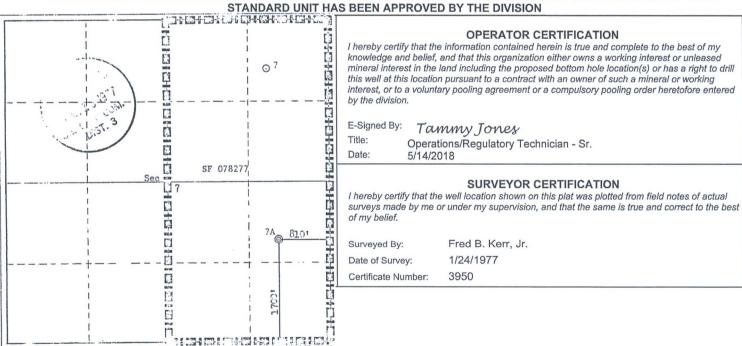




HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 7A PICTURED CLIFFS RECOMPLETION SUNDRY

JOB PROCEDURES

- 1. MIRU service rig and associated equipment; test BOP.
- 2. TOOH with 2 3/8" tubing set at 5,732'.
- 3. Set a 4-1/2" cast iron bridge plug at +/- 3,900' to isolate the Mesa Verde.
- 4. RU Wireline. Run CBL. Record Top of Cement.
- 5. Load the hole and pressure test the casing to frac pressure.
- 6. N/D BOP, N/U frac stack and test frac stack to frac pressure.
- 7. Perforate and frac the Pictured Cliffs in a single stage (Top Perforation @ 3,477'; Bottom Perforation @ 3,580').
- 8. Isolate frac stage with a composite bridge plug.
- 9. Nipple down frac stack, nipple up BOP and test.
- 10. TIH with a mill and drill out top Pictured Cliffs isolation plug.
- 11. Clean out to Mesa Verde isolation plug and, when water and sand rates are acceptable, flow test the Pictured Cliffs.
- 12. Drill out Mesa Verde isolation plug and cleanout to PBTD of 5,771'. TOOH.
- 13. TIH and land production tubing. Get a commingled Mesa Verde/Pictured Cliffs flow rate.



HILCORP ENERGY COMPANY SAN JUAN 29-5 UNIT 7A PICTURED CLIFFS RECOMPLETION SUNDRY

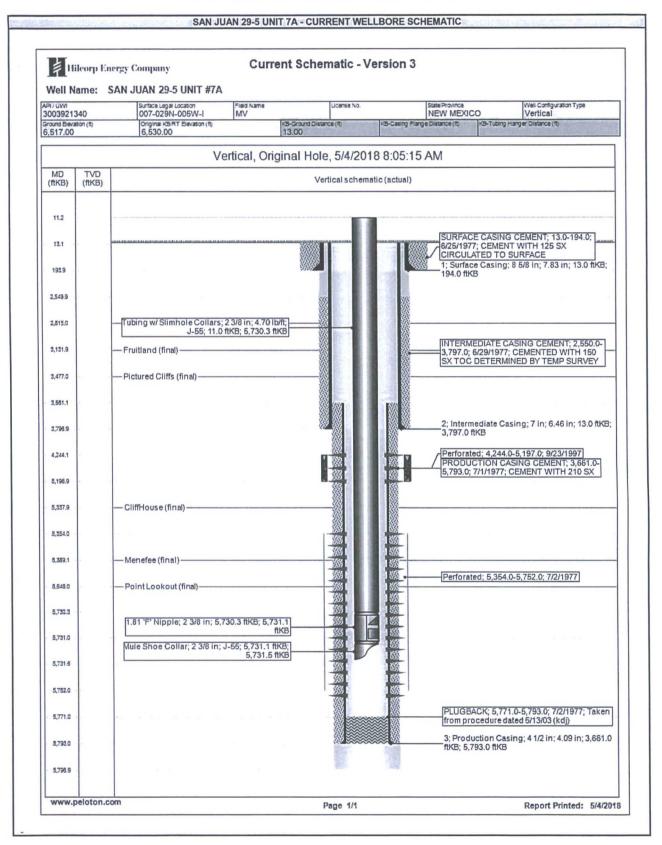



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Farmington District Office 6251 College Blvd. - Suite A Farmington, New Mexico 87402 www.blm.gov/nm



CASING REPAIR, WORKOVER, AND RECOMPLETION CONDITION OF APPROVAL

- 1. If casing repair operations are needed, obtain prior approval from this office before commencing repairs.
- 2. If a CBL or other logs are run, provide this office with a copy.
- 3. After any casing repair operations, test cement squeeze to a minimum of 500# for 30 minutes with no more than 10 % pressure fall off in the 30 minutes test period. Provide test chart with your subsequent report of operations
- 4. A properly functioning BOP and related equipment must be installed prior to commencing workover, casing repair, and/or recompletion operations.
- 5. Contact this office at (505) 564-7750 prior to conducting any cementing operations

SPECIAL STIPULATIONS:

- 1. Pits will be fenced during work-over operation.
- 2. All disturbance will be kept on existing pad.
- 3. All pits will be pulled and closed immediately upon completion of the recompletion and work-over activities.
- 4. Pits will be lined with an impervious material at least 12 mils thick.