Form 3160-5

### UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED

OMB No. 1004-0137 (August 2007) BUREAU OF LAND MANAGEMENT mington Field O Expires: July 31, 2010 5. Lease Serial No. Bureau of Land Manag SF-078503 SUNDRY NOTICES AND REPORTS ON WELLS 6. If Indian, Allottee or Tribe Name Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2. 7. If Unit of CA/Agreement, Name and/or No. 1. Type of Well San Juan 29-7 Unit Oil Well X Gas Well Other 8. Well Name and No. San Juan 29-7 Unit 114 2. Name of Operator 9. API Well No. **Hilcorp Energy Company** 30-039-21747 3a. Address 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area 505-599-3400 382 Road 3100, Aztec, NM 87410 Blanco Mesaverde / Basin Dakota 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. Country or Parish, State Surface Unit K (NESE) 2020' FSL & 1470' FWL, Sec. 33, T29N, R07W Rio Arriba **New Mexico** 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION X Notice of Intent Production (Start/Resume) Water Shut-Off Acidize Deepen Reclamation Well Integrity Alter Casing Fracture Treat Subsequent Report Casing Repair New Construction X Recomplete Other Change Plans Plug and Abandon Temporarily Abandon Final Abandonment Notice Convert to Injection Plug Back Water Disposal Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once Testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.) Hilcorp Energy Company plans to recomplete the subject well in the Mesaverde formation and downhole commingle with the existing Dakota. Attached is the MV C102, recomplete procedure & wellbore schematic. The DHC application will be submitted and approved prior to commingling. A closed loop system will be utilized. Interim reclamation will be performed after surface disturbing activities. This well is pending approval of well density exemption. SEE ATTACHED FOR MMOCD CONDITIONS OF APPROVAL DISTRICT III 14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) **Christine Brock** Operations/Regulatory Technician - Sr. Vistino Keloc

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify

Office

Title

that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department of agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

Approved by

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

District II 811 S. First St., Artesla, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV** 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico **Energy, Minerals and Natural** Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

August 1, 2011

Permit 268066

### WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number	2. Pool Code	3. Pool Name
30-039-21747	72319	BLANCO-MESAVERDE (PRORATED GAS)
4. Property Code	5. Property Name	6. Well No.
318713	SAN JUAN 29 7 UNIT	114
7. OGRID No.	8. Operator Name	9. Elevation
372171	HILCORP ENERGY COMPANY	6623

10 Surface Location

			,									
- 11	UL - Lot	Section	- 1	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County	
н.			ചി									
- 1			331	29N	07W		2020	S	1470	W	I RIO I	
	-	1	1			l		_		, , , , ,		
		1	- 1						•		I ARRIBA I	
		1									rutitori	

11. Bottom Hole Location if Different From Surface

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
	L								
12. Dedicated Acres 320.00 W/2			13. Joint or Infili		14. Consolidatio	n Code		15. Order No.	

### NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

•.	

### **OPERATOR CERTIFICATION**

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Li Musture Bross
Title: Operation/Regulatory Tech Sr.

Date: 5/31/2019

#### **SURVEYOR CERTIFICATION**

surveys made by me or under my supervision, and that the same is true and correct to the best of my belief. I hereby certify that the well location shown on this plat was plotted from field notes of actual

Surveyed By:

Fred B. Kerr

Date of Survey:

2/10/1978

Certificate Number:




# HILCORP ENERGY COMPANY San Juan 29-7 Ut #114 MESA VERDE RECOMPLETION NOI

API#: 30-039-21747

### **JOB PROCEDURES**

- 1. MIRU Service rig and associated equipment, test BOP. Check Bradenhead pressures daily and record throughout the recomplete project. Notify NMOCD and BLM if any anomalous pressures changes occur on the Bradenhead.
- 2. TOOH w/ 2 3/8" tubing set at 7733'.
- 3. Set initial CIBP at 7556' or deeper (no higher than 50' above existing perforations)
- 4. Perform MIT from initial CBP, providing 24 hr notice to BLM and NMOCD. Once completed, review and submit the MIT charted test results to both the NMOCD and BLM If the MIT fails, discuss and gain approval with both the NMOCD and BLM with a plan of action to remediate the wellbore. Perform a 2nd MIT once remediated.
- 5. Run CBL and submit it to NMOCD and BLM to confirm calculated TOCs.
- 6. Optionally set bridge plug below intended recomplete interval.
- 7. ND BOP, NU frac stack. Pressure test the production casing or frac string and frac stack to maximum frac pressure. The pressure test will not exceed 85% of the internal yield pressure rating of the primary treatment string.
- 8. Perforate and frac the Mesa Verde within 4864'-6019'.
  - a. Note: Base is determined as 500' from 5519' top of Point Lookout.
- 9. Optionally set a kill plug above recomplete interval for casing fracs.
- 10. ND the frac stack, NU the BOP and test.
- 11. MU and TIH with a mill. Tag and drill out the top isolation plug and Mesa Verde frac plugs if applicable.
- 12. Clean out the wellbore to the top of the Dakota isolation plug.
- 13. Once water and sand rates are acceptable, drill out the Dakota isolation plug and cleanout to PBTD of 7823'. TOOH.
- 14. TIH and land production tubing. Get a commingled Dakota/MV flow rate.

### **Wellbore Schematic:**

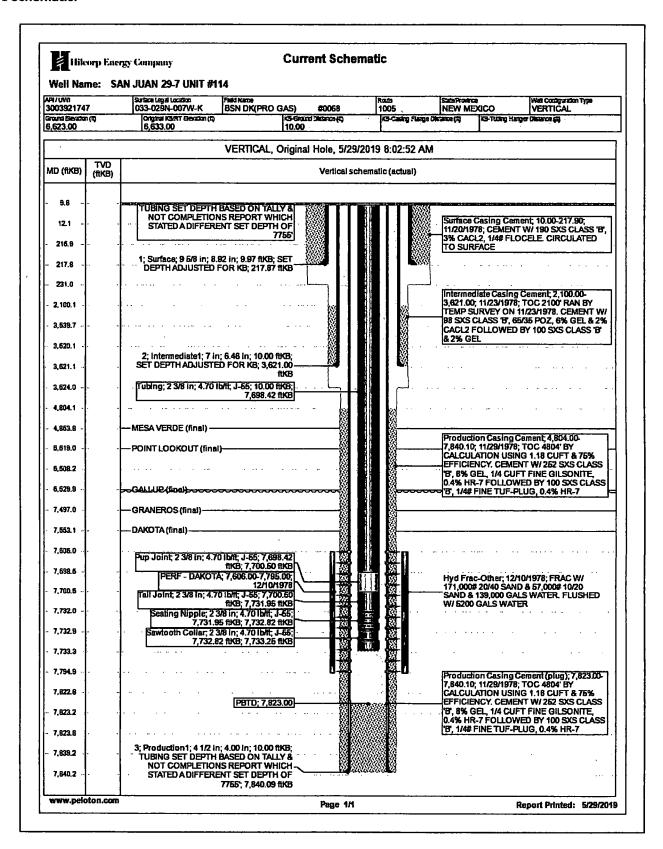

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intent to Recomplete & Commingle

Well:

San Juan 29-7 Unit 114 30-039-21747

### **CONDITIONS OF APPROVAL**

1. Contact BLM Inspection and Enforcement @ (505) 564 - 7750, 24 hours prior to conducting MIT work so an inspector can be present to witness the MIT.

Contact John Hoffman, Petroleum Engineer @ (505) 564 – 7742 to discuss any failed MIT results and/or your remedial action and isolation plans.

Submit the electronic copy of the MIT Test Chart and CBL for verification to the following addresses: <a href="mailto:jhoffman@BLM.gov">jhoffman@BLM.gov</a> and <a href="mailto:Brandon.Powell@state.nm.us">Brandon.Powell@state.nm.us</a>.

- 2. The following modifications to your recompletion program are to be made:
  - a) Upon rigging up, record Bradenhead pressure and monitor same during recompletion operations. Notify BLM and NMOCD if anomalous pressure changes occur. Provide monitoring results in the subsequent Report of Operations.
  - b) Casing pressure test for fracture stimulation operations cannot exceed the internal yield strength of the casing including a 20% safety factor unless a waiver is granted. Stimulation operations cannot exceed this test pressure.
  - c) CIBP for base of fracture stimulation to be set less 50' above top existing perforation.
- 3. File well test and recompletion results within 30 days of completing recompletion operations.