

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

14-29-0603-1692

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Navajo Allotted

7. UNIT AGREEMENT NAME

Torreon Working Interest

8. FARM OR LEASE NAME

Torreon

9. WELL NO.

1

10. FIELD AND POOL, OR WELDCAT

Wildcat

11. SEC., T., R., E., OR BLK. AND
SURVEY OR AREA

See 12, 18-N, 5-W

12. COUNTY OR PARISH, 13. STATE

McKinley New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
Gulf Oil Corporation

3. ADDRESS OF OPERATOR
Box 670, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

(PLEASE CONSIDER THIS INFORMATION CONFIDENTIAL)

2060' FSL & 2190' FEL, Section 12, 18-N, 5-W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6581' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON*

SHOOTING OR ACIDIZING

ABANDONMENT*

REPAIR WELL

CHANGE PLANS


(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and some pertinent to this work.)*

Drilled 11" hole to 4200'. Ran 44 joints, 1381' of 8-5/8" OD 32# K-55 ST&C casing and 89 joints, 2782' of 8-5/8" OD 24# K-55 ST&C casing. Total of 133 joints, 4163'. Set casing at 4179' with DV tool at 1880'. Cemented first stage through shoe with 700 sacks of Class C with 4% gel, .2% CFR-2 and 100 sacks of Class C Neat. Cemented second stage through DV Tool with 850 sacks of Class C with 4% gel, .2% CFR-2. IS indicated TOC on first stage at 2525' and on second stage at 405'. WOC 23 hours. Tested casing with 1500#, 30 minutes, OK.

Started drilling 7-7/8" hole at 4200' at 4:15 PM, June 4, 1970.

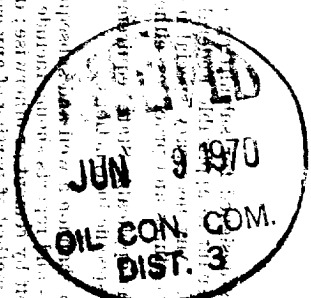

18. I hereby certify that the foregoing is true and correct

SIGNED Orig signed by E.W.Sands

TITLE Production Superintendent

DATE June 5, 1970

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by the local Federal and/or State office.

Item 4: If there are applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of a abandoned well should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid content; not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing plugs; and the depth to top of any left in the hole, method of closing top of well, and date well shall be conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1954 O-685229

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
UNITED STATES

SUNDRY NOTICES AND REPORTS ON WELLS

(This form is to be filled out by the operator in accordance with the State requirements. The information should be furnished to the local Federal and/or State office.)

1. NAME OF OPERATOR: Box 677, Hobbs, New Mexico 58100

2. ADDRESS OF OPERATOR: Box 677, Hobbs, New Mexico 58100

3. LOCATION OF WELL (Indicate location clearly and in accordance with the State requirements. See also page 11 below.)
Section 18, T18N, R18W, S18E, Hobbs, New Mexico

4. TITLE OF WELL (Show whether water well, etc.)
Water well

5. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TO BE SUBMITTED TO FEDERAL AGENCY

<input type="checkbox"/>	PROPOSAL TO ABANDON WELL
<input type="checkbox"/>	REPORT ON ABANDONMENT
<input type="checkbox"/>	REPORT ON CLOSING TOP OF WELL
<input type="checkbox"/>	REPORT ON OTHER DATA

6. STATE OF NEW MEXICO

7. COUNTY OF Hobbs

8. TOWNSHIP OF T18N

9. RANGE OF R18W

10. SECTION OF S18E

11. PERMIT NO. _____

12. DATE OF SUBMISSION TO FEDERAL AGENCY _____

13. SIGNATURE OF OPERATOR _____

14. TITLE OF OPERATOR _____

15. APPROVED BY _____

16. DATE OF APPROVAL _____

17. COMMENTS ON APPROVAL _____