

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.  
5. LEASE DESIGNATION AND SERIAL NO.  
N00-C-14-20-4305  
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐  
2. NAME OF OPERATOR  
Basin Fuels, Inc.  
3. ADDRESS OF OPERATOR  
152 Petroleum Center Bldg., Farmington, N. Mexico  
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface  
2310' FNL & 1650' FWL

14. PERMIT NO.  
15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
7039 GL & 7050 K.B.  
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
8, T17N, R8W  
12. COUNTY OR PARISH  
McKinley  
13. STATE  
N. Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐ PULL OR ALTER CASING ☐  
FRACTURE TREAT ☐ MULTIPLE COMPLETE ☐  
SHOOT OR ACIDIZE ☐ ABANDON\* ☐  
REPAIR WELL ☐ CHANGE PLANS ☐  
(Other) ☐


SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐ REPAIRING WELL ☐  
FRACTURE TREATMENT ☐ ALTERING CASING ☐  
SHOOTING OR ACIDIZING ☐ ABANDONMENT\* ☒  
(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

9-25-74: Rig up csg. pulling unit. Ran tbg. to 2830 ft. Spot 35 sk. cement plug over Dakota "D" open hole 2817 ft.-2831 ft. from 2494 ft.-2831 ft. Pull tbg. 9-26-74; Rig up csg. jack. Shoot off pipe at 821 ft. Pull 5½" csg. 9-27-74; Run tbg. to 916 ft. Spot 35 sk. cement plug from 736 ft.-916 ft. Pull tbg. Spot 15 sks. cement plug at surface. Install dry hole marker. Well P & A 9-27-74. Location will be cleaned and ready for inspection by 10-10-74. 5½" csg. stub at 821 ft. Cement spotted from 736 ft. to 916 ft. Well plugged as result of non-commercial production from Dakota "D" Zone.

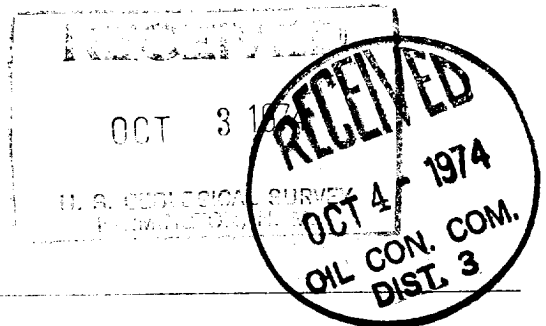

18. I hereby certify that the foregoing is true and correct

SIGNED Jack D. Cook  
(This space for Federal or State office use)

TITLE Agent

DATE 9-30-74

APPROVED BY  
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE