

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. Tribal #158 Tract #255 & 259
2. NAME OF OPERATOR Anacada Petroleum Corporation		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Gicarilla Apache
3. ADDRESS OF OPERATOR Box 1469, Durango, Colorado		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1250' SW and 890' NW, Sec. 9, T-23N, R-2W, Rio Arriba County, New Mexico. Southeast Lindrith Area.		8. FARM OR LEASE NAME Apache #1 Tract #2
14. PERMIT NO.		9. WELL NO. 1
15. ELEVATIONS (Show whether DF, RT, GR, etc.) GR-7301, DF-7310 & AB-7311		10. FIELD AND POOL, OR WILDCAT South Blanco - Pictured Cl.
		11. SEC. T. R. M., OR BLK. AND SURVEY OR AREA Sec. 9, 23N, 2W, 44E, Southeast Lindrith Area
		12. COUNTY OR PARISH Rio Arriba
		13. STATE New Mex.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐


Set Packer between zones

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6/13/64 - Killed well with 100 bbls. of water. Pulled 2-3/8" Tbg. . Ran 1 Jt. 2-3/8" Tbg. w/pen collar on bottom, 4 1/2" Halliburton R-3 Packer with 4' Sub on Top, then 96 Jts. 2-3/8" Tbg.. Packer Set @ 3015', Pen Collar @ 3047'. Set Packer between Kirtland and Pictured Cliffs Zones. After 1 run with swab, well started to flow. Flowed well thru Pictured Cliffs Perforations for 12 hrs.. Had a light spray of water. Tbg. Press. 25%, Csg. Press. 0%.

6/14/64 - After well was closed in for 12 hrs. Tbg. Press. 800%, Csg. Press. 0%. Opened well for 3 hrs.. Made a trace of water, Tbg. Press. 25%. Will take a test 6/16/64.

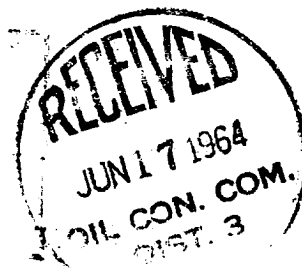

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Foreman

DATE

6/15/64

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.