

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

Jic. 167

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

J. Apache "I"

9. WELL NO.

7

10. FIELD AND POOL, OR WILDCAT

Pictured Cliffs

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 1, T23N, R3W

12. COUNTY OR PARISH 13. STATE

Rio Arriba

N.M.

1.

OIL ☐ GAS ☒
WELL WELL OTHER

2. NAME OF OPERATOR

Amerada Hess Corporation

3. ADDRESS OF OPERATOR

Drawer D, Monument, New Mexico 88265

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)

At surface

1760' FNL & 1840' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

7140' GR, 7152' DF

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

☐
☐
☐
☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

☐
☒
☒

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

☐
☐
☐

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*


Closed in fr. 11-4-79 to 2-29-80.

2-29-80 - Dresser Atlas ran GR log fr. 2117' to 2900'. Checked 2-7/8" csg. collars at 2958', 2989', 3054' & 3082' & perf. 2-7/8" csg. opposite Pictured Cliffs zone at 3009', 3010', 3012', 3013', 3015', 3018', 3021', 3022', 3024', 3027', 3028' w/2 SPF, total of 26 shots. CI.

3-5-80 - Dowell acidized Pictured Cliffs zone thru 2-7/8" csg. perf. fr. 3009' to 3028' w/1500 gal. 15% HCl acid w/additives using ball sealers. Dowell fractured w/555 bbls. gelled 1% KCl water, 1,753,380 SCF carbon dioxide & 76,000# sand in stages. Flowed & cleaned up to pit. CI 7 days.

3-20-80 - Opened to pit. Flow stabilized. Flowed dry gas at rate of 361 MCFPD on 24/64" choke, Flowing CP 140#.

Completion Report to follow.

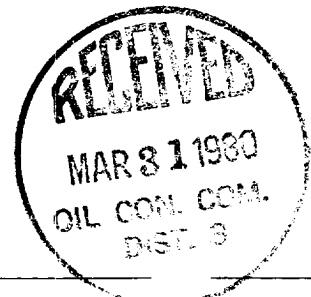

18. I hereby certify that the foregoing is true and correct

SIGNED

E.B. Fisher

TITLE Supv. Adm. Ser.

DATE

10-80

(This space for Federal or State office use)

ACCEPTED FOR RECORD

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

MAR 25 '80

state

MAR 24 1980

*See Instructions on Reverse Side

BY *CAF* DISTRICT

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.