

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

Jic. Cont. 440

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Jicarilla "C"

9. WELL NO.

1 (0-32)

10. FIELD AND POOL, OR WILDCAT

Undesignated

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 32, T.22N., R.5W.

12. COUNTY OR PARISH

Sandoval

13. STATE

New Mexico

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Union Oil Company of California

3. ADDRESS OF OPERATOR

P. O. Box 2620 - Casper, Wyoming 82601

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

660' FSL & 1980' FEL (SW SE)

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

7271' GR

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*


6330' T.D.

Plugged and abandoned subject well as follows: Laid down D.C. Ran D.P. open-ended and set plugs as follows:

Plug #1, 35 sacks at 6185-6085'
Plug #2, 35 sacks at 4900-5000'
Plug #3, 35 sacks at 3175-3275'
Plug #4, 35 sacks at 1625-1725'
Plug #5, 35 sacks at 1350-1450'

Displaced mud out of hole above top cement plug leaving water in casing.
Finished pulling out of hole with D.P. Installed Dry Hole Marker.

Well plugged and abandoned 1-14-73.

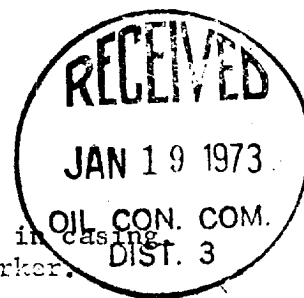

Above procedure approved verbally by Jerry Long, U.S.G.S., Durango, Colorado, on 1-12-73. Top cement plug at surface waived by Emmett Lynch, Bureau of Indian Affairs, Jicarilla Apache Indian Agency, Dulce, New Mexico.

18. I hereby certify that the foregoing is true and correct

SIGNED

R. G. Ladd, Jr.
R. G. Ladd, Jr.

TITLE

District Drilling Supt.

DATE

1-15-73

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY
FEDERAL BUREAU OF RESEARCH