

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.
14-08-0001-12395

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER Gas Storage

2. NAME OF OPERATOR
Southern Union Gas Company

3. ADDRESS OF OPERATOR
1402 Fidelity Union Tower, Dallas, Texas 75201

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
800' FNL & 300' FEL
Sec 18-T15N-R1E, NPM

7. UNIT AGREEMENT NAME
Las Milpas Gas Storage

8. FARM OR LEASE NAME
San Ysidro

9. WELL NO.
San Ysidro #1-17

10. FIELD AND POOL, OR WILDCAT
Las Milpas

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 18-T15N-R1E, NPM

12. COUNTY OR PARISH 13. STATE

Sandoval New Mexico

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
5691 ungraded elevation

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Drilled 12 1/4" surface hole to total depth of 516' RKB.
2. Ran 11 joints of 3 5/8, R-55, 24#, STQC casing. Casing landed at 516' RKB. Cemented with 280 sks class B plus 2% Cacl and 12 1/2" gilsonite. Plug down at 4:30 p.m. 7/14/75. Cement did not circulate. Ran 1" tubing to 49'. Cemented with 100 sks class B plus 2% Cacl. Cement circulated. Cement dropped 6". Cemented top with 15 sks class B.
3. Ripped up BOP and pressure tested surface casing and BOP to 500 psi for 30 minutes.
4. Drilled out from under surface casing with 7 7/8" hole on 7/15/75.

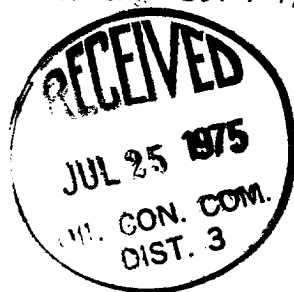

18. I hereby certify that the foregoing is true and correct

SIGNED R. G. Sharrock
R. G. Sharrock

TITLE Geologist

DATE 7/22/75

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.