

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. NOO-C-14-20-5358	
2. NAME OF OPERATOR CHACE OIL COMPANY, INC.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME NAVAJO	
3. ADDRESS OF OPERATOR 313 Washington S.E., Albuquerque, NM 87108		7. UNIT AGREEMENT NAME RUSTY NAVAJO	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit "A" 800' NL & 800' EL		8. FARM OR LEASE NAME RUSTY NAVAJO	
14. PERMIT NO.		9. WELL NO. #1	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6850' GR		10. FIELD AND POOL, OR WILDCAT RUSTY CHACRA	
		11. SEC. T., R., M. OR BLK. AND SURVEY OR AREA Sec. 23, T22N, R7W	
		12. COUNTY OR PARISH Sandoval	
		13. STATE N.M.	

16. Check: Appropriate Box To Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

2/5/76 Contractor, Gene Burson, buried approx. 900' drill collars and drill pipe in hole. Could only recover 150' drill pipe. Burson went in with 1½" tbg to top of drill pipe. Pumped in 60 sxs 50-50 posmix, pulled up to 70', 20 feet up in surface pipe and pumped in 50 sxs of Halliburton lite. Came out of hole with tubing and put 20' plug in top of surface pipe. Set dry hole marker.

Surface Rehabilitation & Seeding of this well location waived until well No. 1-X is P+A.

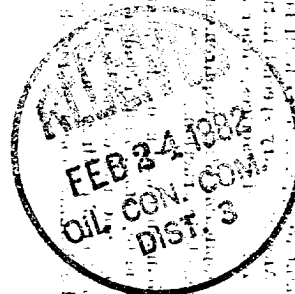

18. I hereby certify that the foregoing is true and correct

SIGNED <i>James F. Sims</i>	TITLE President	DATE 8-76-77
(This space for Federal use)		
APPROVED BY <i>James F. Sims</i>	TITLE	DATE
CONDITIONS OF APPROVAL FEB 23 1982		
FOR JAMES F. SIMS DISTRICT ENGINEER		

See Instructions on Reverse Side

NMOCC