

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY


SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R140

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER Wildcat
2. NAME OF OPERATOR
Bco, Inc.
3. ADDRESS OF OPERATOR
P.O. Box 669 Santa Fe, N.M. 87501
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface
790' FNL 790' FWL Sec 17 T22N R9W NMPM

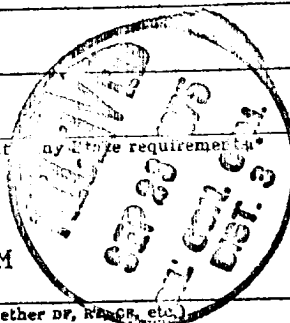

5. LEASE DESIGNATION AND SERIAL NO.
NM-5938
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Federal
9. WELL NO.
1
10. FIELD AND POOL, OR WILDCAT
Wildcat
11. SEC. T. R. M. OR BLK. AND SURVEY OR AREA
17-22N-9W NMPM
12. COUNTY OR PARISH
San Juan

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RFB, etc.)

GR 6424

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

SUBSEQUENT REPORT ON

☒ REPAIRING WELL
☒ ALTERING CASING
☒ ABANDONMENT

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

11-17-74 Ran cement bond log. New TD 3880. Perforated w/2SPF
3655-58; 3662-68; 3673-74; 3678-82; 3710-14; 3730-34;
3804-08; 3814-18; 3824-28; 3832-42

11-18-74 Set RBP on bottom, pulled up one joint and spotted 125
gals 28% HCL.

11-19-74 Set packer at 3762 and had communications with middle
perfs. Moved packer and acidized 3710 to 3842 with 1975
gals 28% HCL, and flushed w/600 gals water. Instant
shut in 900#'s. Swab tested. Set packer at 3636 and
RBP at 3695 and acidized with 900 gals 28% HCL and
flushed w/600 gals water. Instant shut in at 1400#'s.

11-20-75 Swab tested.

4-19-75 Swab tested. Had a little gas and no oil.

to
4-20-75

ATTACHMENTS: 1 copy of CBL run 11-17-74 to U.S.G.S.

18. I hereby certify that the foregoing is true and correct

SIGNED Harry R. Baggett TITLE President

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE 9-22-75