

P. O. Box 965
Farmington, New Mexico

September 5, 1956

Gulf Oil Corporation
c/o Lester LeFavour
Box 2097
Denver 1, Colorado

Re: Jicarilla Contract No. 59

Gentlemen:

Your "Subsequent Report of Abandonment" dated June 8,
1956 covering your well No. 3 Apache located in the SE $\frac{1}{4}$ SW $\frac{1}{4}$
sec. 16, T. 24 N., R. 5 W., N. M. P. M., Rio Arriba County,
New Mexico, is hereby approved.

Very truly yours,

(Orig. Sgd.) P. T. McGRATH

P. T. McGrath
District Engineer

PTMcGrath:al

Inspected by:
P.T. McGrath
September 2, 1956



COPY TO O. C. C.

11-11-11
11-11-11

11-11-11

11-11-11
11-11-11
11-11-11

11-11-11

11-11-11

11-11-11

11-11-11

11-11-11

11-11-11

11-11-11

11-11-11

11-11-11

11-11-11


11-11-11
11-11-11
11-11-11



COPY TO O.C.O.

(SUBMIT IN TRIPLICATE)

Indian Agency **Jicarilla**

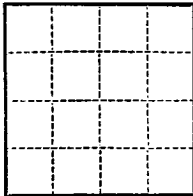

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____

Contract No. **69, Tract 131**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 8, 1956

Well No. **3** is located **990** ft. from **S** line and **1650** ft. from **E** line of sec. **18**
C NW SE SW, Section 18 **24 North** **5 West**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Otero-Pictured Cliffs **Rio Arriba** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **6472** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding, cementing points, and all other important proposed work)

The well was temporarily abandoned September 3, 1955, after swabbing 4 barrels fluid per hour, 90% water. FBID 2182', 5-1/2" casing set at 2102' with 100 sacks. Pulled tubing and re-ran with HOWCO 5-1/2" OD type DH squeeze packer set at 2090', 2' above perforations. Released tubing from packer and spotted 10 sacks Ideal cement on top of packer, filled up 2090' to 2010'. Ran Free Point Indicator by Dis-Log, found free point at 1475'. Cut 5-1/2" casing with jet casing cutter at 1475'. Spotted 10 sacks Ideal Portland cement by HOWCO on top of stub. Filled up 1475' to 1443'. Pulled casing stopping at 172', 15' below surface casing shoe. Spotted 10 sacks Ideal Portland cement by HOWCO from 172' to 140'. Finished pulling 5-1/2" casing. Spotted 10 sacks Ideal Portland cement in top of surface pipe, erected marker.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Gulf Oil Corporation**

Address **c/o Lester LaFavre**

Box 2097

Denver, 1, Colorado

By _____

Title **Area Superintendent of Production**

cc: **New Mexico Oil & Gas Conservation Commission (2)**
Jicarilla Indian Agency (1)

