

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form 9-531
Revised 1963

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR
Tenneco Oil Company

3. ADDRESS OF OPERATOR
P. O. Box 1714, Durango, Colorado 81301

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1850 FNL, 1150 FEL
Unit H

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
6610 Gr.

5. LEASE DESIGNATION AND NUMBER
Jicarilla Cont. 100

6. IF INDIAN, ALLOTTEE OR TRUST LAND
Jicarilla, Dulce, New Mexico

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Jicarilla 1150

9. WELL NO.
7

10. FIELD AND POOL, OR WILDCAT
South Blanco Tocito

11. SEC., T., R., M., OR BLM. AND
SURVEY OR AREA
Sec. 16, T-26-N, R-5-W

12. COUNTY OR PARISH
Rio Arriba

13. STATE
New Mexico

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	<input type="checkbox"/>	PULL OR ALTER CASING	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	MULTIPLE COMPLETE	<input checked="" type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	ABANDON*	<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	CHANGE PLANS	<input type="checkbox"/>
(Other)	<input type="checkbox"/>		<input type="checkbox"/>


SUBSEQUENT REPORT OF:

WATER SHUT-OFF	<input type="checkbox"/>	REPAIRING WELL	<input type="checkbox"/>
FRACTURE TREATMENT	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
SHOOTING OR ACIDIZING	<input type="checkbox"/>	ABANDONMENT*	<input type="checkbox"/>
(Other)	<input type="checkbox"/>		<input type="checkbox"/>

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

We plan to rig up and kill Dakota sand w/salt wtr. Pull tbq, set CIBP w/wireline. Perf two holes at 6880 and 2 holes at 6830. Set cmt retainer pkr, run tbq and set in pkr. Est circ through tbq, around csq and in perfs at 6830. Circ 250 gals acid ahead of cmt. Cmt w/100 sx. WOC. Drill out, pressure test, and load hole. Perf, frac. Run two strings 2-1/16" tbq. Complete as a dual Basin Dakota and South Blanco Tocito gas well. Run deliverability test.

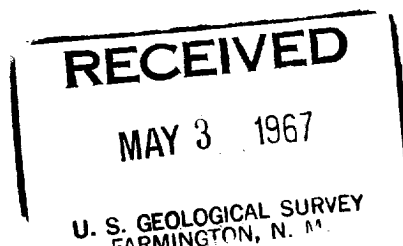

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Senior Production Clerk

DATE April 25, 1967

(This space for Federal or State-office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

5 UZGS
1 Cont
1 Atlantic

*See Instructions on Reverse Side